

# REPUBLIC OF THE PHILIPPINES DEPARTMENT OF PUBLIC WORKS AND HIGHWAYS

# CONSULTING SERVICES FOR THE ASSESSMENT AND DESIGN OF FUNCTIONAL ELEMENTS OF PUBLIC-SCHOOL BUILDINGS SELECTED FOR RETROFITTING AND STRENGTHENING/UPGRADING IN PREPARATION FOR "THE BIG ONE"


UNDER IBRD LOAN NO. 9251-PH: PHILIPPINES SEISMIC RISK REDUCTION AND RESILIENCE PROJECT

# **ENVIRONMENTAL AND SOCIAL MANAGEMENT PLAN (ESMP)**

(STA. LUCIA HIGH SCHOOL)

DEPED BUILDING

VICENTE P. EUSEBIO BUILDING

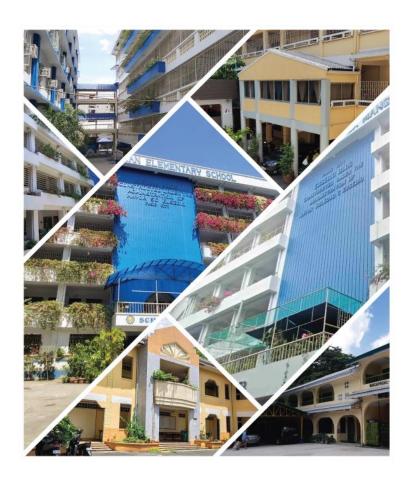

# **Table of Contents**

| 1 |     | Introd | luction   | 1  |
|---|-----|--------|---|----|
| 2 |     | Proje  | ct Description                                    | 1  |
|   | 2.  | 1 Pı   | oject Location                                    | 1  |
|   | 2.2 | 2 R    | etrofitting Works for Sta. Lucia High School      | 3  |
|   |     | 2.2.1  | Retrofitting Methodology                          | 3  |
|   |     | 2.2.2  | Projected Workforce                               | 3  |
|   | 2.3 | 3 Pı   | oject Activities and Schedule                     | 5  |
|   | 2.4 | 4 D    | escription of the Environment                     | 6  |
|   |     | 2.4.1  | Pasig City  | 6  |
|   |     | 2.4.2  | Santa Lucia High School                           | 12 |
| 3 |     | Poter  | itial Environmental and Social Impacts            | 18 |
|   |     | 3.1.1  | Land  | 18 |
|   |     | 3.1.2  | Water   | 18 |
|   |     | 3.1.3  | Air Quality, Noise, and Vibration                 | 18 |
|   |     | 3.1.4  | People  | 19 |
| 4 |     | Envir  | onmental and Social Management Plan               | 20 |
| 5 |     | ESMF   | P Implementation                                  | 32 |
|   | 5.  | 1 In   | stitutional Plan                                  | 32 |
|   |     | 5.1.1  | DPWH-BSPMC-UPMO                                   | 32 |
|   |     | 5.1.2  | DepEd Schools Division Office (SDO) of Pasig City | 34 |
|   | 5.2 | 2 M    | onitoring and Reporting                           | 37 |
|   | 5.3 | 3 St   | takeholder Engagement Plan                        | 38 |
|   | 5.4 | 4 Di   | sclosure and Consultation                         | 40 |
|   | 5.  | 5 G    | rievance Redress Mechanism                        | 42 |
|   | 5.0 | 6 La   | abor Management Plan                              | 44 |
|   |     | 5.6.1  | Characteristics of Project Workers                | 44 |
|   |     | 5.6.2  | Age of Employment                                 | 44 |
|   |     | 5.6.3  | Terms and Conditions                              | 45 |
|   | 5.  | 7 W    | aste Management Plan                              | 47 |
|   | 5.8 | Tr 8   | affic Management Plan                             | 50 |
| 6 |     | Proje  | ct Timeline and Cost                              | 51 |
|   | 6.  | 1 S    | chedule and Implementation Budget                 | 51 |
|   |     | 6.1.1  | Project Duration                                  | 51 |
|   |     | 6.1.2  | Implementation Schedule                           | 51 |
|   |     | 6.1.3  | Indicative Budget for ESMP Implementation         | 51 |

# **LIST OF ANNEXES**

| ANNEX A<br>ANNEX B | World Bank Checklist<br>Student and Facilities Relocation Plan        |           |
|--------------------|---|-----------|
| ANNEX C            | Traffic Management Procedure  |           |
| ANNEX D            | Environment and Social Safeguard Site Instruction Form and Inspection | Checklist |
|                    |   |           |
|                    | LIST OF TABLES  |           |
| Table 2-1: Ge      | eneral Vicinity of Santa Lucia High School                            | 1         |
|                    | escription of Building Retrofitting Works                             |           |
|                    | anpower Requirement per Project Phase                                 |           |
|                    | tivities Involved in the Retrofitting Works                           |           |
|                    | nd Cover of Pasig City  |           |
|                    | eeks within Pasig City  |           |
| Table 2-7: Cli     | matological Data  | 7         |
| Table 2-8: De      | emographic Data of Pasig City (2020)                                  | 10        |
| Table 2-9: Ge      | ender and Age Profile of Pasig City (2020)                            | 10        |
|                    | load Inventory by System Classification (2021)                        |           |
|                    | lazard Assessment Report for Santa Lucia High School                  |           |
|                    | Conservation Status of Flora Species within the Study Area            |           |
|                    | vironmental and Social Management Plan for Santa Lucia High School    |           |
|                    | sks and Responsibilities for Safeguard Implementation                 |           |
|                    | akeholder Interactions During the Project Implementation              |           |
|                    | inducted Disclosure and Consultations                                 |           |
|                    | mmary of Issues, Concerns, Suggestions, and Agreements                |           |
|                    | aste Hierarchy Scheme – WMP Option and Strategies                     |           |
|                    | lid Waste Color-Coding Scheme   |           |
|                    | pected Project Duration   |           |
|                    | dicative Implementation Schedule                                      |           |
| Table 6-3: In      | dicative ESMP Implementation Budget for Sta. Lucia High School        | 53        |
|                    |   |           |
|                    | LIST OF FIGURES   |           |
|                    | ocation Map of Santa Lucia High School                                |           |
|                    | and Use Map of Pasig City (2015-2023)                                 |           |
|                    | and Cover Map of Pasig City (2020)                                    |           |
|                    | te Development Plan of Santa Lucia High School                        |           |
|                    | egetation in the Study Area   |           |
| -                  | ocation of Construction Activities and Proposed Mitigation Measures   |           |
| rigure 5-1: S      | ta. Lucia High School PSRRRP Organizational Structure                 | 36        |

Figure 5-2: Waste Hierarchy Scheme......47

#### LIST OF ACRONYMS

BCE Bobby C. Eusebio Building

CHSP Construction Safety and Health Program

CLUP Comprehensive Land Use Plan CNC Certificate of Non-Coverage

COVID-19 Coronavirus Disease
CR Critically Endangered
DAO DENR Administrative Order

dB Decibel
DD Data Deficient

DENR Department of Environment and Natural Resources

DepEd Department of Education
DO Department Order

DOLE Department of Labor and Employment
DPWH Department of Public Works and Highways
ECC Environmental Compliance Certificate
ECOP Environmental Codes of Practice
EHS Environment, Health, and Safety
EMB Environmental Management Bureau

EN Endangered EO Executive Order

ESMP Environmental and Social Management Plan

ESMF Environmental and Social Management Framework

ESS Environmental and Social Standards
ESSU Environmental and Social Safeguards Unit

FRP Fiber Reinforced Polymer
GBV Gender-based Violence
GRC Grievance Redress Committee
GRM Grievance Redress Mechanism
IATF Inter-Agency Task Force

IEC Information, Education and Communication
IUCN International Union for Conservation of Nature

LC Least Concern

LGU Local Government Unit

LMP Labor Management Procedure

LSEN Learners with Special Education Needs

NCR National Capital Region

NCCA National Commission for Culture and the Arts

NCCAP National Climate Change Action Plan NGO Non-governmental organization

NOx Nitrogen Oxide NT Near Threatened

NWMC National Wildlife Management Committee

NWRB National Water Resources Board
OSH Occupational Safety and Health
OTS Other Threatened Species
OWS Other Wildlife Species

PAGASA Philippine Atmospheric, Geophysical, and Astronomical Services Administration

PCMA Project Contract Management Application

PD Presidential Decree

PHIVOLCS Philippine Institute of Volcanology and Seismology

PHP Philippine Peso

PIU Project Implementation Unit

PM Particulate Matter

PMO Project Management Office

PPE Personal Protective Equipment

PRECUP Philippine Registry of Cultural Property

PSA Philippine Statistics Authority

PSRRRP Philippines Seismic Risk Reduction and Resiliency Project

RC Reinforced Concrete
RTR Roman T. Romulo Building
SCE Soledad C. Eusebio Building
SEP Stakeholder Engagement Plan

SO<sub>2</sub> Sulfur Dioxide

SVR Seismic Vulnerability Rating
TSP total suspended particulates
TWG Technical Working Group
USD United States Dollar

VPE Vicente P. Eusebio Building

VU Vulnerable WB World Bank

WMP Waste Management Plan

#### 1 INTRODUCTION

The **Philippines Seismic Risk Reduction and Resiliency Project (PSRRRP)**, a project financed by World Bank, aims to improve the safety and seismic resilience of public-school buildings in Metro Manila. Through structural strengthening and functional upgrades of public-school buildings, selected and prioritized based on a transparent, well-designed, cost-effective retrofitting approach, which will contribute to a reduction in the estimated impacts of earthquakes (particularly 'The Big One' scenario) on the portfolio of critical public-school facilities.

This document presents the Environmental and Social Management Plan (ESMP) of Santa Lucia High School that will undergo retrofitting which will comply with the local regulations and WB Environmental and Social Framework (ESF) requirements, and to address potential environmental and social (E&S) impacts of the project.

The project will comprise the retrofitting of 2 school buildings of Santa Lucia High School namely: (a) Vicente P. Eusebio (VPE) Building, and (b) DepEd Building. All retrofitting works will take place within the premises of Santa Lucia High School.

#### **2 PROJECT DESCRIPTION**

#### **2.1 PROJECT LOCATION**

Santa Lucia High School, with School Identification Number 305420, is located at #30 Tramo St., Rosario Village, Barangay Sta. Lucia, Pasig City, Metro Manila. As presented in **Table 2-1** and **Figure 2-1**, Santa Lucia High School is surrounded by residential areas.

Table 2-1: General Vicinity of Santa Lucia High School

| GENERAL DIRECTION | SENSITIVE<br>RECEPTOR  | NAME  | DISTANCE FROM SCHOOL       |
|-------------------|--|---|----------------------------|
| NORTH             | Residential Area<br>Institutional- Clinic                          | Barangay Sta. Lucia Health<br>Center                    | ~250 meters (NW)           |
| WEST              | Residential Area<br>Institutional- Church                          | Philippine Evangelical Friends<br>Christian Church      | ~60 meters                 |
| EAST              | Residential Area   |   |                            |
| SOUTH             | Residential Area<br>Institutional- Church<br>Institutional- School | St. Jude Thaddeus Parish<br>Martires Integrated Academy | ~100 meters<br>~101 meters |



Figure 2-1: Location Map of Santa Lucia High School

#### 2.2 RETROFITTING WORKS FOR STA. LUCIA HIGH SCHOOL

#### 2.2.1 Retrofitting Methodology

For the buildings identified in Santa Lucia High School, **Concrete Jacketing** and **FRP Systems** will be adopted. The methodology for each type of structural building retrofitting works is provided in **Table 2-2**.

Table 2-2: Description of Building Retrofitting Works

| TYPE   | DESCRIPTION/METHODOLOGY   |
|--|---|
| Concrete Jacketing                           | This method is used for poorly detailed or damaged reinforced concrete (RC) members whereby RC jackets are applied around the structural elements. The RC jackets provide increase strength, stiffness, and overall enhancement of structural performance. This is frequently used prior to or after damage of RC members such as beams, columns, and joints. Shotcrete overlay is used on the surface of an existing RC member with an outer assembled reinforcement cage. Shotcrete jacketing can be used in lieu of conventional cast-in-place concrete jackets because of its potential to achieve good bond strength and low permeability. It is also known that the shotcrete process is more versatile than common concrete placement and can be applied in very difficult or complex sections where conventional concrete formwork would prove difficult, cost-prohibitive, or even impossible. |
| Fiber Reinforced<br>Polymer (FRP)<br>Systems | The FRP materials are composed of high-strength fibers embedded in a polymeric matrix. The fibers (which have very small diameters and are considered continuous) provide the strength and stiffness of the composite, while the matrix separates and disperses the fibers. In concrete strengthening applications, the fibers are typically carbon (graphite), glass, or aramid, and the matrices are typically epoxy. FRP is extremely versatile and is quickly and easily installed, reducing the downtime and disruption during retrofit.   |

Considering the functional upgrade of the school buildings, activities related to architectural, electrical, mechanical, and sanitary will also be conducted.

#### 2.2.2 Projected Workforce

The number of workforces in the project site may vary depending on the specific activities. **Table 2-3** provides the manpower requirements per project phase.

**Table 2-3: Manpower Requirement per Project Phase** 

| PROJECT<br>PHASE     | ESTIMATED<br>MANPOWER<br>REQUIREMENT | TASKS TO BE PERFORMED  | SKILLS<br>REQUIREMENT  |
|----------------------|--------------------------------------|--|--|
| Pre-<br>Construction | ~100                                 | <ul> <li>Prepare detailed engineering<br/>designs and drawings</li> <li>Facilitate permit requirements and<br/>tender documents</li> </ul>                                     | Specialized technical skills/expertise on various engineering and scientific fields. |
| Construction         | ~50                                  | <ul> <li>Perform civil, architectural, and electro-mechanical works</li> <li>Oversee the entire operations of the proposed project, including emergency situations,</li> </ul> | <ul><li>Project Engineers</li><li>Foreman</li></ul>                                  |

| PROJECT<br>PHASE      | ESTIMATED<br>MANPOWER<br>REQUIREMENT | TASKS TO BE PERFORMED   | SKILLS<br>REQUIREMENT                       |
|-----------------------|--------------------------------------|---|---|
|                       |                                      |   | <ul> <li>Non-skilled<br/>workers</li> </ul> |
|                       |                                      | <ul> <li>Ensuring the safety and welfare of its personnel</li> <li>Maintain conformity of the proposed project to relevant government regulations, including Occupational Health and Safety.</li> <li>Promote and uphold a harmonious relationship with the host community</li> </ul> |   |
| Post-<br>Construction | ~11                                  | <ul> <li>Restoration of disturbed areas<br/>(e.g., classrooms, offices, plant<br/>boxes)</li> <li>Site clearing including of removal<br/>temporary facilities</li> </ul>  |   |

**DPWH and its Contractors** will adhere to Republic Act No. 6685 of 1998 entitled, "An Act Requiring Private Contractors to Whom National, City and Municipal Public Works Projects Have Been Awarded Under Contract To Hire At Least Fifty Percent of the Unskilled and At Least Thirty Percent of the Skilled Labor Requirement to be Taken From the Available Bona Fide Residents in the Province, City, or Municipality in Which the Projects are to be Undertaken, and Penalizing Those Who Fail to Do So" as well as Republic Act No. 9710 or the "Magna Carta on Women", through the issuance of Department Order No. 130 series of 2016.

**Guidelines for the Implementation of the Provisions of Republic Act No. 6685 and Republic Act No. 9710 or the Magna Carta on Women.** Pursuant to Section 7 of RA No. 6685 and MCW, the following implementing rules and regulations are issued accordingly:

- a. The mandatory minimum percentage of 50% of unskilled labor requirement shall be recruited and be equally accessible to both women and men.
- b. The mandatory minimum 30% of the skilled labor requirement shall be recruited and be equally accessible to both women and men.

The conditions for items a. and b. were as follow:

- i. First priority shall be recruited from the unemployed bona fide residents of the locality/barangay where the project is being undertaken who are ready, willing, and able as determined/certified by the City/Municipal Mayor concerned;
- ii. If the un/skilled labor requirement is not fully met by the recruitment pursuant to item i. above, the deficiency shall be recruited from the unemployed bona fide residents of neighboring barangays of the city/municipality where the project is being undertaken who are ready, willing, and able as determined/certified by the City Mayor concerned; and
- iii. If still the un/skilled labor requirement is not fully satisfied after the recruitment pursuant to items i. and ii., then the deficiency shall be recruited from the unemployed

bona fide residents of the city where the project is being undertaken who are ready, determined/certified by the mayor.

iv. In case of a project traversing two or more barangays/ municipalities/ cities/ provinces, the labor requirement shall be recruited proportionately from the localities traversed by the project.

**DPWH** shall also purposively employ women, to comprise at least 20% of the total workforce in skilled or unskilled positions, in various phases and stages of construction/civil work, form planning, design, pre-construction and construction and maintenance of a public works project.

Republic Act No. 10524 defines equal opportunity for employment as "no person with disability shall be denied access to opportunities for suitable employment. A qualified employee with disability shall be subject to the same terms and conditions of employment and the same compensation, privileges, benefits, fringe benefits, incentives, or allowances as a qualified able-bodied person".

#### 2.3 PROJECT ACTIVITIES AND SCHEDULE

Once the detailed engineering design is approved, bidding for the contractor will be initiated by the DPWH Buildings and Special Projects Management Cluster-Unified Project Management Office (BSPMC-UPMO).

Once the winning contractor is mobilized, the following activities will be undertaken by the contractor in coordination with the DPWH BSPMC-UPMO and the Administration of Santa Lucia High School.

Table 2-4: Activities Involved in the Retrofitting Works

| STAGE                 | ACTIVITIES  |
|-----------------------|---|
|                       |   |
| Prior to              | Site investigation by the contractor in close coordination with the end-                        |
| Construction          | user (school administration)  |
|                       | Development of a schedule/plan of works   |
|                       | Securing of permits (as necessary)  |
|                       | Installation of project billboard/signboard   |
| Earthworks (for       | Removal of slab on fill/obstructions  |
| retrofits involving   | Surface preparation   |
| foundation)           | Installation of shoring   |
| •                     | Structure excavation  |
| Building retrofitting | Removal of obstructions, relocation of utilities  |
|                       | Construction of field office/makeshift office   |
|                       | Installation of scaffoldings, forms, and falseworks   |
|                       | Chipping of concrete  |
|                       | 1. 9  |
|                       | Structural steel fabrication (done offsite)  Cutting and bonding of uniforming steel (deformed) |
|                       | Cutting and bending of reinforcing steel (deformed)   |
|                       | Concrete / epoxy injection and crack repair (including rectification of                         |
|                       | honeycombs, exposed rebars, and non-structural defects)   |
|                       | Epoxy-resin base bonding for concrete (structural epoxy)  |
|                       | Structural concreting (28 days)   |
|                       | Welding and bolting of metal structures and accessories   |
|                       | • Finishing (painting, repair/restoration of affected architectural finishes)                   |
| Post-Construction     | Restoration of disturbed areas  |
|                       | Site clearing including removal of makeshift office   |

#### 2.4 DESCRIPTION OF THE ENVIRONMENT

#### 2.4.1 Pasig City

#### 2.4.1.1 Physical Environment

#### a) Land Resources

**Soils.** The soil classification found in Pasig are Pinagbuhatan Clay, San Manuel Clay Loam, Marikina Clay, Marikina Silt Loam, Boulevard Clay, Cupang Clay, Novaliches Urban Land Complex, and Baras clay. Santa Lucia High School is situated on top of Marikina Silt Loam.

**Land Use**. Santa Lucia High School is under institutional use and is surrounded by residential areas based on the Comprehensive Land Use Map of Pasig City (**Figure 2-2**).

**Land Cover**. According to the Comprehensive Land Use Plan (CLUP) of Pasig City, 95.07% of the land cover is considered as built-up area. Approximately 67.99 hectares are covered with vegetation, including grass, shrubs, and trees, while the rest represents the rivers and creeks that traverses Pasig.

LAND COVER **AREA (HAS.) PERCENTAGE** Built-Up Area 3,365.19 95.07 48.39 1.37 Grass 1.61 Shrub 0.05 17.99 0.51 Trees 106.63 Water 3.01 Total 3,539.8066 100.00

Table 2-5: Land Cover of Pasig City

Santa Lucia High School is within the built-up area based on **Figure 2-3**.

#### b) Freshwater Resources

**Rivers and Creeks.** The tributaries of the Pasig and Marikina Rivers, as well as seventeen streams make up the waterways, that traverse through the city. These rivers and creeks serve as an administrative boundary or as stormwater drainage systems. **Table 2-6** presents the list of creeks in Pasig.

Santa Lucia High School is approximately **700 meters east of Marikina River** and **~600 meters northwest of Buli Creek.** 

| NAME OF CREEK   | LOCATION                                   | LENGTH (M) |
|-----------------|--|------------|
| Parian Creek    | Kapasigan, Sagad, Sto. Tomas, Palatiw, San | 3,422      |
|                 | Miguel and Pinagbuhatan                    |            |
| Sapang Malapit  | San Miguel and Maybunga                    | 2,049      |
| Mahabang Ilog   | Maybunga                                   | 1,060      |
| Ngusong Buwaya  | Maybunga                                   | 822        |
| Buli Creek      | San Miguel and Pinagbuhatan                | 2,722      |
| Ilugin Creek    | Pinagbuhatan                               | 600        |
| Daang Paa Creek | San Joaquin and Kalawaan                   | 760        |

Table 2-6: Creeks within Pasig City

| NAME OF CREEK              | LOCATION                              | LENGTH (M) |
|----------------------------|---------------------------------------|------------|
| Marapa Creek               | Pinagbuhatan                          | 522        |
| San Agustin Creek          | Pinagbuhatan, Bambang, Sto. Tomas and | 1,680      |
|                            | Kalawaan                              |            |
| Villa Guapo Creek          | Pinagbuhatan                          | 120        |
| Nagpayong Creek            | Pinagbuhatan                          | 332        |
| Sapang Liwanag Creek       | San Miguel                            | 1,200      |
| Hakbangan Creek            | Dela Paz                              | 1,200      |
| Manmade Creek/ Kangkungan  | Manggahan                             | 1,085      |
| Manmade Creek/ Mabuhay     | Santa Lucia                           | 836        |
| Manmade Creek/ Lanuza      | Ugong                                 | 3,562      |
| Nagcruz Creek/ Pinagkrusan | Rosario                               | 1,085      |
|                            | TOTAL                                 | 23,057     |

Source: Pasig City CLUP

#### c) Climate

The climate in the Philippines is classified into four (4) types based on the rainfall distribution and pattern. The project sites, located in Pasig City, belong to Type I climate under the modified Coronas classification with two distinct seasons: dry from November to April and wet the rest of the year. The southwest monsoon peaks throughout the months of July to September, resulting in the most wet season.

The Science Garden in Quezon City, the nearest PAGASA Weather Stations in the project site, has the latest monitoring records of climatological normals (1991 to 2020) and climatological extremes (as of 2023) which are summarized below:

**Table 2-7: Climatological Data** 

| PARAMETER                       | SCIENCE GARDEN, QUEZON CITY (DESCRIPTION)                               |  |  |
|---------------------------------|---|--|--|
| Temperature                     | The warmest month of the year is May, with an average temperature of    |  |  |
|                                 | 29.8 ℃.   |  |  |
|                                 | • The coldest month is January, with an average temperature of 26.0 °C. |  |  |
|                                 | The highest temperature recorded was 38.5°C on May 14, 1987.            |  |  |
|                                 | The lowest temperature was 14.9°C on March 1, 1963.                     |  |  |
| Rainfall                        | An estimated 2,785.60 mm of rainfall and 143 rainy days may be          |  |  |
|                                 | experienced in the area per year.                                       |  |  |
|                                 | On September 26, 2009, the region had the highest day rainfall quantity |  |  |
|                                 | of 455.0 mm.  |  |  |
| Relative                        | The most humid are the months of July to December.                      |  |  |
| Humidity                        | The Science Garden recorded a mean annual relative humidity of 78%.     |  |  |
| Surface Wind                    | The prevailing winds during October to January came from north;         |  |  |
|                                 | southeast during March to May, and southeast from June to September.    |  |  |
| Source: PAGASA (1991-2023 data) |   |  |  |

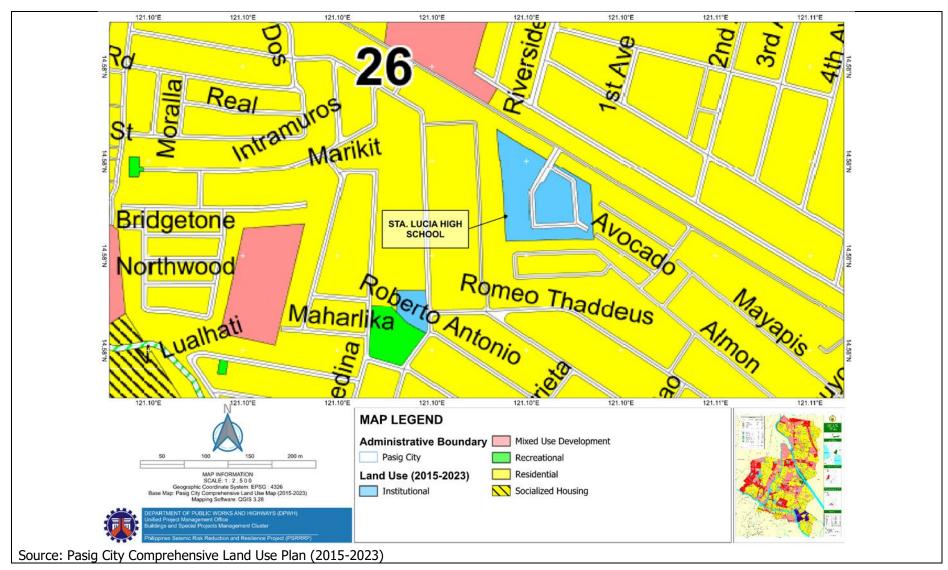


Figure 2-2: Land Use Map of Pasig City (2015-2023)

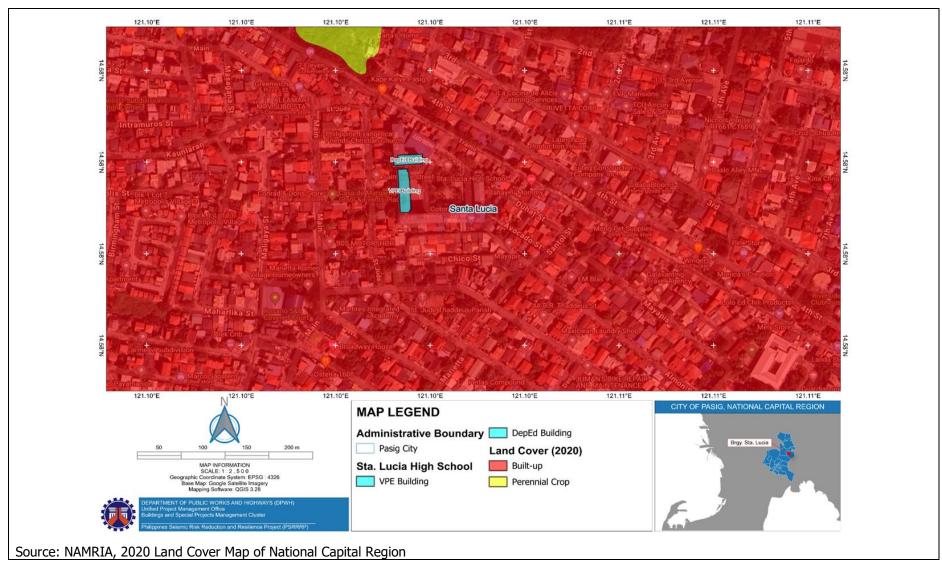


Figure 2-3: Land Cover Map of Pasig City (2020)

#### 2.4.1.2 Socio-economic Environment

#### a) Population

Pasig City is a highly urbanized city with a total land area of 4,846 hectares. Pasig City is politically divided into 30 barangays. According to the 2020 PSA Census, Pasig City has a total population of 803,159 people. From 2015, the city recorded an annual population growth rate of +1.30% from 2015 to 2020. The total number of households in Pasig is 212,895 having an average household size of 3.76.

The host barangay, Barangay Santa Lucia, has a total population of 43,749 people with an average household size of 3.72.

Table 2-8: Demographic Data of Pasig City (2020)

| CITY/BARANGAY | POPULATION (2020) | HH<br>POPULATION | NO. OF<br>HHs. | AREA<br>(HAS.) | AVE.<br>HH<br>SIZE* | POP.<br>DENSITY |
|---------------|-------------------|------------------|----------------|----------------|---------------------|-----------------|
| City of Pasig | 803,159           | 801,439          | 212,895        | 3,539.8066     | 3.76                | 22,689          |
| Sta Lucia     | 43,749            | 43,697           | 11,751         | 187.80         | 3.72                | 23,296          |

Source: PSA, 2020 Census of Population and Housing; Pasig CLUP Note:

#### b) Gender and Age Profile

The age group of '0-4' has the highest population, with 81,142 individuals or 10.12% of Pasig City's population. Of the total population, the female population comprised a larger portion (50.42%) compared to the male population (49.58%).

Table 2-9: Gender and Age Profile of Pasig City (2020)

| AGE GROUP  | MALE    | FEMALE  | BOTH SEXES |  |  |
|--|---------|---------|------------|--|--|
| 0 - 4  | 41,770  | 39,372  | 81,142     |  |  |
| 5 - 9  | 40,399  | 37,614  | 78,013     |  |  |
| 10 - 14  | 36,887  | 34,121  | 71,008     |  |  |
| 15 - 19  | 33,210  | 32,389  | 65,599     |  |  |
| 20 - 24  | 35,711  | 36,272  | 71,983     |  |  |
| 25 - 29  | 37,907  | 38,526  | 76,433     |  |  |
| 30 - 34  | 36,103  | 35,445  | 71,548     |  |  |
| 35 - 39  | 31,334  | 30,937  | 62,271     |  |  |
| 40 - 44  | 26,727  | 27,193  | 53,920     |  |  |
| 45 - 49  | 21,545  | 22,282  | 43,827     |  |  |
| 50 - 54  | 17,673  | 19,231  | 36,904     |  |  |
| 55 - 59  | 13,572  | 15,638  | 29,210     |  |  |
| 60 - 64  | 10,332  | 13,050  | 23,382     |  |  |
| 65 - 69  | 6,667   | 9,285   | 15,952     |  |  |
| 70 - 74  | 4,242   | 5,976   | 10,218     |  |  |
| 75 - 79  | 1,774   | 3,255   | 5,029      |  |  |
| 80 years and over                                  | 1,534   | 3,466   | 5,000      |  |  |
| TOTAL  | 397,387 | 404,052 | 801,439    |  |  |
| Source: PSA, 2020 Census of Population and Housing |         |         |            |  |  |

<sup>\*</sup> Average HH size= Household Population/ No. of Households

<sup>\*\*</sup>Population Density= Population/Area (km2)

1,821,386.88

#### c) Culture and Heritage

The Republic Act No. 10066, otherwise known as the "National Cultural Heritage Act of 2009" provided for the protection, preservation, and promotion of the nation's cultural heritage. This authorized the National Commission for Culture and the Arts (NCCA) to establish the Philippine Registry of Cultural Property (PRECUP).

The PRECUP is the repository of all culture properties of the Philippines that were deemed important to cultural heritage. As of April 2024, Pasig City is currently home to 34 tangible, intangible and immovable cultural properties recorded in the PRECUP-TALAPAMANA.

Santa Lucia High School is approximately 3.1 kilometers away from the nearest registered cultural property of Pasig – The EEI Building.

The retrofitting works will be confined within the Santa Lucia High School and are not expected to impact any registered cultural property nor heritage sites directly and adversely.

#### d) Road Network and Traffic Conditions

City/Barangay/Alley/Footpath

Source: Pasig City CLUP

The road network of Pasig City includes national, city, barangay, and private roads. Pasig City has a total road network of around 353 kilometers, which includes subdivision roads.

Administrative ClassificationLength (m)Area (sq. m)National29,613185,864.46

323,807

Table 2-10: Road Inventory by System Classification (2021)

Sta Lucia High School is accessible using Ortigas Avenue Ext, Bonifacio Avenue, Cardinal Santos, Sapphire St., St. Martin St., Parola St., and Tramo Street. The road in front of the school, Tramo Street, is about five meters wide and has two lanes.

In order to accommodate the foot traffic of children entering and leaving the school, the road is often inaccessible to vehicles during this specific time.

#### 2.4.2 Santa Lucia High School

Santa Lucia High School is located at Barangay Santa Lucia, Pasig City, Metro Manila.

The school has six (6) buildings namely: Senior High School Building, DepEd Building, Vicente P. Eusebio (VPE) Building, Bobby C. Eusebio Building I (BCE I), BCE II, and Roman T. Romulo Building.

The school site has only one main gate in which learners and school personnel can enter and exit. The main gate measures 9 meters wide.

#### School Demographics

As of SY 2023-2024, Santa Lucia High School has a total of 7,688 (4,012 male and 3,676 female) learners, which includes learners from Grades 7-10 (Junior High School) to 11-12 (Senior High School).

Currently, Santa Lucia High School has 259 school teachers and personnel (168 teaching, 91 non-teaching).

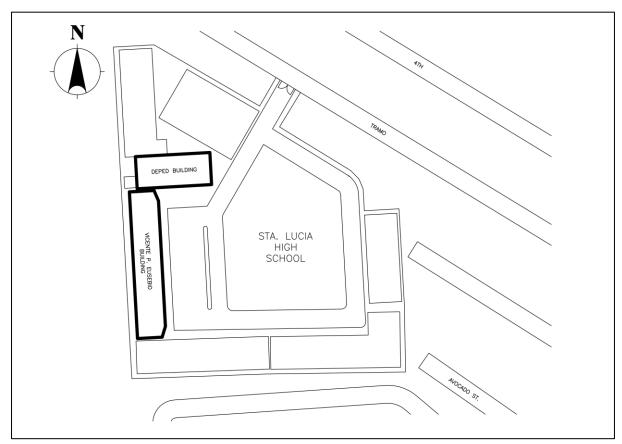


Figure 2-4: Site Development Plan of Santa Lucia High School

#### **Hazard Assessment**

Based on the hazard assessment report of HazardHunterPH, the location of the school is highly susceptible to ground shaking (Intensity VIII) and moderately susceptible liquefaction (see **Table 2-11**).

Table 2-11: Hazard Assessment Report for Santa Lucia High School

| Sei                     | smic Hazards   | Proposed Engineering Solutions  |
|-------------------------|--|---------------------------------|
| Ground Rupture          | Safe; Approximately 3.3 km east of the   | -                               |
|                         | Valley Fault System: West Valley Fault   |                                 |
| Ground Shaking          | Prone; Intensity VIII  | Concrete enlargement of         |
| Liquefaction            | Moderate Potential   | beams, columns, and footing     |
| Earthquake-Induced      | Safe   | -                               |
| Landslide               |  |                                 |
| Tsunami                 | Safe   | -                               |
| <b>Volcanic Hazards</b> |  |                                 |
| Nearest Active Volcano  | Approximately 64.3 km north of Taal  | -                               |
| Ashfall                 | Prone  | -                               |
| Hydro-Meteorological H  | azards   |                                 |
| Severe Wind             | 117.1 - 220 kph (20-year return period); 117.1 -220 kph (500-year return period) | Provision of additional trusses |
| Flood                   | High Susceptibility; 1 to 2 meters flood height and/or more than 3 days flooding | -                               |
| Storm Surge             | Safe   | -                               |
| Source: HazardHunterPh  | · · · · · · · · · · · · · · · · · · ·  |                                 |

# 2.4.2.1 DepEd Building

| Building Information                            |               | DEPED BUILDING   |   |  |
|---|---------------|--|---|--|
| Seismic Vulnerability Rating                    | 81.70         |  |   |  |
| (SVR):  |               |  | Mar 8, 2024 at 13 20 23 11<br>4 34 58" E 121 6 11"  |  |
| No. of Floors:                                  | 6 Floors      |  | 4 34 96 E 121 6 11<br>Pasig   |  |
| Estimated Floor Area:                           | 1,575 sq.m.   |  |   |  |
| Year Constructed:                               | 2012          |  |   |  |
| Years of the Structure:                         | 12 years      |  |   |  |
| Occupants of the Eligible Build                 | ding          |  |   |  |
| Total number of Learners                        | 700           |  |   |  |
| Grade Level                                     | Grades 9 & 10 |  | THE REAL PROPERTY AND ADDRESS OF THE PERSON |  |
| Age Range                                       | 14 to 17 y/o  |  |   |  |
| Total Number of Shifts                          | 2             | The state of the s |   |  |
| Shift 1: 06:00 AM - 12:50 PM                    |               |  | THE WATER   |  |
| Shift 2: 01:00 PM - 07:30 PM                    |               |  |   |  |
| Number of Teachers and                          | 30            | THE PARTY OF THE P |   |  |
| Personnel                                       |               |  | - Barrier Barrier   |  |
| Type of rooms directly affected by retrofitting | Quantity      | Existing facilities to be<br>affected by retrofitting  | Quantity  |  |
| Offices:  | •             | WASH Facilities:   | •   |  |
| TLE Department Head Office                      | 1             | Toilet Facilities  | 6   |  |
| Faculty Room                                    | 3             | Outdoor Handwashing Facility   | 1   |  |
| Maintenance Room                                |               | Water Supply   | With provision  |  |
|   |               | Septic Tank  | With provision  |  |
| Rooms:  |               | Other structural elements/fac  | ilities:  |  |
| Computer Laboratory                             | 2             | Ingress/Egress   | Interconnected with VPE   |  |
|   | 1             |  | Building  |  |
| Todo obside III / Marilia Isaa Daara            |               |  | Dananig   |  |
| Industrial / Workshop Room                      | 12            | Fire Cabinets (per floor)  | 6   |  |
| Others:   | 12            | Fire Cabinets (per floor) Fire Escape/Exit   |   |  |
|   | 12            |  | 6 With provision With provision   |  |
| Others:   | 1             | Fire Escape/Exit Drainage system Stairs  | 6 With provision With provision 2   |  |
| Others:   | 1             | Fire Escape/Exit Drainage system   | 6 With provision With provision   |  |

# 2.4.2.2 Vicente P. Eusebio Building

| Building Information  |                   | VPE BUILDING  |  |
|---|-------------------|---|--|
| Seismic Vulnerability Rating  | 81.70             |   |  |
| (SVR):  |                   |   | 3/8/24, 1:20 PM<br>N 14° 34' 58", E 121° 6' 10"  |
| No. of Floors:  | 6 Floors          |   | Metro Manila<br>1608 Pasig   |
| Estimated Floor Area:   | 3,120 sq. m.      |   | Santa Lura High School   |
| Year Constructed:   | 2007              | STALLUCIA HIGH SCHOOL   |  |
| Years of the Structure:   | 17 years          |   |  |
| Occupants of the Eligible Buildi  | ng                |   |  |
| Total number of Learners  | ~1,900            | Ta l  |  |
| Grade Level   | Grades 9 & 10     | 7-7-17  |  |
| Age Range   | 14 to 17 y/o      |   | THE RESERVE OF THE PARTY OF THE |
| Total Number of Shifts  | 2                 |   | THE PERSON NAMED IN  |
| Shift 1: 06:00 AM - 12:50 PM  |                   |   |  |
| Shift 2: 01:00 PM - 07:30 PM  |                   |   |  |
| Number of Teachers and  | 60                | 16 10 14 211 1 2 1 3 2 10 3 2 |  |
| Personnel   |                   |   |  |
| 1   |                   |   |  |
| Type of rooms directly affected by retrofitting   | Quantity          | Existing facilities to be affected by retrofitting  | Quantity   |
| Type of rooms directly affected by retrofitting Offices:  | Quantity          | Existing facilities to be affected by retrofitting WASH Facilities:   | Quantity   |
| affected by retrofitting  | Quantity          | affected by retrofitting  | <b>Quantity</b>  |
| affected by retrofitting Offices:   |                   | affected by retrofitting WASH Facilities:   |  |
| <b>Offices:</b> Guidance Office (1st Floor)   | 1                 | affected by retrofitting WASH Facilities: Toilet Facilities   | 6  |
| <b>Offices:</b> Guidance Office (1st Floor)   | 1                 | affected by retrofitting WASH Facilities: Toilet Facilities Outdoor Handwashing Facility  | 6 1  |
| <b>Offices:</b> Guidance Office (1st Floor)   | 1                 | affected by retrofitting WASH Facilities: Toilet Facilities Outdoor Handwashing Facility Water Supply   | 6 1 With provision With provision  |
| affected by retrofitting Offices: Guidance Office (1st Floor) Faculty Rooms                                       | 1                 | affected by retrofitting WASH Facilities: Toilet Facilities Outdoor Handwashing Facility Water Supply Septic Tank   | 6 1 With provision With provision  |
| affected by retrofitting Offices: Guidance Office (1st Floor) Faculty Rooms  Rooms:                               | 1 3               | affected by retrofitting WASH Facilities: Toilet Facilities Outdoor Handwashing Facility Water Supply Septic Tank Other structural elements/facil   | 6 1 With provision With provision ities:   |
| affected by retrofitting Offices: Guidance Office (1st Floor) Faculty Rooms  Rooms: Classrooms                    | 18                | affected by retrofitting WASH Facilities: Toilet Facilities Outdoor Handwashing Facility Water Supply Septic Tank Other structural elements/facil PWD Ramps   | 6 1 With provision With provision ities: With provision Interconnected with BCE 1 and  |
| affected by retrofitting Offices: Guidance Office (1st Floor) Faculty Rooms  Rooms: Classrooms                    | 18                | affected by retrofitting WASH Facilities: Toilet Facilities Outdoor Handwashing Facility Water Supply Septic Tank Other structural elements/facil PWD Ramps Ingress/Egress  | 6 1 With provision With provision ities: With provision Interconnected with BCE 1 and DepEd Building   |
| affected by retrofitting Offices: Guidance Office (1st Floor) Faculty Rooms  Rooms: Classrooms                    | 18                | affected by retrofitting WASH Facilities: Toilet Facilities Outdoor Handwashing Facility Water Supply Septic Tank Other structural elements/facil PWD Ramps   | 6 1 With provision With provision ities: With provision Interconnected with BCE 1 and DepEd Building 6   |
| affected by retrofitting Offices: Guidance Office (1st Floor) Faculty Rooms  Rooms: Classrooms ALS/Open High Room | 1<br>3<br>18<br>1 | affected by retrofitting WASH Facilities: Toilet Facilities Outdoor Handwashing Facility Water Supply Septic Tank Other structural elements/facil PWD Ramps Ingress/Egress Fire Cabinets (per floor) Drainage system  | 6 1 With provision With provision ities: With provision Interconnected with BCE 1 and DepEd Building 6 With provision  |
| affected by retrofitting Offices: Guidance Office (1st Floor) Faculty Rooms  Rooms: Classrooms ALS/Open High Room | 1<br>3<br>18<br>1 | affected by retrofitting WASH Facilities: Toilet Facilities Outdoor Handwashing Facility Water Supply Septic Tank Other structural elements/facil PWD Ramps Ingress/Egress Fire Cabinets (per floor)  | 6 1 With provision With provision ities: With provision Interconnected with BCE 1 and DepEd Building 6   |

#### 2.4.2.3 School Vegetation and Trees

The observed trees and plants in the school perimeter and their respective distances to the identified school buildings are summarized in the **Table 2-12**.

Table 2-12: Conservation Status of Flora Species within the Study Area

| BUILDING/<br>LOCATION | DISTANCE<br>(m) | OBSERVED<br>TREE/PLANT | SCIENTIFIC NAME               | IUCN<br>2023* | DAO<br>2017-<br>11 |
|-----------------------|-----------------|------------------------|-------------------------------|---------------|--------------------|
| DepEd Building        |                 |                        |                               |               |                    |
| Front                 | 8.0             | American Kapok         | Ceiba pentandra               | LC            | -                  |
| Right Side            | >1.0            | Foxtail Palm           | Wodyetia bifurcata            | -             | -                  |
| Right Side            | >1.0            | MacArthur's Palm       | Ptychosperma<br>macarthurii   | LC            | -                  |
| Right Side            | >1.0            | Palmera                | Chrysalidocarpus<br>lutescens | NT            | -                  |
| Right Side            | >1.0            | Kentia                 | Howea forsteriana             | VU            | -                  |
| Right Side            | >1.0            | Manila Palm            | Adonidia merrillii            | VU            | VU                 |
| Right Side            | >2.0            | Anahaw                 | Saribus rotundifolius         | -             | -                  |
| Right Side            | >2.0            | Avocado (Sapling)      | Persea americana              | LC            | -                  |
| Back                  | 1.0             | Langka (sapling)       | Artocarpus<br>heterophyllus   | -             | -                  |
| Back                  | 1.0             | Kamias (sapling)       | Averrhoa bilimbi              | -             | -                  |
| Back                  | 3.0             | Lemon (sapling)        | Citrus x limon                | LC            | -                  |
| <b>VPE Building</b>   |                 |                        |                               |               |                    |
| Front                 | <1.0            | Manila Palm            | Adonidia merrillii            | VU            | VU                 |
| Front                 | <1.0            | Foxtail Palm           | Wodyetia bifurcata            | -             | -                  |
| Front                 | <1.0            | Cacao                  | Theobroma cacao               | -             | -                  |
| Front                 | <1.0            | Neem Tree              | Azadirachta indica            | LC            | -                  |
| Back (Left)           | 1.5             | Langka (Sapling)       | Artocarpus<br>heterophyllus   | -             | -                  |
| Back (Left)           | <1.0            | Guava                  | Psidium guajava               | LC            | -                  |
| Back (Right)          | <1.0            | Kamias                 | Averrhoa bilimbi              | -             | -                  |
| Back (Right)          | <1.0            | Malunggay              | Moringa oleifera              | LC            | -                  |
| Back                  | 5.0             | Mahogany               | Swietenia macrophylla         | EN            | -                  |
| Quadrangle            | -               | Royal Palm             | Roystonea regia               | LC            | -                  |

Note:

\*Not Evaluated (NE); Data Deficient (DD); Least Concern (LC); Near Threatened (NT); Vulnerable (VU); Endangered (EN); Critically Endangered (CR); Extinct in the Wild (EW); Extinct (FX)

Red font – Trees that may be subjected to tree cutting due to retrofitting works.

Figure 2-5: Vegetation in the Study Area

# DepEd Building









**VPE Building** 









Source: ALAI E&S Consultant

# **3 POTENTIAL ENVIRONMENTAL AND SOCIAL IMPACTS**

#### 3.1.1 Land

| Potential Environmental and Social Impacts  | ESS   |
|---|-------|
| <b>Generation of Solid Waste</b> . The build-up of solid waste, particularly construction debris, is a concern during the retrofitting activities.  | ESS 3 |
| The site preparation for retrofitting activities will result in the generation of demolition waste, such as aggregate, concrete, wood, and glass. Construction wastes, including steel, wood, and empty cement bags, are anticipated to be generated throughout the retrofitting process. In addition, the construction workers will also generate domestic wastes. |       |
| <b>Generation of Hazardous Waste</b> . During the retrofitting activities, hazardous wastes such as used oil, grease, paint containers, and busted bulbs may also be generated.   | ESS 3 |
| <b>Soil Erosion</b> . Earthworks, for retrofits involving foundation, will require a certain amount of soil to be displaced, which may result in soil erosion.  | ESS 3 |
| Storm runoff may transport and deposit soil to adjacent drains during rainy seasons, potentially resulting in siltation. Siltation reduces drainage capacity, which may lead to floods in neighboring areas.  |       |
| <b>Disturbance in Terrestrial Flora</b> . About 8 saplings and 10 trees ( <b>Table 2-12</b> ) were observed close to the school buildings, in addition to a number of ornamental plants in the plant boxes of the building. These ornamental plants and trees may be impacted by the retrofitting activity.   | ESS 3 |

#### 3.1.2 Water

| Potential Environmental and Social Impacts   | ESS                     |
|--|-------------------------|
| <b>Surface Water Pollution</b> . The generated demolition wastes, construction wastes, and domestic solid wastes during the construction phase may cause pollution to the nearby water bodies if not properly managed. | ESS 2<br>ESS 3<br>ESS 4 |
| Since heavy equipment will also be used, another concern during the construction is accidental oil spills.   |                         |
| Domestic wastewaters will also be generated by the construction workers. Untreated wastewater can contaminate water supplies and endanger the health of the surrounding communities.                                   |                         |

# 3.1.3 Air Quality, Noise, and Vibration

| Potential Environmental and Social Impacts   |       |  |  |
|--|-------|--|--|
| <b>Dust Emissions.</b> Retrofitting activities involving excavation activities and roughening of | ESS 2 |  |  |
| concrete substrate will generate dust especially during dry season. Dust can cause               | ESS 3 |  |  |
| nuisance, reduction of visibility and may cause respiratory diseases.                            | ESS 4 |  |  |

| Potential Environmental and Social Impacts   | ESS                     |
|--|-------------------------|
| <b>Gaseous Emissions</b> . Aside from dust, gaseous emissions from heavy equipment and generators used in the construction site will produce short-term impacts on the ambient air quality. An increased concentration of carbon monoxide (CO), sulfur dioxide (SO2), and nitrogen dioxide (NO2) may be realized in the ambient air. This impact may not be a primary concern since the construction activities will only be temporary. Nevertheless, heavy equipment must be kept in prime condition at standard air and fuel ratio in order to limit gaseous emissions, particularly total suspended particulates (TSP). Diesel fuel products emit TSP, SO2 and nitrogen oxides (NOx) due to the hydrocarbon and sulfur content. | ESS 2<br>ESS 3<br>ESS 4 |
| Noise and Vibration. Noise and vibration may also be generated during excavation, and concrete chipping of targeted building structural elements. Although construction works are expected to occur regularly, these impacts may be considered temporary.  The noise and vibration may affect the nearby school buildings, households, establishments, and offices during the retrofitting works.  | ESS 2<br>ESS 3<br>ESS 4 |

# 3.1.4 People

| Potential Environmental and Social Impacts  | ESS   |
|---|-------|
| <b>Traffic Congestion.</b> The delivery of construction equipment, crossing of heavy vehicles and delivery trucks will affect the traffic condition of the project sites.   | ESS 4 |
| <b>Peace and Order.</b> Presence of outsiders (i.e., migrant workers) can bring new influence in the area, especially to the learners of Santa Lucia High School.   | ESS 4 |
| <b>Gender Related Issues.</b> Issues concerning gender-based violence, sexual harassment,   | ESS 2 |
| and sexual exploitation and abuse due to the presence of outsiders (workers) in Santa Lucia High School.  | ESS 4 |
| <b>Health and Safety</b> . Since the project is within the school premises, construction may  | ESS 2 |
| pose danger to the safety and health of students and school personnel. Potential health and safety risks may also arise from dust, pollutants, noise, and vibration to be generated from construction activities.                       | ESS 4 |
| <b>Disruption of Student Learning</b> . Due to the nature of the project, the current building  | ESS 1 |
| occupants will be forced to vacate the building for their safety. School equipment such as  | ESS 4 |
| cabinets, chairs, tables, and elective-specific equipment will also be relocated.   | ESS 5 |
| This relocation may have an impact on the learning outcomes of the students if not properly managed.  |       |
| <b>Generation of Local Employment.</b> The project is predicted to have a favorable influence on the local economy of the host community, given the additional employment opportunities that will be accessible to the local workforce. | ESS 1 |

#### **4 ENVIRONMENTAL AND SOCIAL MANAGEMENT PLAN**

**Table 4-1** presents the prepared Environmental and Social Management Plan (ESMP) for Santa Lucia High School.

Table 4-1: Environmental and Social Management Plan for Santa Lucia High School

| POTENTIAL RISKS AND   | RISK     | MITIGATION MEASURES   | MONITORING PARAMETERS   | COST OF MITIGATION/  | INSTITUTIONA   | L ARRANGEMENT  |
|---|----------|---|---|--|--|--|
| IMPACTS   | CATEGORY |   |   | MONITORING   | IMPLEMENTATION   | SUPERVISION  |
| A. Pre-Construction Phase   | <u> </u> |   |   |  |  |  |
| Failure to comply with National Laws and Regulations resulting to delay of the project implementation   | LOW      | <ul> <li>Acquisition of applicable permits and licenses</li> <li>Certificate of Non-Coverage (CNC)</li> <li>Building Permit</li> <li>Electrical Permit</li> <li>Mechanical Permit</li> <li>Sanitary Permit</li> <li>Fire Safety Inspection Certificate (FSIC)</li> <li>Occupancy Permit</li> <li>Tree Cutting/Trimming Permit</li> <li>Temporary Hazardous Waste Generator ID</li> </ul>  | Submission of complete<br>requirements for processing all<br>permits  | Permits from the local government are free of charge.  Refer to item "Loss of Vegetation" for the tree cutting permit (DENR).  | • Contractor   | <ul> <li>DPWH BSPMC-UPMO</li> <li>Sta Lucia High School<br/>Administration</li> <li>Third-party<br/>construction<br/>supervision firm</li> </ul>   |
| Disruption of student learning due to temporary relocation of affected school classrooms:  Particularly, affecting the building occupants:  DepEd Building: Learners: 700 (9.11% of 7,688)  School Personnel: 30 (11.58% of 259)  VPE Building: Learners: 1,900 (24.71% of 7,688)  School Personnel: 60 (23.16% of 259) | HIGH     | <ul> <li>Coordination with Pasig City LGU for the Traffic management, traffic control plan, and the parking availability during material deliveries.</li> <li>Coordinate the schedule of activities/ program of works with the administration of the school:</li> <li>SCHOOL BUILDINGS DURATION (IN MONTHS)</li> <li>DepEd Building 7</li> <li>Vicente P. Eusebio Building 12</li> <li>Preparation and implementation of temporary student and facilities relocation plan with the approval of the DepEd Schools Division Office.</li> <li>The school will utilize a Blended Learning Delivery Modality (Please refer to ANNEX B to see the student and facilities relocation plan.)</li> <li>Establishment of the grievance redress mechanism with designated focal person.</li> <li>Post billboard containing project information and contact information of complaint focal person.</li> </ul> | Site layout   | Please refer to <b>ANNEX B</b> for an estimate of the cost associated with the student and facilities relocation plan requirements.  | DPWH BSPMC-UPMO     Contractor                               | <ul> <li>DPWH BSPMC-UPMO</li> <li>Sta Lucia High School<br/>Administration</li> <li>Adjacent communities<br/>(Brgy. Santa Lucia)</li> <li>Third-party<br/>construction<br/>supervision firm</li> </ul> |
| Disruption of operation of facility due to temporary relocation of other building utilities  Specifically, the Project will impact the following facilities:  DepEd Building: 3 Offices:  | HIGH     | <ul> <li>Coordination with Pasig City LGU for the Traffic management, traffic control plan, and the parking availability during material deliveries.</li> <li>Coordinate the schedule of activities/ program of works with the administration of the school:</li> </ul>   | <ul> <li>Minutes of meetings</li> <li>Site layout</li> <li>Temporary relocation plan</li> <li>Inventory of equipment and supplies</li> <li>Program of works/schedule</li> <li>Updated site-specific ESMP/ECOP and other applicable safeguard instruments</li> </ul> | Please refer to <b>ANNEX B</b> for an estimate of the cost associated with the student and facilities relocation plan requirements.  Please refer to <b>ANNEX C</b> for the Traffic Management Plan. | <ul> <li>DPWH BSPMC-<br/>UPMO</li> <li>Contractor</li> </ul> | <ul> <li>DPWH BSPMC-UPMO</li> <li>Sta Lucia High School<br/>Administration</li> <li>Adjacent communities<br/>(Brgy. Santa Lucia)</li> <li>Third-party<br/>construction<br/>supervision firm</li> </ul> |

| POTENTIAL RISKS AND   | RISK     | MITIGATION MEAS  | SURES  | MONITORING PARAMETERS   | COST OF MITIGATION/   | INSTITUTIONA  | L ARRANGEMENT  |
|---|----------|--|--|---|---|---|--|
| IMPACTS   | CATEGORY |  |  |   | MONITORING  | IMPLEMENTATION  | SUPERVISION  |
| IMPACTS  1 TLE Head Office, 1 Faculty Room, 1 Maintenance 14 Rooms: 2 Computer Laboratory, 12 Industrial/ Workshop Rooms Others: Feeding Center (Entire Ground Floor)  VPE Building: 4 Office: 1 Guidance Office, 3 Faculty Rooms 19 Rooms: 19 Regular Classrooms 4 Others: 3 Room-Canteen, 1 Kitchen (Extension) | CATEGORY | SCHOOL BUILDINGS      DepEd Building     Vicente P. Eusebio Building      Preparation and impler temporary student and facil plan with the approval of Schools Division Office. (PANNEX B to see the studer relocation plan.)     Establishment of the gries mechanism with designated mechanism with designated post billboard contact information and contact is complaint focal person.     Verify if the drainage is we the construction activities.   | lities relocation of the DepEd Please refer to nt and facilities vance redress d focal person. ning project information of | CHSP Project billboard     Periodic monitoring of grievance redress mechanism   | MONITORING  | IMPLEMENTATION  | SUPERVISION  |
| Establishment of workers' camp and staging area which may result to the increase in crime rate within the school  | LOW      | <ul> <li>The school administration we construct a barracks with perimeter.</li> <li>The workers will only be at the school building for retrown the school building for retrown within the safe and undimensional within the building subject of the Provision of workers' pass</li> <li>A designated security generated by the Contractor</li> </ul>  | allowed within ofitting. vill be situated sturbed floors for retrofitting.   | <ul> <li>Monitoring of the workers' pass</li> <li>Checking of the staging area</li> </ul>   | Part of the Construction<br>Management cost                     | • Contractor  | <ul> <li>DPWH BSPMC-UPMO</li> <li>Sta Lucia High School<br/>Administration</li> <li>Third-party<br/>construction<br/>supervision firm</li> </ul> |
| Disruption on the foot traffic and road traffic within the vicinity due to the retrofitting activity (Delivery of materials)  | MEDIUM   | <ul> <li>Coordination with Pasig (Brgy. Sta Lucia LGU for management)</li> <li>Installation of the promeasures such as signs, lighting for pedestrian (lear</li> </ul>   | posed traffic<br>markers and   | <ul> <li>Record or logbook of traffic<br/>management</li> <li>Checking of the installed traffic<br/>markers, signage, and other<br/>measures</li> </ul> | Please refer to <b>ANNEX C</b> for the Traffic Management Plan. | <ul><li>DPWH BSPMC-<br/>UPMO</li><li>Contractor</li></ul> | <ul> <li>DPWH BSPMC-UPMO</li> <li>Sta Lucia High School<br/>Administration</li> <li>Adjacent communities<br/>(Brgy. Santa Lucia)</li> </ul>      |
| B. Construction Phase  Disruption of classes (student learning), neighboring homes, and businesses due to noise and vibration from hammering and drilling activities during concrete chipping and stripping down of targeted walls/ ceilings/ beams/ columns  | HIGH     | <ul> <li>Conduct noise monitoring the conduct of the retrofitting a standard decibel reader of the nearest receptors.</li> <li>Provide noise/ acoustic barricade the construction as sensitive receptors.</li> <li>Strictly prohibit heavy noing activities beyond 9:00PM, areas near residential areas receptors.</li> <li>Require workers to proper such as boots with properties, impact glove padding, and ear protection.</li> <li>Inspection of tools regularly these are not damaged nor</li> </ul> | barriers to area and shield ise generating particularly in and sensitive rly wear PPEs anti-vibration is with thick in.    | <ul> <li>Check work schedule</li> <li>Check if workers have PPEs</li> <li>Check tools used in hammering and drilling activities</li> </ul>              |   | • Contractor  | <ul> <li>DPWH BSPMC-UPMO</li> <li>Sta Lucia High School<br/>Administration</li> <li>Adjacent communities<br/>(Brgy. Santa Lucia)</li> </ul>      |

| POTENTIAL RISKS AND  | RISK     | MITIGATION MEASURES  | MONITORING PARAMETERS  | COST OF MITIGATION/                       | INSTITUTIONA   | L ARRANGEMENT  |
|--|----------|--|--|---|----------------|--|
| IMPACTS  | CATEGORY |  |  | MONITORING                                | IMPLEMENTATION | SUPERVISION  |
|  |          | <ul> <li>Keep a daily record of noise and ensure mitigation measure will be applied when exceedance is being observed.</li> <li>Monitor complaints from the building enduser and communities.</li> </ul>   | Daytime 55  Morning/Early 50  Evening  Nighttime 45  |   |                |  |
| Disruption of classes (student learning), neighboring homes, and businesses due to noise from use of heavy equipment | MEDIUM   | Use adequate muffler/ silencer for heavy equipment Install shields on stationary equipment where considerable noise reduction is required Use less noisy or newer equipment and conduct regular maintenance offsite  | monitoring during the conduct of the retrofitting works  Check if equipment has mufflers/silencers |   | • Contractor   | DPWH BSPMC-UPMO     Third-party construction supervision firm                          |
| Disruption of classes (student learning), neighboring homes, and businesses due to noise from cutting of steel       | MEDIUM   | <ul> <li>Deliver fabricated steel plates and cut/bend reinforcing steel to desired size to minimize cutting activities on site.</li> <li>Require workers to wear ear plugs.</li> </ul>   | Check materials delivery   | Part of the construction management cost. | • Contractor   | DPWH BSPMC-UPMO     Third-party     construction     supervision firm                  |
| Noise from delivering construction<br>supplies causes disturbances in the<br>residential area at night               | MEDIUM   | <ul> <li>Coordination with Brgy. Sta. Lucia LGU for<br/>the Traffic management</li> <li>Keep a daily record of noise and ensure<br/>mitigation measure will be applied when<br/>exceedance is being observed.</li> <li>Monitor complaints from the communities.</li> </ul> | construction supplies are being delivered  | monitoring equipment:                     | Contractor     | <ul> <li>DPWH BSPMC-UPMO</li> <li>Third-party construction supervision firm</li> </ul> |

| DOTENTIAL DISVS AND  | DICK      | MITICATION MEASURES  | MONITODING DADAMETERS   | COST OF MITICATION/  | INCTITUTIONA   | I ADDANCEMENT   |
|--|-----------|--|---|--|----------------|---|
|  |           | MITIGATION MEASURES  | MONITORING PARAMETERS   | -  |                |   |
| All NOIS   | CALLOGICI |  | Area dB(A)  |  |                | JOI LIVISION  |
| Potential loss of vegetation (i.e., trees), particularly the trees near/adjacent the building:  DepEd Building: Trees/saplings: 10 species  VPE Building: Trees/sapling: 8 species | HIGH      | A tree cutting or trimming permit shall be secured from the DENR NCR.     Replacement of trees in accordance with the DENR-DPWH Joint Memorandum Circular No. 01, s. 2014     Replant or preserve (marcotting) the tree/sapling. | Area dB(A)  Residential area Daytime 55 Morning/Early 50 Evening Nighttime 45   Conditions of the Tree Cutting or Trimming Permit including but not limited to:  1. Only the identified/inventoried trees shall be cut. 2. Prior to cutting operation, a signboard with dimension of 4 ft by 8 ft shall be installed in conspicuous place to inform the public that the activity is authorized by the DENR. The signage must indicate the name of the Permittee, the purpose, the activity to be undertaken and number of trees to be cut.  3. The Permittee is required to replace each tree to be cut with at least 100 seedlings to be donated by the Permittee to DENR.  4. Strictly no cutting shall be undertaken without the presence of DENR and/or LGU representatives.  5. A terminal report with photodocumentation shall be submitted to the DENR upon completion of the cutting operation or expiration of the Permit. |  | IMPLEMENTATION | DPWH BSPMC-UPMO     Third-party construction supervision firm               |
| Potential loss of vegetation particularly the ornamental plants within the building.   | HIGH      | <ul> <li>Replant or preserve ornamental plants</li> <li>Temporary transfer of the ornamental plants to other buildings or vacant spaces within the school promises</li> </ul>  | Check the condition of the plants   | Part of the transfer cost of building equipment (see ANNEX B). | Contractor     | DPWH BSPMC-UPMO     Third-party     construction     supposition firm       |
| Generation of excavated soils, specifically:  DepEd Building: Excavation (Common Soil): ~88.00 cu.m.  VPE Building:  | MEDIUM    | <ul> <li>within the school premises</li> <li>Provision of designated temporary storage of excavated soil. Possible location of the stockpile is in front VPE Building.</li> <li>Reuse excavated soil as backfill.</li> </ul>     |   | Part of construction management cost.                          | Contractor     | supervision firm  DPWH BSPMC-UPMO Third-party construction supervision firm |

| POTENTIAL RISKS AND  | RISK     | MITIGATION MEASURES  | MONITORING PARAMETERS  | COST OF MITIGATION/   | INSTITUTIONA   | L ARRANGEMENT   |
|--|----------|--|--|---|----------------|---|
| IMPACTS  | CATEGORY |  |  | MONITORING  | IMPLEMENTATION | SUPERVISION   |
| Excavation (Common Soil): ~1,315.00 cu.m.  |          | <ul> <li>Termite Control Works for excavated soil<br/>with termites. PPE must be worn properly<br/>when performing termite control activity.</li> </ul>  |  |   |                |   |
| Dust from excavation, concrete chipping, and drilling affecting the health of the students, school personnel, and the residential area.  | HIGH     | <ul> <li>Provide nets/sheeting and temporary screens for chipping/drilling on the exterior surface of the building.</li> <li>Conduct water spraying to suppress dust and minimize discomfort to nearby residents and occupants in the compound.</li> <li>Provide impermeable dust barriers and use air vacuum pumps and ventilation exhaust fans for indoor concrete chipping and drilling.</li> <li>Require workers to wear dust mask and proper PPEs.</li> <li>Regular clean-up of debris.</li> </ul>  | Check dust control measures  | Part of the construction management cost.   | • Contractor   | DPWH BSPMC-UPMO     Third-party     construction     supervision firm |
| Air pollution caused by emissions from on-site material delivery poses a health concern to the students and school personnel, including respiratory ailments.  | LOW      | <ul> <li>Prohibit idling of vehicles while unloading materials at the site.</li> <li>Ensure that the vehicles used for delivery shall be properly maintained to prevent smoke-belching.</li> <li>Ensure that trucks delivering construction materials have covers.</li> <li>Maintenance of delivery trucks/vehicles shall not be done onsite.</li> </ul>   | Monitor delivery vehicles  | Part of construction management cost.   | • Contractor   | DPWH BSPMC-UPMO     Third-party     construction     supervision firm |
| Generation of non-hazardous solid waste/construction debris:  Specifically, the Project will generate:  DepEd Building: Removal of obstructions (plywood ceiling): ~418.00 cu.m.  Partial demolition of walls, slabs, beams, floor finishes: ~217.00 cu.m.  VPE Building: Removal of obstructions (plywood ceiling): ~878.00 cu.m.  Partial demolition of walls, slabs, beams, floor finishes: ~659.00 cu.m. | MEDIUM   | <ul> <li>Provide segregation receptacles/bins for different types of solid waste and debris.</li> <li>Collect recyclable materials such as wires, pipes, rebars, and other pieces of material in separate bins for possible reuse or selling to a recycler.</li> <li>Avoid extended accumulation of wastes at the site and arrange for collection and offsite disposal of residual wastes in an LGU-approved disposal site.</li> <li>Prohibit burning of wastes.</li> <li>Conduct daily cleaning of the work areas after a day's work by clearing of waste materials and obstructions such as exposed nails, broken glass, etc.</li> <li>Daily collection/ hauling of construction debris</li> </ul> | Monitor non-hazardous solid waste management measures                    | The initial cost for the provision of receptacle bins and other waste containers:  Sta Lucia HS PHP 250,000 | • Contractor   | DPWH BSPMC-UPMO     Third-party     construction     supervision firm |
| Generation of construction wastewater from washing of equipment and tools which contains concrete mixture. This may cause  | MEDIUM   | The Contractor shall provide containers<br>for excess concrete and concrete wash<br>water to prohibit workers discharging this<br>waste in streets and/or local drainage.  | Monitor the implementation of<br>wastewater (with concrete)<br>disposal. | Provision of washout container:  Sta Lucia HS PHP 100,000   | Contractor     | DPWH BSPMC-UPMO     Third-party     construction     supervision firm |

| POTENTIAL RISKS AND IMPACTS  | RISK<br>CATEGORY | MITIGATION MEASURES   | MONITORING PARAMETERS  | COST OF MITIGATION/<br>MONITORING | INSTITUTIONA IMPLEMENTATION | L ARRANGEMENT<br>SUPERVISION   |
|--|------------------|---|--|-----------------------------------|-----------------------------|--|
| clogging of canals or drainage in the area.  |                  | The washout containers have to be<br>transported and treated by an accredited<br>Treatment, Storage and Disposal (TSD)<br>Facility  |  |                                   |                             |  |
| Soil contamination due to generation of hazardous waste such as empty containers of paints, solvents, epoxy resins, adhesives, degreasers, oil rags, and busted lamps  | MEDIUM           | <ul> <li>Designate a hazardous waste collection area at the work site.</li> <li>Provide segregate bins/receptacles for the different types of hazardous wastes and affix labels on the bins.</li> <li>Register as hazardous waste generator with the DENR.</li> <li>Commission the services of a DENR-registered hazardous waste transporter and treater</li> <li>Complete the Hazardous Waste Manifest.</li> <li>Secure the Certificate of Treatment (COT) from the DENR-recognized treater.</li> </ul>  | Monitor implementation of<br>hazardous waste management<br>measures                  |                                   | • Contractor                | <ul> <li>DPWH BSPMC-UPMO</li> <li>Third-party construction supervision firm</li> </ul>               |
| Considering that Santa Lucia High School is approximately 700 meters east of Marikina River and ~600 meters northwest of Buli Creek, soil runoff may cause clogging of canals and localized, particularly during the rainy season. | MEDIUM           | <ul> <li>Minimize earthworks during rainy months.</li> <li>Provide silt/sediment traps around mounds of excavated soil and aggregate materials.</li> <li>Minimize stockpiles by only ordering the supplies needed.</li> <li>Stockpiles of aggregates and sand should be placed inside the rooms under construction.</li> <li>In exceptional cases, materials stockpile will be allowed in an open area of the building compound within a couple of days, subject to approval of the building administrator. In such case, materials stockpile should be secured, provided with silt traps and with visible signs. The stockpile site should be at least 10 meters away from any canal or surface water.</li> <li>Consider using sandbags to redirect rainwater runoff.</li> <li>Consider putting aggregates on sacks for easy conveyance, transfer, and mixing of materials.</li> <li>Cover cement bags with tarpaulin.</li> <li>Prohibit washing of cement mixers and other construction vehicles at the site.</li> <li>Conduct daily cleaning and sweeping of the construction site and periodically remove soils, stones, and wastes from gutters, drainage canals and ditches.</li> </ul> | Monitor implementation of drainage management measures     Monitor ponding of water. | 1                                 | • Contractor                | DPWH BSPMC-UPMO     Third-party construction supervision firm  |
| Generation of domestic sewage resulting to water pollution.  | HIGH             | Provide temporary toilet facilities or<br>portable toilets for workers (male and<br>female) with available water and<br>handwashing facilities.   | Monitor domestic sewage<br>management and sanitation at<br>the site                  |                                   | Contractor                  | <ul> <li>DPWH BSPMC-UPMO</li> <li>Third-party<br/>construction quality<br/>assurance firm</li> </ul> |

| POTENTIAL RISKS AND  | RISK     | MITIGATION MEASURES  | MONITORING PARAMETERS   | COST OF MITIGATION/   | INSTITUTIONA   | L ARRANGEMENT  |
|--|----------|--|---|---|----------------|--|
| IMPACTS  | CATEGORY |  |   | MONITORING  | IMPLEMENTATION | SUPERVISION  |
|  |          | <ul> <li>Keep the portalets clean and sanitary at all times.</li> <li>Locate the portalets at least 30 meters from an existing water supply well, canal, or surface water body. It should not be located in a place where its odor can reach busy areas of the school premises.</li> <li>Ensure collection at least weekly or once contents are almost 2/3 full</li> <li>Hauling of wastewater from the portalets shall be done by third party contractor with license/permit from the LGU and with valid Discharge Permit for wastewater treatment facility.</li> <li>Note: at least one (1) portalet for 60 workers where the number of male workers exceeds 500 (as per IRR- Industrial Hygiene, PD 856 Amending Administrative Order 111 Series of 1991)</li> <li>Note: at least one (1) portalet for 25 workers where the number of male workers exceeds 100 (as per IRR- Industrial Hygiene, PD 856 Amending Administrative Order 111 Series of 1991)</li> </ul> |   |   |                |  |
| Delivery of aggregate materials to the site that may cause spillage                                  | LOW      | <ul> <li>Cover materials with tarpaulin when in transit.</li> <li>Aggregates should be wet and moist when in transit.</li> </ul>   | <ul> <li>Monitor if the measure is implemented by delivery personnel</li> <li>Check complaints</li> </ul> | Part of material delivery cost;<br>monitoring cost is part of<br>construction management cost | Contractor     | <ul> <li>DPWH BSPMC-UPMO</li> <li>Third-party         construction quality         assurance firm</li> </ul> |
| Road congestion in areas with narrow access roads leading to the site                                | MEDIUM   | <ul> <li>Schedule the delivery of materials during non-peak hours.</li> <li>Prohibit parking of construction vehicles on the road near the site.</li> <li>Coordinate with the Barangay LGU Coordinate with the Barangay LGU regarding the implementation of traffic management in the area</li> </ul>  | implemented by delivery personnel  • Check complaints   | Part of material delivery cost;<br>monitoring cost is part of<br>construction management cost | Contractor     | <ul> <li>DPWH BSPMC-UPMO</li> <li>Third-party         construction quality         assurance firm</li> </ul> |
| Gender related issues may arise due to the presence of outsiders (workers) inside the school campus. | MEDIUM   | <ul> <li>SEA-SH orientation and awareness raising training for the workers. All workers shall sign a Code of Conduct regarding SHA-SH before the construction starts.</li> <li>SEA/SH Awareness enhancement training for school staff and students, especially female staff and students. GRM Awareness training should be also included.</li> <li>Project workers should uphold a 'zero tolerance' approach to SEA/SH.</li> </ul>   | 1   | The indicative cost for trainings:  Sta Lucia HS PHP 20,000                                   | • Contractor   | <ul> <li>DPWH BSPMC-UPMO</li> <li>Sta Lucia High School<br/>Administration</li> </ul>                        |

| POTENTIAL RISKS AND                               | RISK     | MITIGATION MEASURES  | MONITORING PARAMETERS              | COST OF MITIGATION/                       | INSTITUTIONA   | L ARRANGEMENT   |
|---|----------|--|------------------------------------|---|----------------|---|
| IMPACTS   | CATEGORY |  |                                    | MONITORING                                | IMPLEMENTATION | SUPERVISION   |
|   |          | <ul> <li>Involvement of the GAD Focal Person of Sta Lucia High School in the Grievance Redress Committee.</li> <li>Through the GRM, potential victims can safely and confidentially report SEA/SH case without fear of discrimination/judgement.</li> <li>Ingress and egress for construction workers should be physically separated from those used by students, teachers, and school personnel. If only one access point exists, construction workers should enter and exit at a different time with the students and school personnel. Workers are not allowed to mingle with the students and school personnel</li> </ul>  |                                    |   |                |   |
| Risks and hazards to health and safety of workers | HIGH     | <ul> <li>Implement a Construction Safety and Health Program (CSHP) in compliance with the DOLE OSH guidelines.</li> <li>Ensure all workers undergo the mandatory workers' OSH orientation.</li> <li>Designate an on-site Safety Officer duly accredited by DOLE.</li> <li>Ensure that workers who will perform tasks at heights complete the Working at Heights (WAH) Training.</li> <li>Assign a contact person on site to receive/respond to complaints from the barangay/community; provide the name/contact number of the responsible person to the barangay.</li> <li>Strictly require workers to properly wear PPEs such as hard hats, gloves, safety belts, safety shoes, and googles, appropriate to the task.</li> <li>Provide welders with the appropriate PPEs; ensure ventilation in the work area involving welding and painting activities.</li> <li>Post safety signs/reminders in strategic places to ensure visibility.</li> <li>Provide barricades and safety barriers particularly at excavations and stockpiles of aggregates to prevent unauthorized personnel (students and school staff) from entering the project site</li> <li>Provide a first-aid kit at the site to ensure immediate emergency medical attention in case of accidents</li> <li>Strictly no unauthorized person to enter the work site.</li> <li>Comply with the COVID-19 health and safety protocols in compliance with DPWH</li> </ul> | Monitor implementation of the CSHP | Part of the construction management cost. | • Contractor   | DPWH BSPMC-UPMO     Third-party construction quality assurance firm |

| POTENTIAL RISKS AND   | RISK     | RISK MITIGATION MEASURES MONITORING PARAMETERS   | MONITORING PARAMETERS              | COST OF MITIGATION/                                     | INSTITUTIONA   | L ARRANGEMENT  |
|---|----------|--|------------------------------------|---|----------------|--|
| IMPACTS   | CATEGORY |  |                                    | MONITORING  | IMPLEMENTATION | SUPERVISION  |
|   |          | DO No. 38, series of 2020 and other instructions from the IATF.  |                                    |   |                |  |
| Risks and hazards to health and safety of students and school personnel   | HIGH     | <ul> <li>Provide barricades and safety barriers particularly at excavations and stockpiles of aggregates to prevent unauthorized personnel (students and school staff) from entering the project site</li> <li>Strictly no unauthorized person to enter the work site.</li> </ul>  | Monitor implementation of the CSHP | Part of the construction management cost.               | Contractor     | DPWH BSPMC-UPMO     Third-party     construction quality     assurance firm                                  |
| Ergonomic hazards from carrying/lifting heavy materials and equipment   | HIGH     | <ul> <li>Lifting heavy equipment, and materials should be done by lifting machine, using stable pulleys, and mechanism approved by the engineers.</li> <li>Always ensure stability in the lifting mechanism.</li> <li>Avoid areas where lifting of materials is being conducted.</li> </ul>  | Monitor implementation of the CSHP | Monitoring cost is part of construction management cost | • Contractor   | DPWH BSPMC-UPMO     Third-party     construction quality     assurance firm                                  |
| Unsafe scaffoldings and falseworks may compromise safety of workers, students, and school personnel.  | HIGH     | <ul> <li>Scaffolding should be strongly fitted using standard hinges, jacks, and clamps.</li> <li>Provide clear opening and walk through access through the scaffolding to avoid any risk of head bump and trip over while moving around.</li> <li>Ensure that unauthorized individuals (students and school personnel) will not have access to the construction site</li> </ul>   | Monitor implementation of the CSHP | Monitoring cost is part of construction management cost | • Contractor   | DPWH BSPMC-UPMO     Third-party     construction quality     assurance firm                                  |
| <ul> <li>Welding fumes may lead to illness (respiratory diseases)</li> <li>Welders may also be exposed to hazards such as heat, flame/fire, burns, and radiation</li> </ul> | HIGH     | <ul> <li>Hire only licensed NC2 welders</li> <li>Provide ventilation where welding and hot works are performed.</li> <li>Provide ventilation fans to diffuse oxides from welding machine away from the welder.</li> <li>Ensure that eye wash sprinkler is provided.</li> <li>Welding is prohibited in rooms with combustible materials or near explosives, flammable liquids, dusts, fumes. Or vapors.</li> <li>Ensure that workers have complete PPEs (i.e., mask, goggles, helmets or head shields fitted with suitable filter lenses, hand shields, fire-resistant aprons, gloves and boots) during the activity.</li> <li>Provide a portable fire extinguisher at the place where welding operations is undertaken.</li> </ul> | Monitor implementation of the CSHP | Part of the construction management cost.               | • Contractor   | DPWH BSPMC-UPMO     Third-party construction quality assurance firm  |
| Workers may be exposed to paint fumes that can cause irritation of the nose, throat, and lungs  | HIGH     | <ul> <li>Ensure proper ventilation in work area.</li> <li>Provide ventilation fans or air purifiers to diffuse paint fumes while painting.</li> </ul>  | Monitor implementation of the CSHP | Part of the construction management cost.               | Contractor     | <ul> <li>DPWH BSPMC-UPMO</li> <li>Third-party         construction quality         assurance firm</li> </ul> |

| POTENTIAL RISKS AND   | RISK     | MITIGATION MEASURES   | MONITORING PARAMETERS  | COST OF MITIGATION/                       | INSTITUTIONA   | L ARRANGEMENT   |
|---|----------|---|--|---|----------------|---|
| IMPACTS   | CATEGORY |   |  | MONITORING                                | IMPLEMENTATION | SUPERVISION   |
| Suspension and/or limited retrofitting activities due to extreme weather conditions | MEDIUM   | <ul> <li>Ensure that workers are not suffering from any lung diseases.</li> <li>Consider shifting schedules of painters to prevent exhaustion and longer exposure.</li> <li>The suspension of retrofitting works shall follow the work suspension order from the national government (i.e., typhoon, heavy rains, and/or other natural calamities).</li> <li>The Contractor can suspend work with the approval of the PIU.</li> </ul> | <ul> <li>Monitor if the measure is implemented</li> <li>Monitor weather updates</li> <li>Monitor the public service announcements from the national government and/or</li> </ul> | Part of the construction management cost. | • Contractor   | DPWH BSPMC-UPMO     Third-party     construction quality     assurance firm |
|   |          |   | Pasig City LGU   |   |                |   |

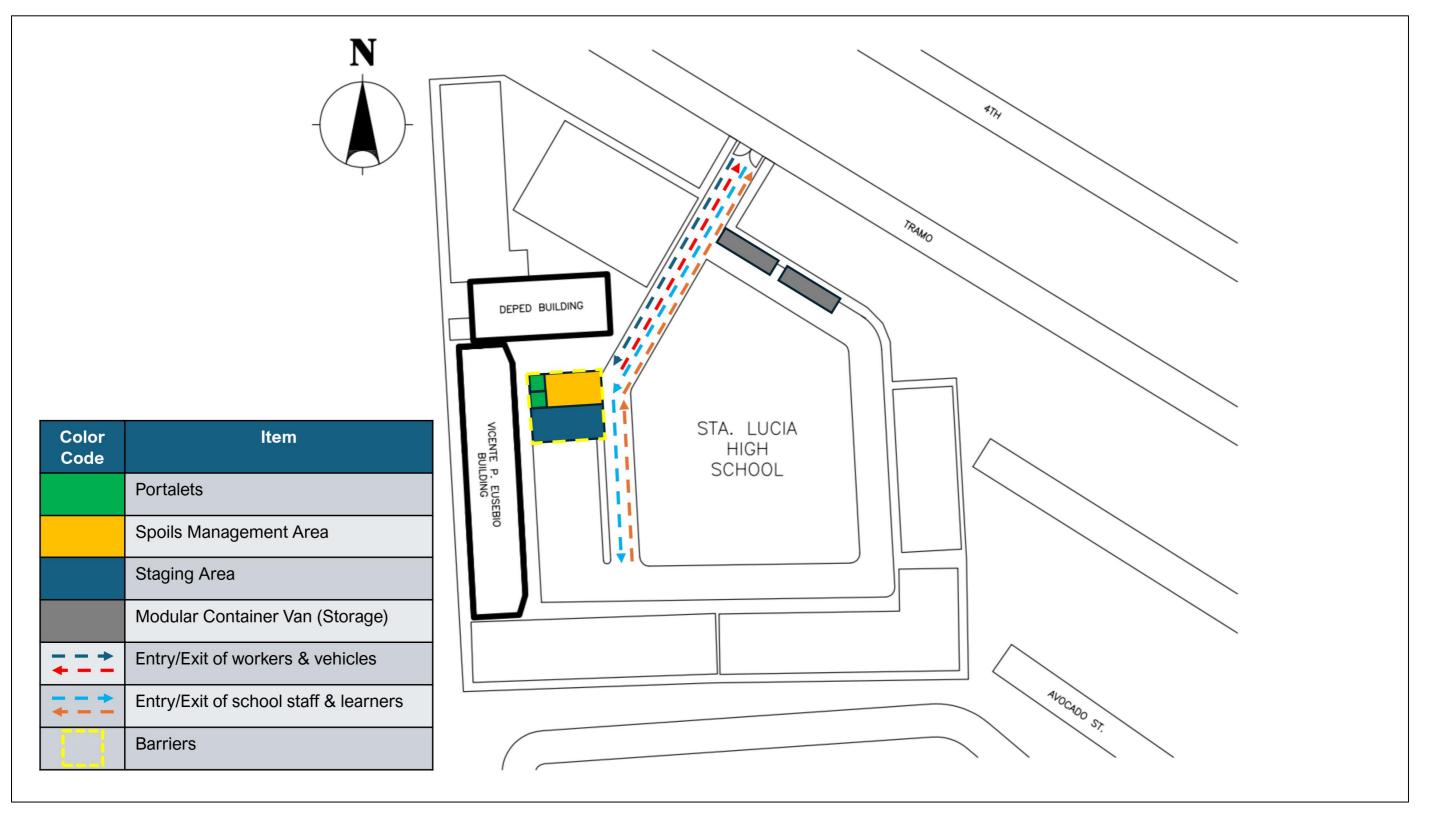


Figure 4-1: Location of Construction Activities and Proposed Mitigation Measures

ANGEL LAZARO & ASSOCIATES, INTERNATIONAL

# **5 ESMP IMPLEMENTATION**

# **5.1 Institutional Plan**

#### 5.1.1 DPWH-BSPMC-UPMO

The implementation of the ESMF will be consistent and aligned with the project implementation arrangements to ensure that identification and mitigation of risks are incorporated efficiently throughout subproject implementation. This includes the clustering of buildings to be retrofitted where screening and assessments will be programmed according to how the overall project will be grouping the contracts/construction of the buildings.

Safeguards functions will be carried out by designated DPWH staff, through institutionalized safeguards units that perform these functions for World Bank (and other development partners) funded projects. In addition, DPWH BSPMC-UPMO which will be responsible for field monitoring of retrofitting works from pre-works to completion/ acceptance. These functions will be carried out as an in-kind contribution of DPWH staff time and in coordination with the Construction Supervision Consultant, in accordance with the established institutional structure that is utilized for largescale civil works projects (including the 2018-2020 retrofitting program).

Generally, oversight for the Project will be by the DPWH BSPMC-UPMO. Particularly, all preconstruction activities of the project will be managed by the Project Preparation-Technical Working Group (TWG) and the Project Implementing Unit (PIU) will supervise the implementation of the project and subprojects. The DPWH BSPMC-UPMO is the implementing office for the subprojects. shows the proposed organizational set-up for the preparation and implementation of the PSRRRP.

The Environmental and Social Safeguards Unit (ESSU) was established to guarantee that the ESMF and site specific ESMP are properly and strictly implemented throughout the project cycle. The ESSU will be staffed by designated Environmental and Social Specialists as internal evaluators and specialists from other interested parties (stakeholders like DepEd) as external evaluators. The Implementing Offices will also assign EHS/safeguards focal persons while the contractor will be required to appoint a PCO or EHS Officer that will be the focal person on safeguard matters.

**Table 5-1** summarizes the tasks and institutional responsibilities for the project and subproject safeguards implementation. **Figure 5-1** shows the proposed organizational set-up for the implementation of the PSRRRP-ESMP.

| SAFEGUARD<br>ACTIVITIES   | TASK DESCRIPTION   | FORM/<br>DOCUMENT           | RESPONSIBILITY                                  | SUPERVISION       |
|---------------------------|--|-----------------------------|---|-------------------|
| Implementation            | <ul> <li>Prepare site-specific<br/>ESMP.</li> <li>Monitor and record<br/>implementation of<br/>ESMP/ECOP</li> </ul>  | Site-specific     ESMP/ECOP | Contractor                                      | DPWH- BSPMC- UPMO |
| Monitoring and Evaluation | <ul> <li>Evaluate the implementation and outcomes of ESMP.</li> <li>Recommends modification if necessary.</li> </ul> | Site-specific     ESMP/ECOP | <ul><li>BSPMC-UPMO</li><li>Contractor</li></ul> | DPWH- BSPMC- UPMO |

## 5.1.1.1 Contractor

The contractor shall:

- a) Have an overall responsibility for project coordination, implementation, and liaison with the PIU;
- b) Hire qualified and experienced personnel for the following positions:

#### a. EHS Officer

- Responsible for managing the environmental and safety impacts of the contractor;
- ii. Ensure compliance with WB safeguards and applicable Philippine legislations and guidelines;
- iii. Ensure that all workers are oriented with all environmental and safety requirements, including plans and procedures;
- iv. Ensure implementation of the site-specific ESMP;
- v. Provide regular monitoring reports and updates to ESSU; and
- vi. In coordination with the ESSU, update the ESMP if there are better measures that can be applied to the project.

# b. Safety Officer

- i. Compliance with the provisions of Republic Act No. 11058 pertaining to occupational safety and health (OSH) and DOLE regulations;
- ii. Organize regular health and safety training sessions/toolbox meetings;
- iii. Conduct investigation and reporting for any workplace accidents or injuries;
- iv. Conduct regular workplace safety inspections and equipment checks;
   and
- v. Implement emergency procedures as needed.

#### c. Social Officer

- i. Responsible for managing the social impacts of the contractor;
- ii. Ensure that all workers are oriented with the social requirements, including plans and procedures;
- iii. Conduct meetings for project updates and developments with identified stakeholders for the project;
- iv. Establish database pertaining to the grievance redress mechanism (GRM);
- v. Provide regular monitoring reports and updates to ESSU; and
- vi. In coordination with the ESSU, update the ESMP (Social) if there are better measures that can be applied to the project.

## d. Pollution Control Officer

- i. Compliance with the provisions of DENR rules and regulations;
- ii. Preparation and submission of environmental reports and permits to DENR;
- iii. Conduct environmental monitoring detailed in the ESMP;
- iv. Identify potential causes and implement corrective measures if there samples that did not meet the standards;
- v. Provide IEC on pollution prevention practices, waste management, and hazardous materials handling; and
- vi. Ensure proper accounting, storage, handling, transport, and disposal of hazardous wastes.

# 5.1.2 DepEd Schools Division Office (SDO) of Pasig City

The SDO of Pasig City shall maintain close coordination with DPWH-BSPMC UPMO, ESSU with regards to the project development and assist the School Administration with the implementation of the student relocation plan.

# 5.1.2.1 Sta. Lucia High School

The School Administration of Sta. Lucia High School shall cooperate with the SDO of Pasig City, DPWH-BSPMC UPMO, ESSU, and contractor with regards to project development and implementation of the ESMP.

The School Administration shall also ensure its participation and improve membership of existing committees to address specific concerns (i.e., grievances, gender-based violence (GBV), sexual exploitation and abuse, and sexual harassment (SEA-SH), traffic management, among others) that may arise during project implementation.

# 5.1.2.2 Stakeholders

The project stakeholders, including the Barangay Local Government Unit (BLGU) of Sta. Lucia, School Parent-Teachers Association (SPTA), and Supreme Secondary Learner Government (SSLG) shall:

- a) Attend and participate in project-related meetings;
- b) Report possible violations or non-compliances following the project GRM;
- c) Provide feedback on the implementation of the ESMP; and
- d) Provide recommendations to improve the implementation of the ESMP.

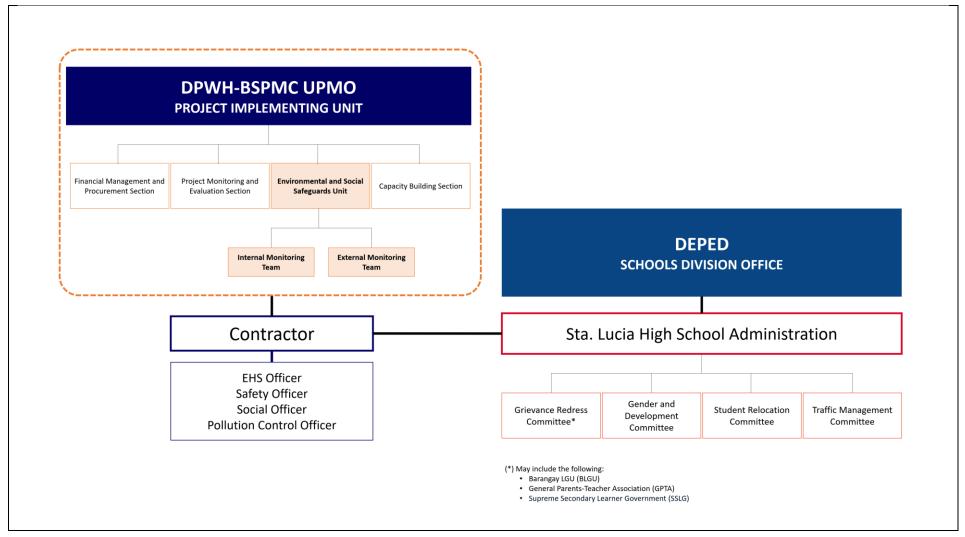


Figure 5-1: Sta. Lucia High School PSRRRP Organizational Structure

# **5.2 MONITORING AND REPORTING**

**Contractor Monitoring and Reporting.** A project daily activity logbook/construction logbook will be maintained at the site to detail the daily activities at the site. The contractor will be tasked to prepare the logbook that contains information on the date, weather/weather chart, manpower, equipment, construction activities for the day, site visitors, issues and problems encountered, recommendations and actions taken, complaints received, and accidents and safety incidents. The daily construction logbook will be checked by the PIU during routine monitoring.

**PIU Monitoring.** Timely and effective monitoring is fundamental to ensure compliance and facilitate adaptive management. The monitoring of implementation of the mitigating measures by the contractor as contained in the site-specific ESMP shall be the responsibility of the PIU, to be supervised by the PSRRRP-ESSU. The PIU, with assistance of a third-party construction supervision firm shall routinely monitor subproject activities to check the progress of works, ensure that the works are in accordance with plans and specifications, and if environment, health and safety measures as embodied in the ESMP are being properly implemented. The PIU through the Environmental and Social Safeguards Unit will also evaluate onsite conditions and inspect work camps, materials yard, and waste storage and disposal site. The PIU will check on workers' health and safety and the overall sanitation and housekeeping practices at the worksites and meet with the school administration and adjacent community to inquire on any issues that they may have about the subproject activities. The Environment and Social Safeguard Site Instruction Form and Inspection Checklist (Annex D) will be filled out by the PIU to document findings during the site visit. Adverse findings during site inspections will be relayed immediately to the contractor through the site instruction so that corrective actions are implemented and closely monitored.

The Contractor will submit to PIU monthly project status report containing information on the progress of project construction, materials logbook, weather chart, together with compilation of monitoring charts, status reports, environment and social safeguard site instructions and inspection checklists, minutes of meetings, and correspondences. The PIU will upload the project monitoring information at DPWH's Project Contract Management Application (PCMA) online monitoring system. The PCMA allows geotagging of a project.

At the end of the construction activities, monitoring will be conducted to check whether the site has been satisfactorily restored. The site should be free of pollution and hazards left over from construction. The result of the inspection is critical because it may become the basis whether the project may be turned over by contractor or not.

## 5.3 STAKEHOLDER ENGAGEMENT PLAN

The Stakeholder Engagement Plan (SEP) was formulated to ensure that stakeholders are aware of the risks and implications of the project, as well as the mitigation measures in place to address any detrimental impact of the project on stakeholders and communities.

During the project implementation, consultations with subproject-specific stakeholders, such as the school administrations, neighboring communities, pertinent local government units, impacted building users, such students, and small companies or concessionaires. Consultations, will take place during project execution. Discussions will center on social and environmental risks unique to the location, along with ways to reduce disruptions to classes and canteen operations.

# A. Methods of Engagement

The Project Proponent shall consult the stakeholders in particular subprojects during the project implementation. DepEd will be also consulted to discuss the roles and duties of each agency in the project implementation, to provide updates on its status, and to address any concerns.

To enhance the effectiveness of the engagement process, the following principles will be adhered to:

- a. the culture, fundamental human rights, values and traditions of stakeholders are respected in accordance with established legal precedent and accepted practice in the Philippines;
- b. stakeholders are treated with sensitivity and respect in terms of their issues, views and suggestions;
- c. interaction with stakeholders is meaningful, culturally appropriate (including language, as needed), and is timely, transparent and responsive;
- d. vulnerable groups are included in the engagement to assess differential needs and perceptions of stakeholder groups (i.e. men, women, youth);
- e. data from stakeholder engagement is incorporated into assessments site-specific environmental and social management and mitigation plans as needed;
- f. access to information and disclosure will be ensured to ensure stakeholders are informed about the Project, its potential benefits, impacts and risks, affected peoples' entitlements, GRM channels; and
- g. informed consultation without coercion to ensure that communities and households have power of choice to participate, or not, in the Project.

The Environmental and Social Safeguards Unit (ESSU) of the PIU and the consultant will conduct the SEP consultations. The main objectives of the consultations will be to provide an explanation of the Project, its effects, its mitigating measures, and the grievance redress mechanism. On demand, consultations might potentially go over:

- a. DPWH earthquake resilience programs to ensure the safety of all public infrastructures;
- b. Long-term benefits of seismic retrofitting programs;

- c. Facility-based disaster risk awareness;
- d. Public awareness campaigns regarding the earthquake safety measures and plans for the Metro Manila in preparation for the "The Big One" Scenario; and
- e. Individual survival safety measures.

# B. Levels and Frequency of Engagement

The stakeholder engagement activities at different levels during the project implementation are presented in **Table 5-2.** 

**Table 5-2: Stakeholder Interactions During the Project Implementation** 

| LEVEL OF INTERACTION | STAKEHOLDER  | NATURE OF INTERACTION                               | OBJECTIVE  | TIMELINE/<br>FREQUENCY  |  |  |  |  |  |
|----------------------|--|---|--|---|--|--|--|--|--|
| National             | DepEd Central<br>Office<br>(representative/s)  | Coordination<br>Meeting                             | To discuss the implementation arrangement and timeline of the project.   | Before issuance of the Notice to Proceed (NTP) to the contractor. |  |  |  |  |  |
|                      |  | Progress Meeting                                    | Update the progress, resolve issues and other concerns about the project.  | Quarterly or as necessary   |  |  |  |  |  |
| Project Level        | School<br>Administrator/s  | Project<br>Awareness and<br>Coordination<br>Meeting | To discuss the project's objectives, long-term benefits, implementation arrangement and timeline of the project.   | Before project<br>mobilization                                    |  |  |  |  |  |
|                      |  | Progress Meeting                                    | Update the progress, resolve issues and other concerns about the project.  | Monthly or as necessary   |  |  |  |  |  |
| Community Level      | Project-Affected Persons i.e. Parents-Teachers Association (PTA), Students, Patients, nearby LGUs, homeowners, concessionaires, and others | Project<br>Awareness and<br>Consultation            | To inform the affected persons of the project benefits, impacts and corresponding mitigating measures; consult with them on issues they may have based on the impacts presented and work out possible ways to address those issues | Before<br>subproject<br>mobilization                              |  |  |  |  |  |

## **5.4 DISCLOSURE AND CONSULTATION**

During project implementation, disclosure and consultations will involve subproject-specific stakeholders including administrations of school, nearby communities, relevant LGUs, affected building users such as students, patients and small businesses or concessionaires. Consultations will be on site-specific social and environmental risks including measures to minimize disruption of classes and canteen services.

The conducted stakeholder consultations for Sta. Lucia High School are provided below:

**Table 5-3: Conducted Disclosure and Consultations** 

| Activity  | Schedule and Venue   | Attendees   |
|---|--|---|
| Site Inspection /<br>WB Checklist<br>Interview              | 08 March 2024<br>9:00 AM to 2:00 PM<br>Sta. Lucia High School    | <ul> <li>School Administration</li> <li>DepEd Pasig SDO</li> <li>DPWH BSPMC-UPMO</li> <li>ALAI</li> <li>E&amp;S Consultants</li> </ul>  |
| Public Consultation   | 30 July 2024<br>1:30 to 4:00 PM<br>Sta. Lucia High School        | <ul> <li>Pasig LGU (Office of the Building Official)</li> <li>Sta. Lucia High School Administration</li> <li>School Parent-Teacher Association</li> <li>Sta. Lucia High School: Supreme Secondary Learner Government</li> <li>Barangay Sta. Lucia LGU</li> <li>Homeowners Association</li> <li>DPWH Representatives</li> <li>ALAI</li> <li>E&amp;S Consultants</li> </ul> |
| Focus Group<br>Discussion for<br>Student Relocation<br>Plan | 20 November 2024<br>09:00 AM - 11:00 AM<br>Sta Lucia High School | <ul> <li>School Administration         <ul> <li>Principal</li> <li>Assistant to the Principal</li> <li>Head Teachers</li> <li>SDRRM Coordinator</li> </ul> </li> <li>Sta Lucia High School - SSLG President</li> <li>DPWH</li> <li>ALAI</li> <li>E&amp;S Consultants</li> </ul>   |

The table below summarizes the raised issues, concerns, suggestions and agreements during the consultations.

Table 5-4: Summary of Issues, Concerns, Suggestions, and Agreements

| Issues/Concerns/Suggestions   | Agreement/s  |
|-------------------------------|--|
| <b>Environmental Concerns</b> |  |
| Generation of dust and noise  | The Contractor will put up a barrier for the building and stockpile as a mitigating measure to ensure that dust and noise will be contained. |

| Issues/Concerns/Suggestions   | Agreement/s   |  |  |  |  |  |  |
|---|---|--|--|--|--|--|--|
| Water and power consumption of the Contractor   | Daily monitoring of noise (noise meter) and dust (visual) will be conducted.  The contractor shall have their own submeters for water and electricity to monitor their own consumption.   |  |  |  |  |  |  |
| Possible loss of vegetation (ornamental plants and trees)   | The payment for the consumed utilities will be paid by the Contractor as part of their contract.  The consultant recommended that the Contractor restore the vegetation in the school after to the retrofitting activities.                         |  |  |  |  |  |  |
| Social Concerns   |   |  |  |  |  |  |  |
| Child Protection  | Only the storage for the equipment, the warehouseman and/or security personnel may stay inside the campus.  |  |  |  |  |  |  |
|   | Also, the provided security personnel of the Contractor will assure the safety within the construction site.  |  |  |  |  |  |  |
|   | The Contractor must also ensure that the ingress and egress, and the comfort rooms of the workers are separate from the students and school personnel.  |  |  |  |  |  |  |
| Student relocation / learning continuity  | Implementation of school-wide shortened period and blended learning.  |  |  |  |  |  |  |
| Relocation of affected school personnel   | The inventory, packaging and labelling of supplies and equipment that will be transferred or stored will be done jointly by the school representative of Sta.   |  |  |  |  |  |  |
| Transfer of equipment within the building   | Lucia High School and the workforce of the contractor.  |  |  |  |  |  |  |
| Safety of the adjacent buildings  | The consultant will adopt protection between the buildings. The Contractor shall adopt the strategic approach to ensure the safety of the building and its adjacent buildings.  |  |  |  |  |  |  |
| Other Concerns  |   |  |  |  |  |  |  |
| Project implementation  | The consultants will consider the suggestion of the school administration.  |  |  |  |  |  |  |
|   | For Sta. Lucia High School, the consultant adopted<br>an overlapped retrofitting schedule of the school<br>buildings, and the contractors may extend the<br>working hours of the retrofitting to shorten the<br>duration of the retrofitting works. |  |  |  |  |  |  |
| Monitoring of the project   | The representatives and engineers from the DPWH-Bureau of Construction, and consultant team (ALAI) will visit and monitor the site.   |  |  |  |  |  |  |
| Existing traffic conditions:  - Hauling of construction debris - delivery of construction materials | During the construction, the contractor will only adapt the size of the truck that will fit with the existing dimensions of the gates.  |  |  |  |  |  |  |
|   | The contractor will utilize smaller trucks, the delivery of materials will be more frequent.  |  |  |  |  |  |  |

| Issues/Concerns/Suggestions | Agreement/s   |
|-----------------------------|---|
|                             | Delivery of materials and hauling of construction debris will also be conducted during nighttime to avoid the disruption of classes |
| Contractors' Scope of Work  | The scope of work will be provided prior to the commencement of retrofitting activities in the school                               |

# **5.5** GRIEVANCE REDRESS MECHANISM

The project's grievance redress mechanism will address stakeholders' concerns and complaints promptly, using a transparent process that is responsive, culturally appropriate, and readily accessible to all segments of the affected communities at no cost and without retribution. The mechanism should not impede access to the country's judicial or administrative remedies. The redress mechanism will be communicated to the nearby communities and stakeholders of the project and subprojects. A separate grievance redress mechanism for the workers is established to address their complaints and is described in the Labor Management Procedures.

A Grievance Redress Committee will be established as needed. The GRC will be comprised of representatives from asset owner, PIU, and the contractor. GRC will receive, evaluate and facilitate the resolution of concerns, complaints and grievances of all stakeholders.

# A. Procedure for filing the formal Complaint/Grievance:

- 1. Any key stakeholder of the project may file a complaint.
- 2. Complaint should be made to Grievance Redress Committee (GRC). It may be oral, by email citizens\_feedback@dpwh.gov.ph or in writing. If the complaint is oral, it will be converted into a written form by the GRC member who received the complaint and authenticated by the complainant under his / her signature as soon as possible.
- 3. If the complainant would not like to reveal his/her name for any grievance, they can drop the grievance(s) in the drop box specific for the project.

All complaints received by any member of the committee shall be forwarded to citizens\_feedback@dpwh.gov.ph for proper documentation.

# B. Procedure for filing the formal Complaint/Grievance:

- 1. Upon receipt of complaint, the GRC should send a response to the complainant acknowledging the receipt of grievance within 48 hours.
- 2. Based on the nature of the complaint and severity of its possible impact, the GRC may take one of the two options to proceed on addressing the concerns:
  - a. Option 1 which can be exercised on matters that could be more routine operation:
    - The asset owner representative may issue a direct instruction to the implementing office and contractor regarding the complaints in the construction.
    - ii. It is important that the complainant is well-informed of the actions taken or the work-in-progress within 15 days upon acknowledging receipt of grievance.

- iii. Once the matter has been resolved the GRC should send a final update to the complainant on the matter.
- b. Option 2 which can be exercised in matters of very serious concern:
  - i. The GRC must convene for a meeting immediately after the complaint has been filed.
  - ii. The Committee, as required, may also call for a deposition by the complainant and the person/s involved in the complaint.
  - iii. Final decision of the GRC has to be communicated to the complainant within 15 days of the receipt of the complaint.
- 3. If no understanding or amicable solution can be reached, or if the complainant does not receive or is dissatisfied with the response from the GRC within 15 days of registry of the complaint, he/she can appeal to the PSRRRP Project Implementing Unit (PIU), which should act on the complaint/grievance within 15 days from the day of its filing. Representative from the PSRRRP Project Implementing Unit (PIU) may be contacted in the following means: email address: citizens\_feedback@dpwh.gov.ph; office address: DPWH Central Office Bonifacio Drive, Port Area, Manila; Telephone No.: 8888; CP no.: 8888
- 4. If the affected person is not satisfied with the decision of the PSRRRP PIU, he/she, as a last resort, can submit the complaint to any court of law.

## **5.6 LABOR MANAGEMENT PLAN**

These labor management procedures provide an overview of the applicable Philippine laws and policies, and WB Environmental and Social Standards ESS2 provisions addressing the labor risks and issues that may arise during implementation of the Philippines Seismic Risk Reduction and Resiliency Project.

The LMP is a living document, which is initiated early in project preparation, and is reviewed and updated throughout the project development and implementation.

# 5.6.1 Characteristics of Project Workers

**Direct Workers**. These people are employed directly by DPWH to work specifically in relation to the project. The project will assign a Project Implementation Unit (PIU) under the DPWH Earthquake Resiliency - Project Management Office (DPWH ER-PMO) who will supervise and oversee the project implementation. It will consist of permanent employees from the different Bureaus, Services, Project Management Office of the Department as well as the Regional Office (RO) and District Engineering Offices (DEO) of NCR.

**Contracted Workers.** These people are employed through third parties to perform work related to core functions of the project, regardless of location. Third parties may include contractors, subcontractors, or intermediaries. For this project, contracted workers are identified as follows:

Retrofitting consultants will be engaged in the early stage of the project to conduct detailed engineering works on public school buildings, and to design the retrofitting plans.

Construction workers are anticipated to do the retrofitting works for component 1 of the project hired by the winning contractors. Contractors will be chosen based on the process stipulated in the procurement plan of this project.

**Vulnerable Workers**. It is not yet identified if there are any vulnerable workers who will be engaged in the project but if so, protection to such workers will be based on the Labor Code of the Philippines, and other laws and guidelines set in the ESS2 of the ESMF.

No person under the age of 18 will be employed in compliance with the Labor Code of the Philippines and the Special Protection of Children Against Child Abuse, Exploitation and Discrimination Act. Also, discrimination against disabled and women workers will be avoided as mandated under the Magna Carta for Disabled Persons (RA 7277, as amended by RA 9442) and Magna Carta of Women (RA 9710) respectively.

**Security workers**. The winning contractor/s for the retrofitting of public schools is/are anticipated to use a small number of security workers to protect the project construction sites, project workers and other stakeholders. In each site, security personnel of the contractor may range from 1 to 3 depending on the number of works shifts and arrangements with the school administration on the use of their own security personnel.

# 5.6.2 Age of Employment

a) Minimum Age of Employment

According to Article 137 of the Labor Code of the Philippines, no person below eighteen (18) years of age shall be allowed to be employed in an undertaking which is hazardous or deleterious in nature as determined by the Secretary of Labor and Employment.

Considering the scope of the project, it is unlikely that the project would hire a person below eighteen (18) years of age.

# b) Age Verification Process

To prevent engagement of underage workers, an age verification process is required to be undertaken by the winning contractor/consultant prior to the engagement of the project worker. All contractual provisions should comply with the minimum age requirements and the responsible staff is required to maintain a labor registry of all hired project workers.

#### 5.6.3 Terms and Conditions

#### a) Specific Wage

Individuals hired through COS shall be paid by the prevailing market rates, subject to the provisions of Republic Act No. 9184 and its Implementing Rules and Regulations; whereas, individuals hired through job order shall be paid wages equivalent to the daily wages/salary of comparable positions in government and a premium of up to 20% of such wage/salary.

Workers employed by the third parties for the retrofitting works shall be paid in accordance with the Labor Code. Minimum wage rates to be applied shall be those prescribed by the Regional Tripartite Wages and Productivity Boards.

# b) Hours of Work

The normal hours of work of project workers shall not exceed 8 hours a day, exclusive of time for meals. If the worked performed exceeds the normal working hours, overtime pay shall be given.

#### c) Rest Per Week

Direct worker is entitled to a 2-day rest period during weekends (Saturday and Sundays). Contracted workers shall also be entitled to rest days depending on the terms and conditions stated in their contract. At minimum, they shall have a rest period not less than twenty-four (24) consecutive hours after every six (6) consecutive normal workdays. Both direct and contracted workers shall also be entitled to a rest day on regular holidays recognized by the State.

#### d) Termination of Contract

The contract of employment shall cease at the end of the period stated therein. However, the contract may be pre-terminated by the hiring authority due to failure to provide the standard of service required under the agreement, breach of any provision thereof, breach of trust, loss of confidence, and for reasons detrimental to the interest of the agency, provided that the project worker is informed in writing at least 30 days prior to the effectivity of such termination. Likewise, the project worker may pre-terminate the contract provided that a written notice is submitted to the hiring authority, stating therein the reasons for the pre-termination, at least 30 days prior to the proposed date of effectivity thereof, and the same has been received, accepted, and approved in writing by the hiring authority.

## e) Deduction from Remuneration

No deductions other than those agreed upon in the contract or those prescribed by law or regulations shall be made from a worker's remuneration. The hiring authority is prohibited to demand or accept from the worker any cash payment or gifts in return for admitting such worker to employment or for any other reasons connected with the terms and conditions of employment. Medical Treatment of Injured and Sick Workers

Any injury, illness or accident sustained by the worker during the work period shall be conveyed to the nearest clinic or hospital by the hiring authority or its representative. For workers who are suspect or confirmed COVID-19 patients, the Project will abide by the Project Implementation Guidelines during COVID-19 pandemic.

## **5.7 WASTE MANAGEMENT PLAN**

Construction waste will inevitably be generated during the retrofitting activities in the school. Wastes are composed of non-hazardous, hazardous, and residual.

To address this concern, the **Contractor** shall implement a waste management plan (WMP), which classifies waste strategies according to the desirability of handling up to the disposal via waste hierarchy scheme. The waste hierarchy scheme is commonly referred to the principle of 3R's – reduce, reuse, and recycle. The principle, in general, is summarized and briefly discussed in in **Figure 5-2**. The strategies for the solid waste management are further discussed in **Table 5-5**.

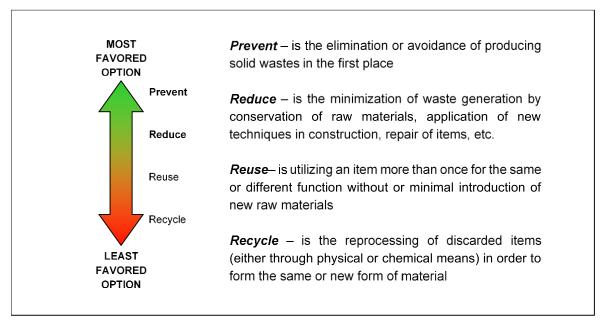


Figure 5-2: Waste Hierarchy Scheme

**Table 5-5: Waste Hierarchy Scheme – WMP Option and Strategies** 

| WMP Option | Strategy   |  |  |  |  |  |  |  |  |  |  |
|------------|--|--|--|--|--|--|--|--|--|--|--|
| Prevent    | <ul> <li>Prepare an efficient purchase, delivery and inventory system for the essential supplies to prevent expiration or spoilage of the raw materials and products, thus preventing or reducing solid waste generation</li> <li>Train the Contractor's personnel to handle carefully the construction and raw materials and to prevent rejects and damages</li> <li>Regularly maintain/clean construction equipment to prevent any contamination to the environment.</li> </ul>  |  |  |  |  |  |  |  |  |  |  |
| Reduce     | <ul> <li>Issuance and strict implementation of a waste segregation (biodegradable and non-biodegradable) and collection schedule policy for all Contractor's personnel</li> <li>Provision of solid waste handling and storage facilities, such as dumpsters, trash cans in common areas in the transport terminal, construction area and administrative office.</li> <li>Repair equipment and other auxiliaries instead of completely discarding it</li> <li>For other communications, use electronic forms instead of paper forms to reduce usage of paper</li> </ul> |  |  |  |  |  |  |  |  |  |  |

| WMP Option | Strategy  |
|------------|---|
|            | Put residual and other general solid wastes in their appropriate bins, and shall be disposed in accordance to the schedule of the Pasig City solid waste collection system  |
| Reuse      | <ul> <li>Use old office forms for other non-confidential documents, communication postings, and other similar applications</li> <li>The biodegradable wastes, such as discarded kitchen wastes and raw materials, shall be given to traders engaged in composting/organic fertilizer</li> </ul> |
| Recycle    | Gather discarded cardboard, paper-based, plastic-based, and glass-based materials for hauling by waste traders  |

The concept of the Waste Hierarchy Scheme is also complemented by Waste Segregation. Waste Segregation refers to the separation of recyclable and non-recyclable solid wastes. Further, solid wastes can also be separated by biodegradable and non-biodegradable.

For the solid wastes to be easier to identify and segregate, a color-coding scheme will be applied in the facility. Different types of wastes are placed in color-coded plastic bags or waste bins. The color-coding scheme makes it easier for the waste generators and collection workers/housekeeping personnel alike to segregate the wastes prior to disposal. The solid waste color-coding scheme is summarized in **Table 5-6.** 

**Table 5-6: Solid Waste Color-Coding Scheme** 

| Color Coding | Type of Waste  |
|--------------|--|
| Black        | Non-Recyclable/Residual Waste  |
|              | Non-Recyclable Plastics etc.   |
| Green        | Biodegradable Waste  |
|              | Food and garden wastes   |
|              | • Left-over or spoiled food, tree trimmings, canteen wastes, discarded raw     |
|              | materials  |
| Blue         | Recyclable items   |
|              | Plastics bottles, glass, metal caps, newspapers, cardboard boxes, office       |
|              | • forms  |
| Yellow       | Hazardous wastes   |
|              | Broken light bulbs, discarded batteries, electronic items, chemical containers |

# Types of Waste and its Management

**Non-Hazardous Waste**. The non-hazardous waste should be placed in waste segregation bins. Separate bins will be provided for biodegradable waste (food wastes), recyclable waste (wires, pipes, rebars, and other pieces of metal), and hazardous waste. Excavated soil will be used as filling materials while other recyclable materials such as wooden planks may be used for formworks and scaffolding. The recyclable materials will be collected and separated onsite from other waste sources for reuse or for sale.

Burning of garbage and construction wastes shall be strictly prohibited at the site. Materials which are clearly a danger to building occupants e.g. exposed nails, broken glass, steel beams, etc. should be properly collected to avoid accidents. Work areas will be maintained clear of waste materials and obstructions. Stockpiles of waste materials will not be allowed.

**Hazardous Waste**. Hazardous waste should always be segregated from the non-hazardous wastes. Designate an area for the temporary storage of empty containers (paints, solvents, epoxy resins, adhesives, degreasers), oily rags, and busted lamps. Proper labels should be affixed on bins of these types of hazardous wastes. As a hazardous waste generator, the contractor is required to secure a Hazardous Waste Generator Registration with the DENR and to commission the services of a DENR-registered hazardous waste transporter and treater for the collection and disposal of hazardous wastes. A Hazardous Waste Manifest must be completed to document the amount of hazardous waste generated and collected/disposed for offsite treatment. The DENR-recognized treater should issue a Certificate of Treatment (COT) ascertaining the safe treatment and disposal of the hazardous waste. The COT records shall be kept for proper documentation.

**Asbestos Containing Materials.** There may be situations wherein the affected building section may contain asbestos materials as high-density products in roofing and flat sheets/walls of existing building. The use of amosite (brown) and crocidolite (blue) asbestos fibers and of products containing these fibers is strictly prohibited and that no spraying of all forms of asbestos in buildings is allowed. The contractor must undertake specific precautions if materials containing asbestos are present or encountered during works in order to ensure the protection of workers and occupants of the building. Asbestos fibers may be carried to the lungs. Prolonged and cumulative exposure is harmful and may cause asbestos-related diseases.

The procedure for handling asbestos materials must comply with the DENR Chemical Control Order on asbestos and the DOLE Order No. 154, series of 2016 on the management of asbestos in the workplace. In case asbestos materials is encountered at the work site, the following procedures should be followed:

- If asbestos is identified during the dismantling work, work will be suspended until DENR is notified of the situation. Only DENR licensed asbestos handlers are allowed to enter the premises.
- Notify the DENR of the proposed removal work and coordinate the activities with the DOLE with regards to the methods to be employed, inspections, decontamination, control monitoring and clearance inspections.
- The removal work must be assigned to a suitably qualified asbestos removal specialist.
- Isolate the site and provide barriers
- Restrict access from the general public to the site
- Erect appropriate signs and keep all access points locked at all times
- Following removal works, all surfaces are to be thoroughly cleaned using HEPA filtered vacuum and wet pipe techniques.
- On completion, the site must be carefully checked for visible asbestos containing materials.
- Any asbestos materials must be placed into asbestos plastic bags and then removed from the site by DENR-licensed waste transporter and treater.
- A hazardous waste manifest shall be completed for the transport, treatment and disposal of asbestos wastes offsite.

# **5.8 TRAFFIC MANAGEMENT PLAN**

During the retrofitting activities, the project is expected to contribute additional vehicular traffic in the project area. To mitigate this impact, a traffic management plan (TMP) was prepared as **Annex C** of this document. The TMP will be implemented to minimize traffic disruption and to promote road safety in the project site and in its immediate surrounding area.

# **6 PROJECT TIMELINE AND COST**

#### **6.1 SCHEDULE AND IMPLEMENTATION BUDGET**

# 6.1.1 Project Duration

The duration for retrofitting each building is shown in **Table 6-1**.

**Table 6-1: Expected Project Duration** 

| SCHOOL BUILDINGS            | DURATION (IN<br>MONTHS) |
|-----------------------------|-------------------------|
| DepEd Building              | 7                       |
| Vicente P. Eusebio Building | 12                      |

# 6.1.2 Implementation Schedule

The indicative implementation of the retrofitting activities is presented in **Table 6-2**. The implementation schedule is based on the following assumptions:

- Project duration was based on an 8-hour workday;
- The contractor can extend their working hours during vacation months (April and May) and may work during the weekends;
- Project briefing will be on the 2nd Quarter of 2025, once the contractor for the project has been identified. Further briefings will be conducted as necessary;
- Personal belongings of school staff will be brought home to reduce storage requirements during the retrofitting works;
- Retrofitting activities will be done in the month of August; and
- Inspection and punch listing should be done per floor to shorten the turnover period.

# 6.1.3 Indicative Budget for ESMP Implementation

**Table 6-3** shows the projected costs for the Contractor's labor force, mitigation measures, preventative actions, and monitoring.

**Table 6-2: Indicative Implementation Schedule** 

| No.   | Activity  |   | 2025 |   |   |   |   | 2026 |   |   |   |   |   |   |   |   |   |   |   |   |   |
|-------|---|---|------|---|---|---|---|------|---|---|---|---|---|---|---|---|---|---|---|---|---|
|       |   | М | J    | J | Α | S | 0 | N    | D | J | F | М | Α | М | J | J | Α | S | 0 | N | D |
| 1     | Project Briefing/Status Updating                                |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 2     | May 2025 Elections  |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 3     | Start of Classes  |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
|       | (SY 2025-2026)  |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   | ı |
| 4     | Mobilization/Inventory of equipment to be transferred or stored |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 5     | Transfer of equipment, desks, chairs to upper floors            |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 6     | Printing of modules   |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 7     | Retrofitting Works (DepEd Bldg.)                                |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 8     | Inspection, punch listing and turn-over of DepEd Bldg.          |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   | i |
| 9     | Transfer of equipment, desks, chairs to upper floors            |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 10    | Retrofitting Works (VPE Bldg.)                                  |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 11    | Inspection, punch listing and turn-over of VPE Bldg.            |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 12    | End of Classes  |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   | i |
|       | (SY 2025-2026)  |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 13    | Start of Classes  |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
|       | (SY 2026-2027)  |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 14    | Demobilization  |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| 15    | Monitoring of the SRP and GRM Implementation                    |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |
| Note: | - Summer Break  |   |      |   |   |   |   |      |   |   |   |   |   |   |   |   |   |   |   |   |   |

Table 6-3: Indicative ESMP Implementation Budget for Sta. Lucia High School

| COMPONENT/S   | UNIT OF WORK MEASUREMENT            | UNIT/LOT     | UNIT COST<br>(PHP) | DURATION<br>(MONTHS) | TOTAL COST (PHP)                     |  |
|---|-------------------------------------|--------------|--------------------|----------------------|--------------------------------------|--|
| Permits   |                                     |              |                    |                      |                                      |  |
| Certificate of Non-Coverage (CNC)   | Processing and Application Fee Cost | 1            | 50,000.00          | -                    | 50,000.00                            |  |
|   |                                     |              |                    |                      | Free of charge as per Pasig City LGU |  |
| Building, Electrical, Mechanical, Sanitary, and   |                                     |              |                    |                      |                                      |  |
| Occupancy Permit; Fire Safety Inspection Certificate (FSIC)   |                                     |              |                    |                      | Part of the Structural Cost Estimate |  |
| Tree Cutting/Trimming Permit  | Processing and Application Fee Cost | 1            | _                  | -                    | 333,500.00                           |  |
| Stockpile Management  | посельну шта пррисанент се сесе     | <del>_</del> |                    |                      | Part of the Structural Cost Estimate |  |
| Termite Control Works (Soil Poisoning)  | Per building                        | 2            |                    |                      | Part of the Structural Cost Estimate |  |
| Dust Suppression  |                                     | <del>_</del> |                    |                      | Part of the Structural Cost Estimate |  |
|   |                                     |              |                    |                      | Tare of the outdown cook Ediniate    |  |
| <ul> <li>Provision of nets/sheeting and temporary screens</li> </ul>  |                                     |              |                    |                      |                                      |  |
| Air vacuum pumps and ventilation exhaust fans   |                                     |              |                    |                      | Part of the Structural Cost Estimate |  |
| for indoor concrete chipping  |                                     |              |                    |                      | Part of the Structural Cost Estimate |  |
| Water spray to suppress dust  |                                     |              |                    |                      |                                      |  |
|   |                                     |              |                    |                      |                                      |  |
| Noise Mitigation  Noise Meter Procurement   |                                     | 2            | 15 000 00          | -                    | 30,000.00                            |  |
|   | Por building                        |              | 15,000.00          | -                    | •                                    |  |
| Noise/Acoustic Barrier  Marke Markers Mar | Per building                        |              |                    |                      | Part of the Structural Cost Estimate |  |
| Waste Management  |                                     |              |                    |                      |                                      |  |
| Non-Hazardous Waste Generation  |                                     | 75           | 2 500 00           |                      | 107 500 00                           |  |
| (Provision of receptacle bins) (Hauling)  |                                     | 75           | 2,500.00           | -                    | 187,500.00                           |  |
| Hazardous Waste Generation  |                                     |              |                    |                      |                                      |  |
| (Temporary HW Generator ID)   |                                     | 1            | 10,000.00          | -                    | 10,000.00                            |  |
| Treatment of Concrete Wash Water  |                                     |              |                    |                      |                                      |  |
| (Provision of washout containers)   | -                                   | 75           | 1,000.00           | -                    | 75,000.00                            |  |
| Drainage Management   | -                                   | -            | 5,000.00           | 17                   | 85,000.00                            |  |
| Provision of Portalets  | 1 Portalet/25 workers               | 3            | 10,000.00          | 17                   | 510,000.00                           |  |
| Traffic Management  |                                     | _            |                    |                      |                                      |  |
| (Signal Man)  | Personnel/day                       | 2            | 650                | 17                   | 530,400.00                           |  |
| Occupational Health and Safety  |                                     |              |                    |                      |                                      |  |
| Personal Protective Equipment   |                                     |              |                    |                      | 5 . 64 . 6                           |  |
| Safety Signages   |                                     |              |                    |                      | Part of the Structural Cost Estimate |  |
| Scaffolding/Temporary Access for workers  |                                     |              |                    |                      |                                      |  |
| EHS Officer   | Personnel                           | 1            | 29,075.00          | 17                   | 494,275.00                           |  |
| Social Officer  | Personnel                           | 1            | 29,075.00          | 17                   | 494,275.00                           |  |
| Student and Facilities Relocation Plan  | Personnel                           | 1            | 29,075.00          | 17                   | 494,275.00                           |  |
| A. General Activities   | Whole School                        | 1            | -                  | 17                   | 829,500.00                           |  |
| B. Building Specific (Student Learning  |                                     |              |                    |                      | ,                                    |  |
| Continuity)   |                                     |              |                    |                      |                                      |  |
| a. DepEd Building   |                                     |              |                    |                      |                                      |  |
| b. VPE Building   |                                     |              |                    |                      |                                      |  |
| Stakeholder Engagement Plan (SEP)   |                                     |              |                    |                      |                                      |  |

ANGEL LAZARO & ASSOCIATES, INTERNATIONAL 53

| COMPONENT/S   | UNIT OF WORK MEASUREMENT | UNIT/LOT | UNIT COST<br>(PHP) | DURATION<br>(MONTHS) | TOTAL COST (PHP) |
|---|--------------------------|----------|--------------------|----------------------|------------------|
| Project Level SEP Meetings  | Per session              | -        | 5,000.00           | 17                   | 85,000.00        |
| <ul> <li>Community Level SEP Meetings<br/>(prior project mobilization)</li> </ul> | Per session              | 1        | 5,000.00           | -                    | 5,000.00         |
| <ul> <li>Other expenses (Brochure, IEC Materials)</li> </ul>                      | -                        | -        | 5,000.00           | -                    | 5,000.00         |
| GBV-SHA and SH Plan (Trainings)   | Per session              | 4        | 5,000.00           | -                    | 20,000.00        |
| Grievance Redress Mechanism (Meetings)  | -                        | -        | 5,000.00           | 17                   | 85,000.00        |
|   |                          |          |                    | SUB-TOTAL            | 17,585,283.33    |
|   | 1,758,283.33             |          |                    |                      |                  |
|   |                          |          |                    | TOTAL                | 19,343,811.66    |

ANGEL LAZARO & ASSOCIATES, INTERNATIONAL

DATE: <u>08 March 2024</u>

| PART 1: BASIC I           | PROJECT I           | NFORMATION          |                                 |            |                  |   |  |
|---------------------------|---------------------|---------------------|---------------------------------|------------|------------------|---|--|
| 1.A. Name of Bu           | ilding:             | 1.C. School Id      | entification Number             | er:        |                  |   |  |
| DepEd Building            | -                   | 305420              |                                 |            |                  |   |  |
| 1.B. Name of Sc           | hool:               |                     |                                 |            |                  |   |  |
| Sta Lucia High S          |                     |                     |                                 |            |                  |   |  |
|                           | 1                   |                     |                                 |            |                  |   |  |
| 2. Project                | Complete            |                     |                                 |            | Zone/Class       | sification:                               |  |
| Location/                 |                     | io/Barangay:        | llaga Dygy Cta Luc              | da.        | (R1, R2, R3, C   | 1 C2 C3)                                  |  |
| Coordinates               | #30 Iram            | o St., Rosario VII  | llage, Brgy. Sta. Luc           | ia,        | R1 - Low Inten   | sity Residential                          |  |
|                           | City/Muni           | cinality:           |                                 |            |                  | ntensity Residential<br>nsity Residential |  |
|                           | Pasig City          | •                   |                                 |            | C1 - Low Inten   | sity Commercial                           |  |
|                           | Coordinat           |                     |                                 |            |                  | ntensity Commercial<br>nsity Commercial   |  |
|                           | 121.1031            | 8, 14.58276         |                                 |            | I - Institution  |   |  |
| 3. Contact                | Name of o           | coordinator/foca    | l person:                       |            | Designation:     |   |  |
| Person at                 | Gregorio            | Fiel Pineda         |                                 |            |                  | VI/ Assistant to                          |  |
| School                    |                     |                     |                                 |            | the Principal    |   |  |
|                           | Landline I 656-99-5 |                     |                                 |            | Fax No:          |   |  |
|                           |                     |                     | y available mobile p            | latform    | Email Address:   |   |  |
|                           | Mobile INC          | o./ viber No./ arry | y avaliable mobile p            | iatioiii.  | slhs98@gmail.    |   |  |
|                           |                     |                     |                                 |            | 3m350@gman.      | 50111                                     |  |
| 4. Building               | Seismic V           | /ulnerability Ratir | ng (SVR):                       | Total Esti | mated Floor Area | <br>9:                                    |  |
| Condition                 |                     | •                   |                                 | 1,575 sq.  |                  |   |  |
|                           | No. of floo         | ors:                |                                 |            | nstructed:       |   |  |
|                           | 6 Floors            |                     |                                 | 2012 or 2  |                  |   |  |
|                           |                     |                     |                                 |            | the structure:   |   |  |
| F Dotrofitting            | ПV                  |                     |                                 | 12 or 11   | years            |   |  |
| 5.Retrofitting Conducted? | □Yes<br>⊠No         |                     |                                 |            |                  |   |  |
| Conducted:                | <b>△INO</b>         |                     |                                 |            |                  |   |  |
|                           | If Yes. Wh          | en and proof of     | Structural Retrofitti           | na:        |                  |   |  |
|                           |                     |                     |                                 |            |                  |   |  |
| 6. Visible                | Description         | on:                 |                                 |            |                  |   |  |
| structural                | ⊠ Slab: <u>H</u>    | lairline Cracks     |                                 |            |                  |   |  |
| Cracks?                   | ☐ Beams             | :                   |                                 |            |                  |   |  |
|                           | □ Columi            | าร:                 |                                 |            |                  |   |  |
|                           | ☐ Founda            | ation:              |                                 |            |                  |   |  |
|                           | ☐ Ground            | d floor slab:       |                                 |            |                  |   |  |
|                           | ☐ Walls: _          |                     |                                 |            |                  |   |  |
|                           |                     |                     |                                 |            |                  |   |  |
| 7.A. Demograph            |                     |                     |                                 |            | 1 +              |   |  |
| Total number of           | _                   | irls:               | Age Range:                      | ء ماط      |                  | no. of class                              |  |
| Learners (in the school): |                     | 676<br>oys:         | 12 to 18 years<br>Grade Levels: |            | shifts           | :<br>1 (Time):                            |  |
| 7,688                     |                     | 012                 | JHS (Grades                     |            |                  | AM - 12:50 PM                             |  |
| .,                        | ",                  | - · -               | SHS (Grades                     | ,          |                  | 2 (Time):                                 |  |
|                           |                     |                     | - (2:3:3:00                     | ,          |                  | PM – 7:30 PM                              |  |
|                           |                     |                     |                                 |            | Shift :          | 3 (Time):                                 |  |
|                           |                     |                     |                                 |            |                  |   |  |
| Total number en           |                     | irls:               | Age Range:                      |            |                  | no. of class                              |  |
| in Learners with          | 1                   |                     |                                 |            | shifts           |   |  |

| Special Educational<br>Needs (LSEN)                                   | N.           | oys:<br>A  | Grade Levels:<br>NA                     |             | NA              |  |
|---|--------------|--|---|-------------|-----------------|--|
| Total Number of Teachers and School Personnel: 259 Women: 168 Men: 91 |              | Total Number of persons with disabilities: Teachers/School Personnel: NA Women: Men: |   |             |                 |  |
|   |              |  | Learners: 3<br>Girls: 2<br>Boys: 1      |             |                 |  |
| 7.B. Occupants of the   |              | ble Building   |   |             |                 |  |
| Number of class shifts: 2  Total number of Girls: 200                 |              | Age Range: 15 to 17  | years old                               |             |                 |  |
| Learners (Shift 1): 350   | Boys         | s: 150   | Grade Levels: Grade                     | e 10        |                 |  |
| Total number of Learners (Shift 2):                                   | Girls        | : 200  | Age Range: 14 to 16                     | years old   |                 |  |
| 350   | Boys: 150    |  | Grade Levels: Grade                     | e 9         |                 |  |
| Total number of Girls: Learners (Shift 3):                            |              | Age Range:   |   |             |                 |  |
| NA Boys:  |              | Grade Levels:  |   |             |                 |  |
| Total number<br>enrolled in   | Girls        | :  | Age Range: Total no. of class shifts: 0 |             |                 |  |
| Learners with<br>Special Educational<br>Needs (LSEN)                  | Boys<br>None |  | Grade Levels:                           |             |                 |  |
| Total Number of Teac  |              | and School   | Total Number of pe                      |             |                 |  |
| Personnel: 30 Teache  | rs           |  | Teachers/School Personnel: None         |             |                 |  |
| Women: 24   |              |  | Women: Men:                             |             |                 |  |
| Men: 6  |              |  | Well.                                   |             |                 |  |
|   |              |  | Learners:                               |             |                 |  |
|   |              |  | Girls:                                  |             |                 |  |
| PART 2: RETROFITTI  | NG (P        | HIII DING SDECIEIC   | Boys:                                   |             |                 |  |
| 8. Type of retrofitting   | •            | □Steel Plate Bondi   |   |             |                 |  |
|   |              | ⊠Concrete Jacketii   | S .                                     |             |                 |  |
|   |              | □Steel Jacketing   |   |             |                 |  |
|   |              | ⊠ Fiber Reinforced   | Polymer (FRP) Systems                   |             |                 |  |
| ☐Steel Bracing Sys  |              |  |   |             |                 |  |
| 9. Type of rooms dire   | -            | Offices:   |   | Remarks (Qu | antity)         |  |
| affected by retrofitting  | ıg           | ☐ Principal  |   |             |                 |  |
|   |              | <ul><li>☑ I fillopal</li><li>☑ Administration</li></ul>                              |   | TLE Departm | ent Head Office |  |
|   |              | ☐ Guidance   |   |             |                 |  |
|   |              |  | 1 room                                  |             |                 |  |
|   |              |  |   | 1 room      |                 |  |
|   |              | Rooms:   |   |             |                 |  |
|   |              | ☐ Classrooms   |   |             |                 |  |

|   | ☐ Science Laboratory   |  |
|---|--|--|
|   | ☐ Speech Laboratory  |  |
|   | □ Computer Laboratory  |  |
|   | □ Conference   | 2 functional computer labs             |
|   |  |  |
|   | = maddina, Workeriop   | 12 elective rooms w/ equipment         |
|   | Others:  |  |
|   | ☐ Canteen  |  |
|   | □ Feeding Center   |  |
|   | ☐ Clinic   | 1 room; Ground floor                   |
|   |  |  |
|   | Library  |  |
|   | ☐ Storage rooms  |  |
|   | ☐ Lodging  |  |
|   | ☐ Pantry   |  |
|   |  |  |
|   |  |  |
| 10. Existing facilities to  | WASH Facilities  | Remarks (Quantity)                     |
| be affected by  |  | 6 cubicles; located at ground floor    |
| retrofitting  | ☐ Urinal   |  |
|   |  | 1 outdoor handwashing facility         |
|   | ☐ Water tank   |  |
|   |  |  |
|   | ⊠ Septic Tank  |  |
|   |  |  |
|   | Other structural elements/facilities:  |  |
|   | ☐ PWD Ramps  |  |
|   |  | Interconnected with VPE Building       |
|   | <ul><li>☑ Fire-safety (Fire extinguisher</li></ul>   | 1 Set of Fire extinguisher and fire    |
|   |  | cabinet w/ hose per floor; 1 fire exit |
|   | • (  | out in the per most, i me orm          |
|   | cabinet, sprinklers, fire exits)   |  |
|   | cabinet, sprinklers, fire exits)  ⊠ Drainage system  |  |
|   | cabinet, sprinklers, fire exits)  ⊠ Drainage system  ⊠ Ceilings, wall partition  |  |
|   | cabinet, sprinklers, fire exits)  ⊠ Drainage system  ⊠ Ceilings, wall partition  ⊠ Windows   |  |
|   | cabinet, sprinklers, fire exits)  ⊠ Drainage system  ⊠ Ceilings, wall partition  |  |
|   | cabinet, sprinklers, fire exits)  ⊠ Drainage system  ⊠ Ceilings, wall partition  ⊠ Windows   |  |
|   | cabinet, sprinklers, fire exits)  ⊠ Drainage system  ⊠ Ceilings, wall partition  ⊠ Windows  ⊠ Stairs   |  |
| 11. Other Comments/Obse   | cabinet, sprinklers, fire exits)  ⊠ Drainage system  ⊠ Ceilings, wall partition  ⊠ Windows  ⊠ Stairs   |  |
| 11. Other Comments/Obse   | cabinet, sprinklers, fire exits)  ☑ Drainage system ☑ Ceilings, wall partition ☑ Windows ☑ Stairs ☑ Electrical power supply                          |  |
|   | cabinet, sprinklers, fire exits)  ☑ Drainage system ☑ Ceilings, wall partition ☑ Windows ☑ Stairs ☑ Electrical power supply                          |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply                                    |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |
| Ongoing electrical was a second or control or cont | cabinet, sprinklers, fire exits)  Drainage system Ceilings, wall partition Windows Stairs Electrical power supply  ervations during the field visit: |  |

| PART 3: DESCRIPTION OF PROJECT SITE AND SUR  |        |  |
|--|--------|--|
| QUESTION   | YES/NO | REMARKS DURING FIELD VALIDATION/ DESCRIBE PHYSICAL APPEARANCE  |
| 12. Project Description  |        | FITSICAL AFFEARANCE  |
| 12.1 Is there a proposed/ ongoing project for the rehabilitation/ reconstruction of school buildings?  | NO     | <ul> <li>□ Repair</li> <li>□ Rehabilitation</li> <li>□ Retrofit</li> <li>□ Demolition</li> <li>□ Total reconstruction</li> </ul> |
| 12.2. Is the school facility fenced?  -If yes, describe the distance of the building from the  | YES    | The distance between the building (right side) and the nearest fence is 0.35 meters  |
| fence.  12.3. Are there any Entry/ Exit Points in the school?  | YES    | Indicate number: 1 The gate has a span of 9 meters.  |
| 12.4. Are there asbestos roofing and other asbestos materials to be removed from the site?   | NO     | The gate has a span of 5 meters.   |
| 13.1. Is the project located next to a residential house?  | YES    | The school building is adjacent to a residential house.  |
| -Indicate if the houses are adjacent or if nearby only   |        |  |
| 13.2. Are there any hospitals and health clinics with lying-in services near the school building?  | YES    | Brgy Sta. Lucia Health Center is ~260 meters NW of the school building   |
| 13.3. Are there any culturally/historically important buildings or areas near the school?  | NO     |  |
| 13.4. Are there any other institutions, public offices/ public places (wet market, parks, etc.) near the school?   | NO     |  |
| 13.5. Are there any religious places (churches, mosques, etc.) near the school?  | YES    | St. Jude Thaddeus Parish is ~100 meters south of the school.   |
| 13.6. Is the project site close to a commercial area?  | NO     |  |
| 13.7. Is there an economic enterprise/s (i.e., canteen) within or outside the project compound that may be affected during construction?                           | NO     | The school canteen is located at VPE Building.   |
| 14. Land 14.1. Are there trees to be removed/affected by the construction?   | YES    | The trees/saplings behind the building may be affected by the activity.  |
| 14.2. Are there available local solid waste management services provided to the school? (i.e., Material Recovery Facilities, Color Coded Trash Bins)               | YES    | A functional MRF, color coded trash bins;<br>waste are daily collected by the<br>City/Barangay LGU                               |
| 14.3. Are there available hazardous waste transport and treatment services in the locality? (batteries, busted lamps, used oils, welding rods, paint buckets etc.) | YES    | The building supervisor reports these items.   |
| 15. Water  |        | T. I. O. I. (2000)   |
| 15.1. Have you experienced flooding in the past years?   | YES    | Typhoon Ondoy (2009);<br>The flood is at above the ankle level which<br>lasted for 1 to 2 days.                                  |
| -If yes, how frequent in a year? -Describe extent of flooding (height) -Indicate duration of flooding due to typhoon or  |        |  |
| heavy rain   |        |  |

| 15.2. Is the project located next to a waterway, i.e. canal, creek, river? | NO   | Marikina River is ~790 meters west of the project site.                      |
|--|------|--|
| 15.3. Is there a drainage system at the area?                              | YES  | A drainage system inside the school drains                                   |
| (indicate if the drainage system is within/outside the                     | ILO  | towards the city drain along Tramo Street.                                   |
| `  |      | , ,  |
| school area)   |      |  |
| - If yes, indicate drainage system condition (working,                     |      |  |
| clogged, not working, etc.)  |      |  |
| 16. Air  |      |  |
| 16.1. Is there a back-up generator set in the school?                      | NO   |  |
| 16.2. Is there a presence of backyard burning in the                       | NO   |  |
| area?  |      |  |
| 17. People   |      |  |
| 17.1. Is the school building being used as an                              | NO   |  |
| evacuation center?   |      |  |
| 18. Construction   |      |  |
| 18.1. Is the school allowing overnight stay/work for                       | YES  |  |
| the workers?   |      |  |
| 18.2. Is there enough open area within the school                          | YES  | Possible location for storage is the school                                  |
| compound for storage of construction materials (i.e.,                      | . 20 | grounds in front of the building.  |
| steel, wire mesh, cements, and other equipment) and                        |      |  |
| for parking of construction vehicles?                                      |      |  |
| 18.3. Is the road going to the site wide enough to                         | YES  | The road in front of the school gate (Tramo                                  |
| accommodate construction vehicles?   | TES  | Street) is ~5 meters.  |
| accommodate construction vehicles?   |      |  |
| Indicate the wielth of the road  |      |  |
| -Indicate the width of the road.   | \/=0 | In front of VDE Duilding   |
| 18.4. Is there an available space for the construction                     | YES  | In front of VPE Building.  |
| debris and other waste?  |      |  |
| 18.5. Is there an available space for the barracks for                     | YES  | The location of possible area for the  |
| workers staying overnight?   |      | barracks is near the RTR Building, as suggested by the school representative |
|  |      |  |
| -Indicate the location of the possible area for the                        |      |  |
| barracks   |      |  |
| 18.6. Is there an available space for stay out workers                     | YES  | Workers are allowed in the canteen but not                                   |
| to rest/ eat? (all of these are temporary, look for big                    |      | during the recess time of the students.                                      |
| spaces at school premises)   |      |  |
| 18.7. Are there available toilet facilities for the                        | YES  | Workers are allowed to use the male  |
| workers?   |      | student CRs.   |
|  |      |  |
| -Indicate the condition and number of toilet facilities                    |      |  |
| 18.8. Does the construction work for this project                          | YES  | All students (since most of the elective                                     |
| trigger relocation of students and school staff?                           |      | subjects are taken in DepEd Building).                                       |
|  |      | All teachers from the TLE Department.  |
| -If this is the case, how many students and school                         |      | 7 th teachers from the TEE Department.                                       |
| staff will be relocated as of (date).                                      |      |  |
| 18.9. In case of potential relocation of students, is                      | YES  | Blended and asynchronous learning are  |
| there enough space within the school compound to                           |      | being proposed.  |
| relocate students?   |      |  |
|  |      |  |
| -Describe in remarks the type of space available e.g.,                     |      |  |
| *                                    |      |  |
| DITUDOL SUACE TOL TEMPOLARY CIASSLOOMS OF EXISTING                         |      |  |
| outdoor space for temporary classrooms or existing                         |      | Ì  |
| facility   |      |  |
| facility   |      |  |
|  |      |  |

| HAZARD                            | INDICATE LEVEL OF EXPOSURE    |                            |                          | REMARKS  |
|-----------------------------------|-------------------------------|----------------------------|--------------------------|--|
|                                   | High                          | Medium                     | Low                      |  |
| A. SEISMIC HAZARDS                |                               |                            |                          |  |
| A.1. Ground Rupture               | Prone                         | -                          | Safe<br>/                | Safe; Approximately 3.3 km east of the Valley Fault System: West Valley Fault    |
| A.2. Ground Shaking               | Intensity<br>Scale VII-X      | Intensity<br>Scale IV-VI   | Intensity<br>Scale I-III | Prone; Intensity VIII  |
| A.3. Liquefaction                 | High<br>Susceptibility        | Moderate<br>Susceptibility | Low<br>Susceptibility    | Moderate Potential   |
| A.4. Earthquake-Induced Landslide | High<br>Susceptibility        | Moderate<br>Susceptibility | Low<br>Susceptibility    | Safe   |
| A.5. Tsunami                      | Prone                         | -                          | Safe<br>/                | Safe   |
| B. VOLCANIC HAZARDS               |                               |                            |                          |  |
| B.1. Nearest Active Volcano       | Within danger zone            | -                          | Outside<br>danger zone   | Approximately 64.3 km north of Taal  |
| B.2. Ashfall                      | Prone /                       | -                          | Safe                     | Prone  |
| C. HYDRO-METEOROLOGICAL           |                               |                            |                          |  |
| C.1. Flood                        | High to Very<br>High/Critical | Moderate<br>Susceptibility | Low<br>Susceptibility    | High Susceptibility; 1 to 2 meters flood height and/or more than 3 days flooding |
| C.2. Storm Surge                  | Prone                         | -                          | Safe<br>/                | Safe   |

# D. Nearest Critical Facilities (from HazardHunterPH) (i.e., institutions, health facilities, road network)

| Facility Name  | Туре                       | Distance from the Project |
|--|----------------------------|---------------------------|
| De Castro ES   | Public Elementary School   | 667 m                     |
| Sta. Lucia HS  | Public Secondary School    | 606 m                     |
| Santa Lucia Health Center  | Government Health Facility | 308 m                     |
| Medical Mission Group Metro Manila<br>East Hospital & Health Services<br>Cooperative | Private Health Facility    | 982 m                     |
| Manila East Rd (Rosario-Cainta Rd); Pasig City (Ione District)                       | Primary Road Network       | 645 m                     |
| Manila East Rd; Rizal (first District)   | Secondary Road Network     | 1.2 km                    |

| Marina Edot Ra, Mear (mot Biotriot)                | Coochaary 1100  | ad HotWork  | '   | 12 1011  |
|--|---|---|---|--|
| PART 5: ENVIRONMENTAL AND SO                       | OCIAL IMPA  | CTS   |   |  |
| IMPACTS  | High  | Medium  | Low   | REMARKS  |
| A. ENVIRONMENTAL IMPACTS                           |   |   |   |  |
| 1.Land   |   |   |   |  |
| 1.1. Waste Generation during                       |   |   |   |  |
| Retrofitting                                       |   |   |   |  |
| 1.1.1. Domestic sewage from workers                | No available<br>sanitation<br>facilities for<br>workers                   | Use of dedicated sanitation facilities within the school premises | Use of sanitation facilities for workers within the building            | The school will allow workers to use the male toilets.   |
| 1.1.2. Solid wastes and construction debris/spoils | No<br>space/area<br>available<br>adjacent to<br>the school<br>building    | Area<br>available<br>within the<br>school<br>premises             | Area<br>available<br>within the<br>school<br>building                   | The space in front of the VPE Building may be used to store solid waste and construction debris. |
| 1.1.3. Hazardous waste and asbestos materials      | Will require<br>removal of<br>asbestos and<br>other<br>hazardous<br>waste | Will require<br>removal of<br>other<br>hazardous<br>waste         | Will not<br>require<br>removal of<br>asbestos nor<br>hazardous<br>waste | The retrofitting works will involve removal of light bulbs.                                      |

| 1.2 Coil Francisco francisco de de   | No  | Area  | Area  | The area in front of the VPE Building   |
|--|---|---|---|---|
| 1.2. Soil Erosion from excavated materials   | space/area<br>available<br>adjacent to<br>the school<br>building                                | available<br>within the<br>school<br>premises   | available<br>within the<br>school<br>building   | may be used as a location of storage of excavated materials.  |
| 1.3. Cutting of Trees  | Will involve cutting of trees   | Will involve<br>tree trimming<br>only   | Will not involve cutting of trees   | The Kapok Tree is 8 meters away from the building. Tree trimming may be required during retrofitting works. |
|  | /   |   |   | Tree saplings behind the building may also be affected.   |
| 2. Water   | 1   | l .   | <u>I</u>  | also be anotica.  |
| 2.1. Change in drainage flow   | Permanent<br>diversion of<br>drainage flow  | Temporary<br>diversion of<br>drainage flow  | Will not<br>require<br>diversion of<br>drainage flow  | Drainage will follow the existing drainage system of the school.  |
| 2.2. Inducement of flooding  | Will involve earthworks   | -   | Will not involve earthworks   |   |
| 2.3. Clogging of canals (existing drainage system)   | Will involve earthworks   | -   | Will not involve earthworks   |   |
| 2.4. Sedimentation of creeks, rivers   | Direct<br>discharge to<br>nearby<br>creeks/rivers   | Direct<br>discharge to<br>city drainage<br>system   | No<br>creeks/rivers<br>adjacent   |   |
| 3. Air Quality/ Noise/ Vibration   |   | /   |   |   |
| 3.1. Air Pollution from retrofitting activities and equipment (i.e., Noise from equipment, tools, and workers) | Construction activities will involve use air pollution sources (i.e., gensets, heavy equipment) | -   | Construction activities will not involve use air pollution sources (i.e., gensets, heavy equipment) | The retrofitting works will involve the usage of heavy equipment and tools.                                 |
| 3.2. Dust from retrofitting activities   | Construction<br>site is directly<br>adjacent to<br>the sensitive<br>receptor                    | Construction<br>site is within<br>30 meters <sup>1</sup><br>from the<br>sensitive<br>receptor | Construction<br>site is more<br>than 30<br>meters from<br>the sensitive<br>receptor                 | DepEd Building is adjacent to the residential area (west portion).  |
| 3.3. Ground Vibration  | Construction activities will involve groundworks.   | -   | Construction<br>activities will<br>not involve<br>groundworks                                       | Excavation (for tie beams) will be conducted.   |
| B. SOCIAL IMPACTS  | /   | <u> </u>  | <u> </u>  |   |
| 4. Relocation  |   |   |   |   |
| 4.1. Relocation of students due to class disruption  | > 50% of<br>building<br>occupants<br>(students)   | >10% but<br><50% of the<br>building<br>occupants<br>(students)                                | <10% of the<br>building<br>occupants<br>(students)  | All learners will be impacted because they all access the rooms during their elective course.               |
|  | 1   |   |   |   |
| 4.2. Relocation of affected small businesses (i.e., Canteen) within the project compound                       | > 50% of<br>small<br>businesses   | >10% but<br><50% of<br>small<br>businesses  | <10% of<br>small<br>businesses  | No businesses will be impacted during the activity.   |
| . , ,  |   |   | 1   |   |

 $<sup>^{\</sup>rm 1}\,{\rm Source}\colon{\rm National\ Pollution\ Control\ Commission\ (NPCC)}$ 

| PHILIPPINE SEISMIC RISK REDUCT  | > 50% of   | >10% but  | <10% of  |  |
|---|--|---|--|--|
| 4.3. Relocation of school staff   | school staff   | <50% of school staff  | school staff   | Around 12% or 30 teachers (TLE Department) out of 259 school teachers/personnel will be impacted                                 |
|   |  | /   |  | by the project.  |
| 5. Site Security  |  |   |  |  |
| 5.1. Presence of workers posing risks to peace and order  | Allow stay in<br>workers<br>without the<br>presence of<br>school<br>security         | Allow stay in<br>workers with<br>the presence<br>of school<br>security                      | Workers will have construction camp outside the school premises and with the presence of school security | The school previously permitted the establishment of construction camps on the school grounds.                                   |
| 5.2. Access to site   | Only one entry/exit point within the school building without school security         | Only one<br>entry/exit<br>point within<br>the school<br>building with<br>school<br>security | School<br>building with<br>multiple<br>entry/exit<br>points  | DepEd Building has only one entry/exit point; security personnel are frequently stationed at the main gate of the school campus. |
| C Acces to Htilities  |  | /   |  |  |
| 6.1. Project will result to temporary disruption of water supply  | Water<br>disruption for<br>the whole<br>construction<br>duration                     | Water<br>disruption for<br>more than 1<br>month   | Water<br>disruption for<br>less than one<br>month  |  |
| 6.2. Project will result to temporary disruption of electricity   | Electricity<br>disruption for<br>the whole<br>construction<br>duration               | Electricity<br>disruption for<br>more than 1<br>month                                       | Electricity<br>disruption for<br>less than one<br>month  |  |
| 6.3. Impact on existing sanitation and sewerage facilities  | > 50% of<br>existing<br>sanitation<br>and<br>sewerage<br>facilities                  | >10% but<br><50% of<br>existing<br>sanitation<br>and<br>sewerage<br>facilities              | <10% of<br>existing<br>sanitation<br>and<br>sewerage<br>facilities                                       | The project will only impact the sewerage facilities of the building itself.   |
| 7. Labor and Working Conditions/  | Community  | Health and  | Safety/ GB\  | / and SHA  |
| 7.1. Impact on Community Health and Safety  | Construction site is directly adjacent to the nearby community                       | Construction<br>site is within<br>30 meters <sup>2</sup><br>from the<br>nearby<br>community | Construction<br>site is more<br>than 30<br>meters from<br>the nearby<br>community                        | DepEd Building is adjacent to the residential area (west portion).   |
| 7.2. Effect on Gender Based<br>Violence (GBV) and Sexual<br>Harassment and Sexual<br>Exploitation and Abuse | Allow stay in<br>workers<br>without the<br>presence of<br>school<br>security         | Allow stay in<br>workers with<br>the presence<br>of school<br>security                      | Workers will have construction camp outside the school premises and with the presence of school security |  |
| 7.3. Effect on workers for occupational health and safety   | Construction activities will involve use of heavy equipment and hazardous chemicals. | Construction activities will involve use of heavy equipment or hazardous chemicals.         | Construction activities will not involve use of heavy equipment nor hazardous chemicals                  |  |

<sup>&</sup>lt;sup>2</sup> Source: National Pollution Control Commission (NPCC)

| 7.4. Spread of Communicable Diseases, (i.e. COVID-19, HIV-AIDS, TB, etc.) | Allow stay in<br>workers<br>without the<br>presence of<br>school<br>security | Allow stay in<br>workers with<br>the presence<br>of school<br>security | Workers will have construction camp outside the school premises and with the presence of school security |                                |
|---|--|--|--|--------------------------------|
| 8. Traffic  |  |  |  |                                |
| 8.1. Traffic Congestion/ blocked roadways during delivery of              | One-lane<br>Road   | Two-lane<br>Road   | Four-lane<br>Road  | Two-way road with ~5.9 m width |
| construction materials  |  | /  |  |                                |
| 8.2. Available open space for traffic/parking                             | No<br>space/area<br>available<br>adjacent to<br>the school<br>building       | Area<br>available<br>within the<br>school<br>premises                  | Area<br>available<br>adjacent to<br>the school<br>building   |                                |
| 8.3. Effect to Pedestrian and traffic safety                              | One-lane<br>Road   | Two-lane<br>Road   | Four-lane<br>Road  |                                |

# 9. List of Observed/Identified Sensitive Receptors/Stakeholders (during site visit)

| General Direction | Sensitive Receptor | Name of Facility                                   | Distance from the<br>Project     |  |
|-------------------|--------------------|--|----------------------------------|--|
| North             | School building    | Senior High School<br>Building                     |                                  |  |
| East              | School grounds     |  |                                  |  |
| West              | Christian Church   | Philippine Evangelical<br>Friends Christian Church | 85 m<br>Northwest of the project |  |
| South             | Church             | St. Jude Thaddeus<br>Parish – Pasig                | 160 m south of the project       |  |

(Church, HOA, Health Facility, Cultural Heritage)

| PINE SEISMIC RISK REDUCTION AND RESILIENCE PROJECT (PSRRRP) on the above screening, the applicable safeguard measures to be developed for the subproject   |
|--|
| <ul> <li>☑ Environmental Code of Practice (ECOP) – applicable to activities generating low (minimal) impacts</li> <li>☑ ECOP 1: Temporary Relocation of School Classrooms and other Building Utilities</li> <li>☑ ECOP 2: General Construction Site Management</li> <li>☑ ECOP 3: Workers' Health and Safety</li> <li>☑ ECOP 4: Community Health and Safety</li> </ul>   |
| <ul> <li>☑ Ecop 5: Cultural Properties</li> <li>☑ Environmental and Social Management Plan (ESMP) – applicable to activities generating medium (manageable) to high (major) impacts</li> <li>☑ Grievance Redress Mechanism</li> <li>☑ Stakeholder Engagement Plan (SEP)</li> <li>☑ Waste Management Plan</li> <li>☑ Construction Safety and Health Program (CSHP) Checklist</li> <li>☑ Gender-Based Violence Action Plan</li> <li>☑ Consultant-Contractor's Contract</li> <li>☑ Student Relocation Plan</li> <li>☑ Labor Management Plan (LMP)</li> <li>☑ Chance Find Procedure</li> </ul> |

Note that the applicable safeguards measures are to be included in the bid and contract documents of the

Project Implementation Unit

JOHEPH (BERWARD)

(Signature over Printed Name)

(Signature over Printed Name)

Attested by:

(DepEd Representative/s)

CHISPLAND DIAGE

MARC SHRUTTING OP (Signature over Printed Name)

(Signature over Printed Name),

contractor.

Prepared by:

JETYOME GEANIO

(Signature over Printed Name)

Consultant

Recommendations for Safety and Functional Improvement:

DATE: <u>08 March 2024</u>

| PART 1: BASIC                          | PROJECT I   | NFORMATION                                |                       |                         |   |      |  |
|--|---|---|-----------------------|-------------------------|---|------|--|
| 1.A. Name of Building:<br>VPE Building |   | 1.C. School Identification Number: 305420 |                       |                         |   |      |  |
| 1.B. Name of Sc                        | hool:   |   |                       |                         |   |      |  |
| Sta Lucia High S                       | chool   |   |                       |                         |   |      |  |
| 2. Project                             | Complete  | address:                                  |                       |                         | Zone/Classification:  |      |  |
| Location/                              |   | io/Barangay:                              |                       |                         |   |      |  |
| Coordinates                            | #30 Tramo St., Rosario Village, Brgy. Sta. Lucia, |   |                       | cia,                    | (R1, R2, R3, C1, C2, C3) R1 - Low Intensity Residential R2 - Medium Intensity Residential |      |  |
|  | City/Municipality:                                |   |                       |                         | R3 - High Intensity Residential<br>C1 - Low Intensity Commercia                           |      |  |
|  | Pasig City  |   |                       |                         | C2 - Medium Intensity Commercial  |      |  |
|  |   | Coordinates: 121.10318, 14.58276          |                       |                         | C3 - High Intensity Commercia   | al   |  |
| 3. Contact                             |   | coordinator/focal                         | nerson:               |                         | Designation:  |      |  |
| Person at                              |   | Fiel Pineda                               | person.               |                         | Head Teacher VI/ Assistan   | t to |  |
| School                                 | Grogorio  | i ioi i iiiodd                            |                       |                         | the Principal   | . 10 |  |
| 3011331                                | Landline I  | No:                                       |                       |                         | Fax No:   |      |  |
|  | 656-99-5  |   |                       |                         |   |      |  |
|  | Mobile No   | o./ Viber No./ any                        | available mobile p    | latform:                | Email Address:  |      |  |
|  |   | •   | •                     |                         | slhs98@gmail.com  |      |  |
|  |   |   |                       |                         |   |      |  |
| 4. Building                            | Seismic V   | ulnerability Ratir                        | ng (SVR):             | Total Esti              | mated Floor Area:   |      |  |
| Condition                              | (c/o: DPW   | ,   |                       | 3,120 sq.               |   |      |  |
|  | No. of floors:                                    |   |                       | Year Constructed:       |   |      |  |
|  | 6 Floors  |   |                       | 2007                    |   |      |  |
|  | <u>'</u>  |   |                       | Years of the structure: |   |      |  |
| F. Datus fitting                       |   |   |                       | 17                      |   |      |  |
| 5.Retrofitting Conducted?              | □Yes  |   |                       |                         |   |      |  |
| Conducted?                             | ⊠No   |   |                       |                         |   |      |  |
|  | If Yes, Wh  | en and proof of                           | Structural Retrofitti | ng:                     |   |      |  |
| 6. Visible                             | Description:                                      |   |                       |                         |   |      |  |
| structural                             | ⊠ Slab: <u>H</u>                                  | lairline Cracks                           |                       |                         |   |      |  |
| Cracks?                                | Beams   | : Corrosion Crac                          | :ks                   |                         |   |      |  |
|  | □ Columns:  |   |                       |                         |   |      |  |
|  | □ Foundation:                                     |   |                       |                         |   |      |  |
|  |   | ☐ Ground floor slab:                      |                       |                         |   |      |  |
|  | □ Walls:  |   |                       |                         |   |      |  |
|  |   |   |                       |                         | <del></del>   |      |  |
| 7.A. Demograph                         | nics of the                                       | concerned Publ                            | ic School             |                         |   |      |  |
| Total number of                        |   | irls:                                     | Age Range:            |                         | Total no. of class  |      |  |
| Learners (in the                       | whole 3,  | 676                                       | 12 to 18 years        | sold                    | shifts:   |      |  |
| school):                               |   | Boys: Grade Level                         |                       |                         | Shift 1 (Time):   |      |  |
| 7,688                                  |   | JHS (Grades                               |                       | ,                       | 6:00 AM - 12:50 I   | PM   |  |
|  |   |   | SHS (Grades           | 11-12)                  | Shift 2 (Time):   |      |  |
|  |   |   |                       |                         | 1:00 PM – 7:30 P  | M    |  |
|  |   |   |                       |                         | Shift 3 (Time):   |      |  |
| <del>-</del>                           | .,  | • 1                                       |                       |                         | <b>T</b>  |      |  |
| Total number en                        |   | irls:                                     | Age Range:            |                         | Total no. of class  |      |  |
| in Learners with                       |   |   |                       |                         | shifts:   |      |  |

PHILIPPINE SEISMIC RISK REDUCTION AND RESILIENCE PROJECT (PSRRRP) Special Educational Boys: Grade Levels: Needs (LSEN) NA NA NA **Total Number of Teachers and School Total Number of persons with disabilities:** Teachers/School Personnel: NA Personnel: 259 Women: 168 Women: Men: Men: 91 Learners: 3 Girls: 2 Boys: 1 7.B. Occupants of the Eligible Building Number of class shifts: 2 **Total number of** Girls: ~570 Age Range: 15 to 17 years old Learners (Shift 1): 1000 (20 sections) Boys: ~430 Grade Levels: Grade 10 ~50 per section **Total number of** Girls: ~515 Age Range: 14 to 16 years old Learners (Shift 2): 900 (18 sections) Grade Levels: Grade 9 Boys: ~385 ~50 per section **Total number of** Girls: Age Range: Learners (Shift 3): Grade Levels: NA Boys: **Total number** Girls: Age Range: Total no. of class enrolled in shifts: Learners with Boys: Grade Levels: Special Educational None Needs (LSEN) **Total Number of Teachers and School Total Number of persons with disabilities:** Personnel: 60 Teaching; 8 non-teaching Teachers/School Personnel: Women: 52 Women: Men: Men: 8 Learners: Girls: Boys: PART 2: RETROFITTING (BUILDING SPECIFIC) 8. Type of retrofitting: ☐Steel Plate Bonding □ Concrete Jacketing □Steel Jacketing ⊠ Fiber Reinforced Polymer (FRP) Systems
 ☐Steel Bracing Systems 9. Type of rooms directly Remarks (Quantity) affected by retrofitting Offices: ☐ Principal □ Administration 1 room (ground floor) □ Guidance □ Faculty ☐ Maintenance

Rooms:

| PHILIPPINE SEISIVIIC RISK I   | REDUCTION AND RESILIENCE PROJEC             | I (PSRRRP)                                    |
|-------------------------------|---|---|
|                               | ☐ Science Laboratory                        |   |
|                               | ☐ Speech Laboratory                         |   |
|                               | ☐ Computer Laboratory                       |   |
|                               | ☐ Conference                                |   |
|                               |   |   |
|                               | ☐ Industrial/Workshop                       |   |
|                               |   |   |
|                               | Others:                                     |   |
|                               | ⊠ Canteen                                   | Area equivalent to 3 rooms + extended kitchen |
|                               | ☐ Feeding Center                            | ·   |
|                               | ☐ Clinic                                    |   |
|                               | ∠ Library                                   |   |
|                               | ⊠ Storage rooms                             |   |
|                               |   | 2 rooms                                       |
|                               | Lodging                                     | 2.001110                                      |
|                               | ☐ Pantry                                    |   |
|                               |   |   |
| 10. Existing facilities to    | WASH Facilities                             | Remarks (Quantity)                            |
| be affected by                |   | 6 CRs (1F and 3F)                             |
| retrofitting                  |   | OCKS (11 and 31)                              |
| retrontting                   | ☐ Urinal                                    | 1 Outdoor Handwashing Facility                |
|                               |   | 1 Outdoor Handwashing Facility                |
|                               | ☐ Water tank                                |   |
|                               |   | 4 L (c. 11 12 . 1 (b 1 1                      |
|                               | ⊠ Septic Tank                               | 1; located behind the building                |
|                               | •   | (between 1C-1 and 1C-2)                       |
|                               | Other structural elements/facilities:       |   |
|                               |   |   |
|                               |   | 2   |
|                               |   | Interconnected with two (2) buildings         |
|                               | □ Fire-safety (Fire extinguisher            | Fire cabinets (Fire extinguisher) per         |
|                               | cabinet, sprinklers, fire exits)            | floor   |
|                               | □ Drainage system                           |   |
|                               | □ Ceilings, wall partition                  |   |
|                               |   | 0.1:  |
|                               | ⊠ Stairs                                    | 2 stairs                                      |
|                               | ⊠ Electrical power supply                   |   |
|                               |   |   |
| 11. Other Comments/Obse       | ervations during the field visit:           |   |
|                               |   |   |
| Other affected facilities:    |   |   |
| Two (2) building in-cha       | rge office                                  |   |
|                               | t fourth floor are converted into a library |   |
| · ·                           | ers ALS/Open High School learners.          |   |
| • One (1) classroom cate      | ers ALS/Open high School learners.          |   |
|                               |   |   |
|                               |   |   |
|                               |   |   |
|                               |   |   |
|                               |   |   |
|                               |   |   |
|                               |   |   |
|                               |   |   |
|                               |   |   |
|                               |   |   |
| <b>PART 3: DESCRIPTION OF</b> | PROJECT SITE AND SURROUNDING C              | OMMUNITIES (BASELINE)                         |

| PHILIPPINE SEISMIC RISK REDUCTION AND RESILIE  |        |  |
|--|--------|--|
| QUESTION   | YES/NO | REMARKS DURING FIELD VALIDATION/ DESCRIBE PHYSICAL APPEARANCE  |
| 12. Project Description  |        | 11110107(27)(1112)(110)(110)   |
| 12.1. Is there a proposed/ ongoing project for the rehabilitation/ reconstruction of school buildings?   | NO     | <ul> <li>□ Repair</li> <li>□ Rehabilitation</li> <li>□ Retrofit</li> <li>□ Demolition</li> <li>□ Total reconstruction</li> </ul> |
| 12.2. Is the school facility fenced?   | YES    | - Total reconstruction   |
| -If yes, describe the distance of the building from the fence.   |        |  |
| 12.3. Are there any Entry/ Exit Points in the school?  | YES    | Indicate number: 1 The gate has a span of 9 meters.  |
| 12.4. Are there asbestos roofing and other asbestos materials to be removed from the site?   | NO     |  |
| 13.1. Is the project located next to a residential house? -Indicate if the houses are adjacent or if nearby only   | YES    |  |
| 13.2. Are there any hospitals and health clinics with lying-in services near the school building?  | YES    | Brgy Sta. Lucia Health Center is ~260 meters NW of the school building   |
| 13.3. Are there any culturally/historically important buildings or areas near the school?  | NO     |  |
| 13.4. Are there any other institutions, public offices/ public places (wet market, parks, etc.) near the school?   | NO     |  |
| 13.5. Are there any religious places (churches, mosques, etc.) near the school?  | YES    | St. Jude Thaddeus Parish is ~100 meters south of the school.   |
| 13.6. Is the project site close to a commercial area?  | NO     |  |
| 13.7. Is there an economic enterprise/s (i.e., canteen) within or outside the project compound that may be affected during construction?                           | YES    | The school canteen is located at VPE Building.   |
| 14. Land   |        |  |
| 14.1. Are there trees to be removed/affected by the construction?  | YES    | Trees in front of the building   |
| 14.2. Are there available local solid waste management services provided to the school? (i.e., Material Recovery Facilities, Color Coded Trash Bins)               | YES    | A functional MRF, color coded trash bins;<br>waste are daily collected by the<br>City/Barangay LGU                               |
| 14.3. Are there available hazardous waste transport and treatment services in the locality? (batteries, busted lamps, used oils, welding rods, paint buckets etc.) | YES    | The building supervisor reports these items.   |
| 15. Water  |        |  |
| 15.1. Have you experienced flooding in the past years?   | YES    | Typhoon Ondoy (2009);<br>The flood is at above the ankle level which<br>lasted for 1 to 2 days.                                  |
| -If yes, how frequent in a year? -Describe extent of flooding (height) -Indicate duration of flooding due to typhoon or heavy rain                                 |        |  |
| 15.2. Is the project located next to a waterway, i.e. canal, creek, river?   | NO     | Marikina River is ~790 meters west of the project site.  |

| are allowed in the canteen but not ne recess time of the students.  are allowed to use the male CRs.  and asynchronous learning are oposed. |
|---|
| are allowed to use the male CRs.  and asynchronous learning are   |
| are allowed to use the male CRs.  and asynchronous learning are   |
| are allowed to use the male CRs.  and asynchronous learning are   |
| are allowed to use the male CRs.  and asynchronous learning are   |
| are allowed to use the male CRs.  and asynchronous learning are   |
| are allowed to use the male CRs.  and asynchronous learning are   |
| are allowed to use the male CRs.  and asynchronous learning are   |
| are allowed to use the male CRs.  and asynchronous learning are   |
| are allowed to use the male CRs.  and asynchronous learning are   |
| are allowed to use the male CRs.  and asynchronous learning are   |
| are allowed to use the male   |
| ne recess time of the students.   |
|   |
|   |
|   |
|   |
|   |
|   |
| <u> </u>  |
| R Building  |
| or the banding.   |
| of VPE Building.  |
|   |
| s ~5 meters.  |
| d in front of the school gate (Tramo  |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
|   |
| the city drain along Tramo Street.  |
| ti<br>na<br>s   |

**EXPOSURE** 

|                                   | High           | Medium         | Low            |  |
|-----------------------------------|----------------|----------------|----------------|--|
| A. SEISMIC HAZARDS                |                |                |                |  |
| A.1. Ground Rupture               | Prone          | -              | Safe           | Safe; Approximately 3.3 km east of the   |
| 7 a m Ground Raptaro              |                |                | /              | Valley Fault System: West Valley Fault   |
| A.2. Ground Shaking               | Intensity      | Intensity      | Intensity      | Prone; Intensity VIII                    |
| 7 IIII Ground Grianning           | Scale VII-X    | Scale IV-VI    | Scale I-III    |  |
|                                   | /              |                |                |  |
| A.3. Liquefaction                 | High           | Moderate       | Low            | Moderate Potential                       |
| •                                 | Susceptibility | Susceptibility | Susceptibility |  |
|                                   |                | /              |                |  |
| A.4. Earthquake-Induced Landslide | High           | Moderate       | Low            | Safe                                     |
|                                   | Susceptibility | Susceptibility | Susceptibility |  |
|                                   |                |                | /              |  |
| A.5. Tsunami                      | Prone          | -              | Safe           | Safe                                     |
| B. VOLCANIC HAZARDS               |                |                | /              |  |
|                                   | Within         | _              | Outside        | Approximately 64.3 km north of Taal      |
| B.1. Nearest Active Volcano       | danger zone    | _              | danger zone    | Approximately 04.3 km north of faar      |
|                                   | danger zone    |                | /              |  |
| B.2. Ashfall                      | Prone          | -              | Safe           | Prone                                    |
| D.Z. / Willam                     | /              |                |                |  |
| C. HYDRO-METEOROLOGICAL           |                |                |                |  |
| C.1. Flood                        | High to Very   | Moderate       | Low            | High Susceptibility; 1 to 2 meters flood |
| 5                                 | High/Critical  | Susceptibility | Susceptibility | height and/or more than 3 days           |
|                                   | /              |                |                | flooding                                 |
| C.2. Storm Surge                  | Prone          | -              | Safe           | Safe                                     |
|                                   |                |                | /              |  |

# D. Nearest Critical Facilities (from HazardHunterPH)

(i.e., institutions, health facilities, road network)

| Facility Name  | Туре                       | Distance from the Project |
|--|----------------------------|---------------------------|
| De Castro ES   | Public Elementary School   | 667 m                     |
| Sta. Lucia HS  | Public Secondary School    | 606 m                     |
| Santa Lucia Health Center  | Government Health Facility | 308 m                     |
| Medical Mission Group Metro Manila<br>East Hospital & Health Services<br>Cooperative | Private Health Facility    | 982 m                     |
| Manila East Rd (Rosario-Cainta Rd);<br>Pasig City (Ione District)                    | Primary Road Network       | 645 m                     |
| Manila East Rd; Rizal (first District)   | Secondary Road Network     | 1.2 km                    |

| PART 5: ENVIRONMENTAL AND SOCIAL IMPACTS           |   |   |   |         |
|--|---|---|---|---------|
| IMPACTS  | High  | Medium  | Low   | REMARKS |
| A. ENVIRONMENTAL IMPACTS                           |   |   |   |         |
| 1.Land   |   |   |   |         |
| 1.1. Waste Generation during Retrofitting          |   |   |   |         |
| 1.1.1. Domestic sewage<br>from workers             | No available<br>sanitation<br>facilities for<br>workers                   | Use of dedicated sanitation facilities within the school premises | Use of sanitation facilities for workers within the building            |         |
| 1.1.2. Solid wastes and construction debris/spoils | No<br>space/area<br>available   | Area<br>available<br>within the                                   | Area<br>available<br>within the   |         |
|  | adjacent to<br>the school<br>building                                     | school<br>premises  | school<br>building  |         |
| 1.1.3. Hazardous waste and asbestos materials      | Will require<br>removal of<br>asbestos and<br>other<br>hazardous<br>waste | Will require<br>removal of<br>other<br>hazardous<br>waste         | Will not<br>require<br>removal of<br>asbestos nor<br>hazardous<br>waste |         |
|  | No<br>space/area  | Area<br>available   | Area<br>available   |         |

| PHILIPPINE SEISMIC RISK REDUCT         | TION AND R   | <b>ESILIENCE</b>                   | PROJECT (F                     | PSRRRP)                                  |
|--|--|------------------------------------|--------------------------------|--|
| 1.2. Soil Erosion from excavated       | available  | within the                         | within the                     | The area in front of the VPE Building    |
| materials                              | adjacent to  | school                             | school                         | may be used as a location of storage     |
| materials                              | the school building  | premises                           | building                       | of excavated materials.                  |
|  | building   |                                    | /                              |  |
| 1.3. Cutting of Trees                  | Will involve   | Will involve                       | Will not                       | Trees and ornamental plants in front of  |
| 1.5. Outling of frees                  | cutting of   | tree trimming                      | involve                        | the building will be affected.           |
|  | trees  | only                               | cutting of                     | 3  |
|  | ,  |                                    | trees                          |  |
| 2 Mater                                | /  |                                    |                                |  |
| 2. Water                               | D  | T                                  | MCII 4                         | T  |
| 2.1. Change in drainage flow           | Permanent diversion of   | Temporary diversion of             | Will not<br>require            |  |
|  | drainage flow  | drainage flow                      | diversion of                   |  |
|  | , and the second | ŭ                                  | drainage flow                  |  |
|  |  |                                    | /                              |  |
| 2.2. Inducement of flooding            | Will involve   | -                                  | Will not                       | Retrofitting of footings and tie beams   |
|  | earthworks   |                                    | involve<br>earthworks          | will involve excavation.                 |
|  | /  |                                    | Cartiworks                     |  |
| 2.3. Clogging of canals (existing      | Will involve   | -                                  | Will not                       |  |
| , ,                                    | earthworks   |                                    | involve                        |  |
| drainage system)                       |  |                                    | earthworks                     |  |
| 0.4.0 - discount ti                    | /<br>Direct  | Direct                             | No                             |  |
| 2.4. Sedimentation of creeks,          | discharge to   | discharge to                       | creeks/rivers                  |  |
| rivers                                 | nearby   | city drainage                      | adjacent                       |  |
|  | creeks/rivers  | system                             | ,                              |  |
|  |  | /                                  |                                |  |
| 3. Air Quality/ Noise/ Vibration       | 11   | I.                                 |                                |  |
| 3.1. Air Pollution from retrofitting   | Construction   | _                                  | Construction                   | The retrofitting works will involve the  |
| <u> </u>                               | activities will  | _                                  | activities will                | usage of heavy equipment and tools.      |
| activities and equipment (i.e.,        | involve use  |                                    | not involve                    | acago er maar, e quipmem ana icons       |
| Noise from equipment, tools, and       | air pollution  |                                    | use air                        |  |
| workers)                               | sources (i.e., gensets,  |                                    | pollution<br>sources (i.e.,    |  |
|  | heavy  |                                    | gensets,                       |  |
|  | equipment)   |                                    | heavy                          |  |
|  |  |                                    | equipment)                     |  |
|  | /  |                                    |                                |  |
| 3.2. Dust from retrofitting activities | Construction   | Construction                       | Construction                   | VPE Building is adjacent to the          |
| Ç                                      | site is directly   | site is within                     | site is more                   | residential area (west portion).         |
|  | adjacent to the sensitive  | 30 meters <sup>1</sup><br>from the | than 30<br>meters from         |  |
|  | receptor   | sensitive                          | the sensitive                  |  |
|  |  | receptor                           | receptor                       |  |
|  | 1  |                                    |                                |  |
| 3.3. Ground Vibration                  | Construction   | -                                  | Construction                   | Excavation (for tie beams) will be       |
|  | activities will involve  |                                    | activities will<br>not involve | conducted.                               |
|  | groundworks.   |                                    | groundworks                    |  |
|  | g.ca.ia.ici.ici  |                                    | grounding                      |  |
|  | /  |                                    |                                |  |
| B. SOCIAL IMPACTS                      |  |                                    |                                |  |
| 4. Relocation                          |  |                                    |                                |  |
| 4.1. Relocation of students due to     | > 50% of   | >10% but                           | <10% of the                    |  |
| class disruption                       | building occupants   | <50% of the building               | building occupants             |  |
| ciaco aiorapaori                       | (students)   | occupants                          | (students)                     |  |
|  | (-1225/110)  | (students)                         | (=====)                        |  |
|  | /  | 4501                               |                                |  |
| 4.2. Relocation of affected small      | > 50% of   | >10% but<br><50% of                | <10% of                        |  |
| businesses (i.e., Canteen) within      | small<br>businesses  | <50% of small                      | small<br>businesses            |  |
| the project compound                   | Dadiiiodda   | businesses                         | Dadiilosses                    |  |
| · •                                    | /  |                                    |                                |  |
| 4.3. Relocation of school staff        | > 50% of   | >10% but                           | <10% of                        | Approximately 60 out of 259 personnel    |
|  | school staff   | <50% of school staff               | school staff                   | will be affected. This includes teachers |
|  |  | /                                  |                                | and canteen staff.                       |
| 5. Site Security                       |  |                                    |                                |  |
|  |  | 1                                  |                                | i e e e e e e e e e e e e e e e e e e e  |

 $<sup>^{\</sup>rm 1}\,{\rm Source}\colon{\rm National\ Pollution\ Control\ Commission\ (NPCC)}$ 

| PHILIPPINE SEISMIC RISK REDUCT  | Allow stay in  | Allow stay in   | Workers will  | JAMANE J  |
|---|--|---|---|-----------|
| 5.1. Presence of workers posing risks to peace and order                  | workers without the presence of school security                                      | workers with<br>the presence<br>of school<br>security                               | have construction camp outside the school premises and with the presence of school security |           |
| 5.2. Access to site   | Only one   | Only one  | School  |           |
|   | entry/exit point within the school building without school security                  | entry/exit<br>point within<br>the school<br>building with<br>school<br>security     | building with<br>multiple<br>entry/exit<br>points   |           |
| 6. Access to Utilities  |  |   | /   |           |
| 6.1. Project will result to temporary disruption of water supply          | Water<br>disruption for<br>the whole<br>construction<br>duration                     | Water<br>disruption for<br>more than 1<br>month                                     | Water<br>disruption for<br>less than one<br>month   |           |
| 6.2. Project will result to temporary disruption of electricity           | Electricity disruption for the whole construction duration                           | Electricity<br>disruption for<br>more than 1<br>month                               | Electricity<br>disruption for<br>less than one<br>month                                     |           |
|   | > 50% of   | >10% but  | /<br><10% of  |           |
| 6.3. Impact on existing sanitation and sewerage facilities                | existing<br>sanitation<br>and<br>sewerage<br>facilities                              | <50% of<br>existing<br>sanitation<br>and<br>sewerage<br>facilities                  | existing<br>sanitation<br>and<br>sewerage<br>facilities                                     |           |
| 7. Labor and Working Conditions/  | Community  | Health and  | Safety/ GB\   | / and SHA |
| 7.1. Impact on Community Health and Safety                                | Construction<br>site is directly<br>adjacent to<br>the nearby<br>community           | Construction site is within 30 meters <sup>2</sup> from the nearby community        | Construction<br>site is more<br>than 30<br>meters from<br>the nearby<br>community           | and SHA   |
| 7.2. Effect on Gender Based   | Allow stay in  | Allow stay in   | Workers will  |           |
| Violence (GBV) and Sexual Harassment and Sexual Exploitation and Abuse    | workers without the presence of school security                                      | workers with<br>the presence<br>of school<br>security                               | have construction camp outside the school premises and with the presence of school security |           |
|   | 0 (  | /   | 0   |           |
| 7.3. Effect on workers for occupational health and safety                 | Construction activities will involve use of heavy equipment and hazardous chemicals. | Construction activities will involve use of heavy equipment or hazardous chemicals. | Construction activities will not involve use of heavy equipment nor hazardous chemicals     |           |
| 7.4. Spread of Communicable Diseases, (i.e. COVID-19, HIV-AIDS, TB, etc.) | Allow stay in workers without the presence of school security                        | Allow stay in<br>workers with<br>the presence<br>of school<br>security              | Workers will have construction camp outside the school premises                             |           |

<sup>&</sup>lt;sup>2</sup> Source: National Pollution Control Commission (NPCC)

| PHILIPPINE SEISINIC KISK KEDUCI       | ION AND IN  | COILILITOL I | 1,00001 (1   | Orana j |
|---------------------------------------|-------------|--------------|--------------|---------|
|                                       |             |              | and with the |         |
|                                       |             |              | presence of  |         |
|                                       |             |              | school       |         |
|                                       |             |              | security     |         |
|                                       |             | /            |              |         |
| 8. Traffic                            |             |              |              |         |
| 8.1. Traffic Congestion/ blocked      | One-lane    | Two-lane     | Four-lane    |         |
|                                       | Road        | Road         | Road         |         |
| roadways during delivery of           |             | /            |              |         |
| construction materials                |             |              |              |         |
| 8.2. Available open space for         | No          | Area         | Area         |         |
| ·                                     | space/area  | available    | available    |         |
| traffic/parking                       | available   | within the   | adjacent to  |         |
|                                       | adjacent to | school       | the school   |         |
|                                       | the school  | premises     | building     |         |
|                                       | building    | p. 0         | 24.14.1.9    |         |
|                                       |             |              | /            |         |
| 8.3. Effect to Pedestrian and traffic | One-lane    | Two-lane     | Four-lane    |         |
|                                       | Road        | Road         | Road         |         |
| safety                                |             | /            |              |         |

# 9. List of Observed/Identified Sensitive Receptors/Stakeholders (during site visit)

| General Direction | Sensitive Receptor | Name of Facility                    | Distance from the<br>Project    |
|-------------------|--------------------|-------------------------------------|---------------------------------|
| North             | School building    | DepEd Building                      |                                 |
| East              | School grounds     |                                     |                                 |
| West              | Residential Area   |                                     |                                 |
| South             | Church             | St. Jude Thaddeus<br>Parish – Pasig | 120 meters south of the project |

(Church, HOA, Health Facility, Cultural Heritage)

|  | CTION AND RESILIENCE PROJECT e applicable safeguard measures to be   | ,  |
|--|--|--|
| ⊠ Environmental Code of impacts  | Practice (ECOP) – applicable to activ  | rities generating low (minimal)  |
| <ul><li>☑ ECOP 1: Tempor</li><li>☑ ECOP 2: Genera</li><li>☑ ECOP 3: Worker</li></ul>   | rary Relocation of School Classrooms<br>al Construction Site Management<br>rs' Health and Safety<br>unity Health and Safety<br>al Properties | s and other Building Utilities   |
| <ul><li>☑ Environmental and Soci medium (manageable) to h</li><li>☑ Grievance Redress Med</li><li>☑ Stakeholder Engagement</li></ul>               | chanism  | cable to activities generating   |
|  | n<br>I Health Program (CSHP) Checklist   |  |
| <ul> <li>☑ Consultant-Contractor's</li> <li>☑ Student Relocation Plan</li> <li>☑ Labor Management Plan</li> <li>☑ Chance Find Procedure</li> </ul> | Contract<br>n (LMP)  |  |
| Note that the applicable safeguard contractor.   | ds measures are to be included in the  | e bid and contract documents of the  |
| Recommendations for Safety and   | Functional Improvement:  |  |
|  |  |  |
|  |  |  |
|  |  |  |
|  |  |  |
|  |  |  |
|  |  |  |
| Consultant  (Signature over Printed Name)  | Project Implementation Unit  NATUALIF HUNK T- DAUGIN  (Signature over Printed Name)  | Attested by: (DepEd Representative/s)  Calve Region O. Pleas (Signature byer Printed Name) |
|  | (Signature over Printed Name)  | (Signature over Printed Name)  |

# 1 TRAFFIC MANAGEMENT PLAN (TMP)

The Traffic Management Plan (TMP) for Sta. Lucia High School focuses on efficient planning and managing the movement of construction materials, waste, and personnel within the project area. The TMP also addresses both stationary and moving traffic, including pedestrians, cyclists, and vehicles.

Additionally, the TMP outlines the types of traffic involved, identifies the existing roads and routes impacted by the project, and details the measures necessary to control traffic flow in the areas affected by the construction activities.

# 1.1 Objectives

The primary objective of this TMP is to protect the workers, pedestrians, students, teachers, and motorists by minimizing the potential risks associated with traffic movement.

The objectives of the TMP are to:

- Eliminate or reduce the probability of accidents occurring within the vicinity of the project;
- Provide a smooth traffic flow for pedestrians and vehicles; and
- Comply with Pasig City Government Unit's policies and regulations.

### 1.2 Existing Site Conditions

#### 1.2.1 Access Roads

Sta. Lucia High School is accessible via the road network consisting of Ortigas Avenue Ext, Bonifacio Avenue, Cardinal Santos, Sapphire St., St. Martin St., Parola St., and Tramo Street. The road directly in front of the school, Tramo Street, is approximately five meters wide and features two lanes (see **Figure 1-1**).



Figure 1-1: Access to Sta. Lucia High School

# 1.2.2 School Vicinity

Sta. Lucia High School is under institutional use and is surrounded by residential areas based on the Comprehensive Land Use Map of Pasig City. The school site has only one main gate in which learners and school personnel can enter and exit. The main gate measures 9 meters wide.



Figure 1-2: Vicinity of Sta. Lucia High School

## 1.3 Proposed Delivery Route

The proposed delivery route for the project is illustrated in **Figure 1-3**. It is a multiple-way route starting at Ortigas Ave, turning right or left into Countryside Ave. The delivery vehicles will travel approximately 530 meters before turning left into Tramo Street, where the school is located. The same route will be traversed by the vehicles after its delivery. An alternative route is via Ortigas Ave, De Castro Ave, and Tramo Street. All roads along the proposed route are asphalt paved.

It is also necessary that the implementing contractor must conduct a site verification, as the route may require adjustments based on an assessment of road conditions and traffic behavior during the project implementation.

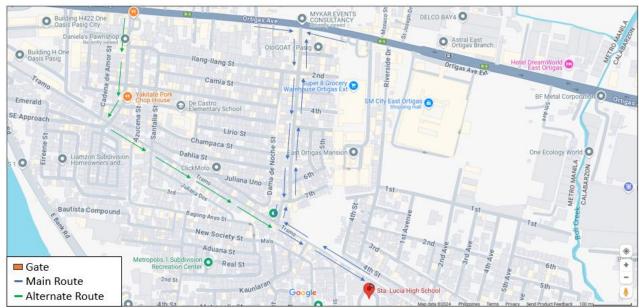


Figure 1-3: Proposed Delivery Route for the Project

### 1.4 Proposed Delivery Schedule

As mentioned in Article XVI – Truck Ban and Public Transport Routes of the 2016 Traffic and Parking Management Code of Pasig City, truck routes in Pasig are restricted between 6:00 to 10:00 AM and 5:00 to 10:00 PM, except on Sundays and holidays. Considering the class schedules of Sta. Lucia High School, the proposed delivery window will be from 10:00 PM to 3:00 AM.

The implementing contractor will coordinate with the Pasig City Traffic and Parking Management Office (TPMO), the local barangay government unit (LGU), and the school administration to finalize the delivery schedule for construction materials.

# 1.5 Proposed Staging Area

A staging area serves as the temporary place for storing construction material and equipment to ensure safety, efficiency, and cost-effectiveness throughout the construction process. Based on the consultations with the school, the proposed staging area and other support facilities (i.e., sanitation facility, spoil management) will be placed in front of Vicente P. Eusebio Building and DepEd Building.

In addition, container vans will be placed along the road in front of the bulletin board area within the school. These will serve as temporary storage area of the school materials.

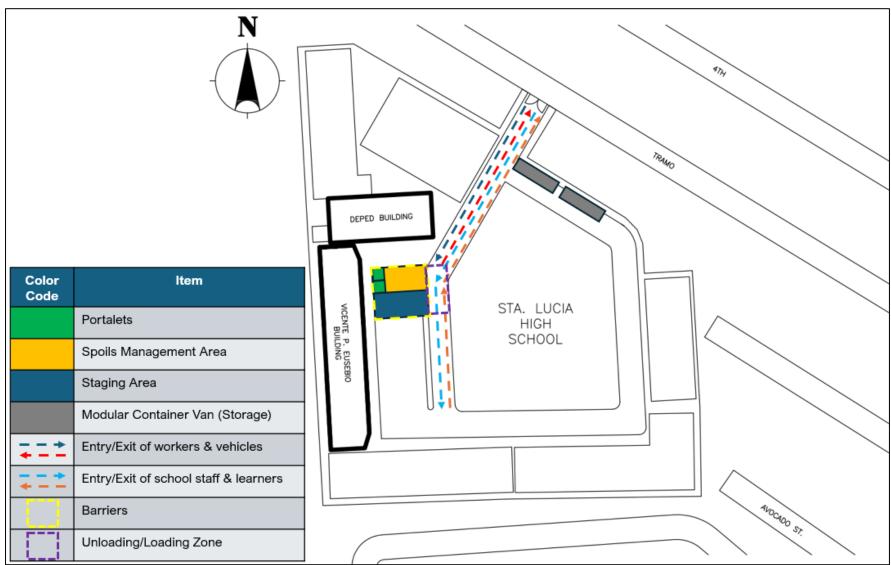


Figure 1-4: Proposed Staging Area and other Support Facilities in Sta. Lucia High School

# 1.6 Recommended Delivery Vehicles

The following are the recommended vehicles to be used in the delivery of construction materials and equipment in consideration of the narrow width and low vertical clearance of some roads leading to the school.

**Table 1-1: Recommended Delivery Vehicles** 

| Image | Type of Vehicle | Description   |
|-------|-----------------|---|
|       | Utility Van     | The most used delivery vehicle in Metro Manila, since this type of vehicle is small enough to access the narrow roads in the city while having a sufficient storage capacity. This can also be used to transport the construction workers to and from the school.                                 |
|       | Open Truck      | This type of vehicle is used to deliver construction materials that don't require the usual packaging (e.g., sand, gravel). In addition, this type of vehicle is also used to collect and transport the spoils and other construction waste from the school to a designated facility.             |
|       | Box Truck       | Box trucks use a fully enclosed cargo area, typically made of aluminum or fiberglass, primarily for protection from weather and theft. This type of vehicle has various sizes such as 10 ft for minor deliveries, 12-14 ft for medium-sized loads, and 16-18 ft for transporting large equipment. |

# 1.7 Traffic Risk Management

### 1.7.1 Road Safety

• **Traffic control devices** – Regulatory signs shall be installed following approval and in coordination with the City Government of Pasig and the DPWH or its delegated authority. These signs are essential for regulating traffic along the designated delivery routes, providing clear directions that must be followed. The examples of regulatory signs are presented in **Figure 1-5**.



The STOP sign is used to ensure caution before entering an intersection and shall be used where a complete stop is required by law for safety. It is intended to ensure that drivers have sufficient time in which to assess the degree of hazard prevailing before entering an intersection.

The sign is normally located on the right side of a twoway road facing approaching traffic and at, or as close as practicable to the point where approaching vehicles are required to stop. On one-way roads, however, STOP signs should be erected on both sides facing approaching traffic. Wherever practicable, a stop line shall be used in addition to the STOP sign to indicate the required stopping point more precisely.

# Table 2.1: STOP Signs

| Sign No. | Size (mm) |
|----------|-----------|
| R1-1A    | 450 X 450 |
| R1-1B    | 600 X 600 |
| R1-1C    | 750 X 750 |
| R1-1D    | 900 X 900 |

#### 2.7.1 Direction to be Followed (R2-1 to R2-7)

#### a) Disc Type

Reflectorized Blue Background Reflectorized White arrow.

Table 2.4: Direction Signs, Disk Type

| Sign No        | Size (mm) |
|----------------|-----------|
| R2-1A to R2-7A | 450       |
| R2-1B to R2-7B | 600       |
| R2-1C to R2-7C | 750       |













2.8.1 No Entry for All Vehicles (R3-1 and R3-1P)

Reflectorized red disc symbol Reflectorized white bar Reflectorized white plate background (R3-1P) only Black legend and border (R3-1P) only

Table 2.8: No Entry for All Vehicles Signs

| Sign   | Size (mm) |         | Letter Size (mm) |        |        |
|--------|-----------|---------|------------------|--------|--------|
| No     | Disc      | Bar     | Plate            | Line 1 | Line 2 |
| R3-1A  | 600       | 480X120 |                  |        |        |
| R3-1B  | 750       | 600X150 |                  |        |        |
| R3-1PA | 300       | 250X50  | 400X600          | 75 DM  | 75 DN  |
| R3-1PB | 450       | 375X75  | 600X900          | 120 DM | 120 DN |
| R3-1PC | 600       | 500X100 | 800X1200         | 160 DM | 160 DN |





R3-1

The NO ENTRY sign shall be used at the termination of a one-way carriageway to prohibit access of all vehicles from the wrong direction.

At one-way street exits, NO ENTRY signs shall be erected on both sides of the street at the intersection facing in the opposite direction to the one-way flow. The signs may need to be located a short distance into the one-way street if there is a possibility of drivers becoming confused as to which street is closed for entry. Sufficient signs shall be erected to ensure that at least one is clearly visible to drivers approaching from any direction, and some signs may have to be set at an angle to achieve this purpose.

#### 2.8.2 No Entry for Specific Type of Road Users (R3-2 to R3-12)

Reflectorized red border and bar. Reflectorized white background, and Black Symbol.

Table 2.9: No Entry for Specific Type of Road Users Signs

| Sign No         | Size (mm) | Size of Border<br>and Bar (mm) |
|-----------------|-----------|--------------------------------|
| R3-2A to R3-12A | 450       | 40                             |
| R3-2B to R3-12B | 600       | 50                             |
| R3-2C to R3-12C | 750       | 60                             |





F







# 2.11.1 Prohibition on Use of Audible Warning Device – No Blowing of Horns Sign (R6-1)

Reflectorized red annular border and bar Black symbol

Reflectorized white background



Use of audible warning device is prohibited, where this sign is used, except to avoid an accident or those vehicles that are authorized to use warning devices in case of emergency. The No Blowing of Horns sign is usually erected in the vicinity of hospitals, schools, libraries, and churches. The diameter of the disk is 600mm.

(continued in the next page)

#### 2.9.1 Speed Restriction (Maximum) (R4-1)

Black numerals. Reflectorized red annular symbol. Reflectorized white background.

Table 2.13: Speed Restriction Signs

| Sign No | Size<br>(mm Dia.) | No of<br>Numerals | Numeral Size<br>(mm) and<br>Series |
|---------|-------------------|-------------------|------------------------------------|
| R4-1A   | 450               | 2                 | 200 DN                             |
| D4 4D   | R4-1B 600         | 2                 | 240 DN                             |
| R4-1B   |                   | 3                 | 240 DN                             |
| R4-1C   | 900               | 2                 | 400 DN                             |
|         |                   | 3                 | 320 DN                             |





#### 2.10.2 Restricted Parking and Loading Signs (R5-4; R5-4A; R5-4B; R5-4C)

Restricted parking signs shall be rectangular in shape and normally not less than 450mm X 750mm in size with the long axis vertical. They shall have reflectorized white background, green reflectorized borderline and legends for permissive messages such as 2 HOUR PARKING, METER PARKING; and, LOADING AND UNLOADING ZONE.

The LOADING ZONE sign should also be used in conjunction with the NO PARKING disc. Parking control signs need not be reflectorized unless street lighting is inadequate or the message has special night time significance.

The LOADING AND UNLOADING ZONE sign shall be rectangular in shape and not less than 450mm X 750mm in size, with the long axis vertical.

These signs shall be used at designated loading and unloading zones for passengers and goods along a route or at a minimum of 30.0m before and after an intersection.







LOADING AND UNLOADING ZONE

#### 2.11.5 School Children Crossing (R6-9)

Black symbol, legend and border Reflectorized fluorescent yellow green background

Table 2.19: School Children Crossing Sign

| Sign No | Size (dia. mm |  |
|---------|---------------|--|
| R6-9A   | 450mm         |  |
| R6-9B   | 600mm         |  |
| R6-9C   | 750mm         |  |



Unlike the Children Warning sign (W6-2) which is placed in advance in accordance with distances recommended (see Table 3.1) R6-9 is a regulatory sign to be placed at the stop lines on the approaches to a marked School Children crossing.

SOURCE: DPWH Highway Safety Design Standards Part 2: Road Signs and Pavement Markings Manual (2012)

Figure 1-5: Recommended Regulatory Signs

- Lane designation and speed limit According to Section 35b of Republic Act No. 4136 (Land Transportation and Traffic Code of 1964), a speed limit of 20 kilometers per hour is required "on congested streets, near intersections at blind corners, in school zones, when passing stationary vehicles, or in other potentially hazardous situations." This speed limit must be followed by all vehicles, including delivery trucks, when approaching intersections and other critical areas along their designated routes, as well as at the access point to the school.
- Improvement of truck visibility during nighttime The visibility of delivery trucks
  operating at night or in low-light conditions can be enhanced by using retro-reflective contour
  markings. These markings involve applying retro-reflective tape along the vehicle's outline,
  making it more visible to other road users.

While retro-reflective markings are not yet required by law for trucks in the Philippines, the proposed project can significantly contribute to improving the visibility and safety of heavy vehicles in the area by introducing the use of these markings on delivery trucks.

In August 2016, the Australian Trucking Association Industry Technical Council published a Technical Advisory Procedure (TAP) for Heavy Vehicle Visibility. The TAP is a voluntary

guideline that provides recommendations on contour markings, suggested colors, and their applicability to different vehicle types.

Contour markings can be applied in three variations: full contour, partial contour, and stripe marking. It is important to note that retro-reflective markings designed for moving vehicles have distinct performance characteristics compared to traffic sign sheeting (see **Figure 1-6**).

### 1.7.2 Pedestrian Safety

Whenever possible, pedestrians should be kept separated from vehicles. It is recommended that the site be divided into the following zones:

- Pedestrian zones Walkways and work areas designated for pedestrians.
- Restricted areas Work zones and roadways designated for vehicles only; pedestrian access is typically not allowed here.
- Shared zones Crossings over roadways and certain work zones where both pedestrians and vehicles are permitted to interact.

Walkways and work areas should be clearly separated from vehicle zones using physical barriers or line markings. These barriers will generally serve as visual boundaries for the pedestrian areas.

In certain cases, it may be necessary to temporarily close a pedestrian zone to pedestrians and allow vehicle traffic. In such instances, appropriate equipment, such as signage, barriers, and traffic cones, should be used, and communication with all affected parties (e.g. barangay LGU) is essential.

### a) Full contour - the preferred layout.

Reflective tape is applied as close as possible to the edge of the vehicle to form a continuous line depicting the outline of the vehicle. This provides maximum visibility to other road users and is best practice. This method must also be chosen if there are retro-reflective graphics on the side of the vehicle.

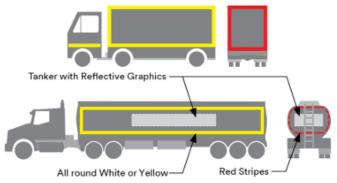


Figure 4: Full contour marking for a tanker

### b) Partial contour

A single stripe of retro-reflective tape is applied along each side and rear of the body or trailer, with 'L' shape sections 0.5 m long in each corner.



Figure 5: partial contour marking

### c) Stripe marking

A single stripe of retro-reflective tape is applied along each side of the vehicle and body or trailer side, and a strip across the rear. This basic layout shall only apply to those vehicles that do not utilise retro-reflective graphics or logos or have limited structure onto which tape can be applied on the upper sections of the trailer.




Figure 6: Stripe contour marking for truck and dog

SOURCE: ATA Technical Advisory Procedure: Heavy Vehicle Visibility 2<sup>nd</sup> Edition (2016)

Figure 1-6: Retro-Reflective Marking Option for Trucks

## 1.7.3 Workers Safety

The contractor should take necessary measures to ensure that all workers are physically capable and properly trained to operate the vehicles, equipment, and attachments they use on site. This can include:

- Conducting inspection during the recruitment of drivers/operators or when hiring contractors;
- Providing training for drivers and operators; and
- Managing the activities of visiting drivers.

Individuals who direct vehicle movements (such as signallers) must be adequately trained and authorized for the task. Accidents may occur if untrained or inexperienced workers operate construction vehicles without proper authorization. Access to vehicles should be controlled, and workers should be made aware of the associated risks.

# 1.7.4 Loading and Unloading Operations

Each loading and unloading zone, which is in front of the school gate, should have an exclusion zone marked around the vehicle. Additionally, there should be a designated driver safety zone located a short distance away, with a clear line of sight to the loading area. The loading/unloading process should be carried out in two distinct phases:

- Phase 1: The driver should not be allowed to perform any tasks on the truck (e.g., securing curtains, chains, or straps) while it is being loaded or unloaded. The driver must remain in the safety zone, where the site operator can see them clearly. It is the site operator's responsibility to ensure the driver stays clear of the vehicle during these activities. If the driver leaves the safety zone or moves out of the operator's direct line of sight, all project site movements must stop immediately.
- Once loading or unloading is complete, the site operator must move their vehicle out of the
  exclusion zone and notify the driver that it is safe to enter. Site equipment must not enter the
  exclusion zone while the driver is still inside (for example, while securing the load or adjusting
  gates or curtains).

If the site can only accommodate a three-meter exclusion zone on one side, as well as the front and rear of the truck, the exposed side should be protected by a barrier strong enough to withstand potential impacts. This will help safeguard pedestrians, vehicles, and project site from falling loads on that side of the truck.

### 1.7.5 Deployment of Traffic Marshal

The traffic marshal ensures that the vicinity of the school is clear and safe for the arrival and departure of the delivery vehicles. The marshal will also assist the delivery driver when it needs to maneuver.

The marshal then walks in front of the vehicle, removing any obstacles from its path while also staying alert for anything that could impede its movement or distract the driver. Once the path is clear, the marshal takes a safe position where the driver can see them and communicate, regardless of the

communication method used. For long-distance movements, the marshal repeats this process, ensuring each section of the route is clear and positioning themselves in a place where the driver can continue to see them.

In addition, the marshal must remain vigilant for other pedestrians and vehicles in the area. This broader situational awareness is essential for identifying potential hazards or issues before they arise and is just as important as any other aspect of the role. Moreover, the workers onsite can help the traffic marshal by keeping them up to date with possible changes in plans or delivery routes.

# Site Instruction No. \_\_\_

| Name of Project:  |  |
|---|--|
| Location:   |  |
|   |  |
| То:   |  |
| (Name and Address of Contractor)                                  |  |
|   | _  |
|   | <del>-</del>   |
|   | _  |
| Please be informed that during                                    | the site inspection the following were observed:         |
| 1   |  |
| 2   |  |
| 3<br>4  |  |
|   | re not in compliance with the ESMP/ECOP, specifically,   |
|   |  |
|   |  |
| <u>.</u>  |  |
| In this regard, you are hereby in                                 | nstructed to   |
|   |  |
| (State actions to be performed by the c for completion of action) | contractor as remedial measure/s and the target schedule |
| For your compliance.  |  |
|   |  |
|   |  |
|   | Project Engineer/DPWH                                    |
| Noted by:   |  |
| •   |  |
| District Engineer/Regional Director                               | _  |
| DISTRICT ENGINEER/ NEGIONAL DIFECTOR                              |  |

# **Inspection Checklist on Environment and Social Safeguard**

|  | Acceptable?<br>Yes/No | Remarks |
|--|-----------------------|---------|
| 1. Housekeeping  | 103/140               |         |
| Solid waste segregation bins (biodegradable, non-biodegradable, recyclables, residual wastes, construction debris) |                       |         |
| Waste bins removed regularly   |                       |         |
| ☐ Drainage system kept clear   |                       |         |
| Portable toilets (portalets) are clean   |                       |         |
| Clean and potable water available for workers  |                       |         |
| Passageways are clean  |                       |         |
| ☐ Materials are properly stored at site  |                       |         |
| ☐ Welding gas containers are organized   |                       |         |
| ☐ Billboard/sign is posted at the site   |                       |         |
| ☐ Materials delivery vehicles are parked properly  |                       |         |
| 2. Hazardous waste management:   |                       |         |
| <ul><li>Hazardous waste generator registration secured from DENR</li></ul>   |                       |         |
| <ul><li>Asbestos material management system (if applicable)</li></ul>  |                       |         |
| Separate hazardous waste bins/containers   |                       |         |
| Hazardous waste manifest available onsite  |                       |         |
| 3. Pollution Control Officer (PCO) onsite  |                       |         |
| 4. Health and Safety   |                       |         |
| Safety officer is onsite   |                       |         |
| ☐ Workers wearing proper PPEs  |                       |         |
| First-aid equipment is in-place  |                       |         |
| <ul><li>Workers comply with the COVID-19 control instructions</li></ul>  |                       |         |
| ☐ Working area is barricaded   |                       |         |
| ☐ Working area is well-lighted   |                       |         |
| Safety warning signs are available   |                       |         |
| ☐ Scaffoldings and braces firmly erected   |                       |         |
| Safety net installed (for works on outer surface of building)  |                       |         |
| Fire extinguishers available   |                       |         |
| Identify any inconveniences:   |                       |         |
| Identify any site accidents and safety incidents:  |                       |         |
| 5. Air pollution control   |                       |         |
| Area where adhesives are being applied or where welding activities are ongoing is well-ventilated                  |                       |         |
| Dust control measures are effective  |                       |         |
| Dust is being monitored (visually)   |                       |         |

|   | Acceptable?<br>Yes/No | Remarks |
|---|-----------------------|---------|
| Results of the onsite monitoring of TSP, PM2.5 and PM 10 are within the NAAQS guidelines. |                       |         |
| 6. Noise and vibration control  |                       |         |
| ☐ Noise and vibration managed   |                       |         |
| ☐ Noise is being monitored  |                       |         |
| Results of the noise monitoring are compliant with NPCC MC No. 002 Series of 1980         |                       |         |
| 7. Emergency response   |                       |         |
| Fire extinguishers available onsite   |                       |         |
| <ul><li>Spill control and management instruction available onsite</li></ul>               |                       |         |
| Workers are aware of emergency response procedures  |                       |         |
| Materials (rags, saw dust, sand, etc.) for oil spill management are available onsite      |                       |         |
| 8. Community complaints   |                       |         |
| Identify any community complaints received including issues                               |                       |         |
| from the school/health facility end-user about the construction                           |                       |         |
| activities:   |                       |         |
|   |                       |         |
| 9. Chance Find (as applicable)  |                       |         |
| Are there any chance find of artifact?  |                       |         |
| 10. Condition of Temporary Relocation Site of School/Health Facility                      |                       |         |
| Are temporary classrooms convenient and safe?   |                       |         |
| ☐ Is the temporary health facility operating well?  |                       |         |
| Identify issues from end-user about the temporary relocation                              |                       |         |
| sites:  |                       |         |
|   |                       |         |
| 11. Post-Construction   |                       |         |
| Work area cleaned up  |                       |         |
| ☐ There are no materials and wastes left onsite   |                       |         |
| Disturbed areas restored properly   |                       |         |